
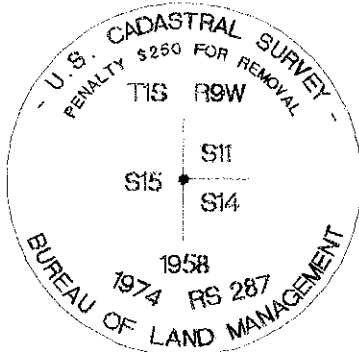


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: SW Section 11	TOWNSHIP 1 South	RANGE 9 West
COUNTY: Tillamook		DATE: 3-19-13
CORNER DESIGNATION: The Section Corner common to Sections 11 and 14 only, T. 1 S., R. 9 W., W.M.		(Please check one)
		<input type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input checked="" type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
		<input type="checkbox"/> Reset at surface
		<input type="checkbox"/> Referenced Out
Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0575 Page 217 (1958), Map A-1100 (1963), Map B-530 (1960-1967), Map A-2687 (1974), Tillamook County Survey Records.		
Found Monument(s) and Accessories (Condition & Source): Original Corner was set by GLO in 1857 as the Section Corner common to Sections 10, 11, 14 and 15. In 1884, GLO performed an independent survey of the remaining unsurveyed T. 1 S., R. 9 W., where it was determined that the corner of Sections 10 and 15 were not in common with the corner of Sections 11 and 14 and set a Closing Corner at this position. This monument was found and confirmed in a subsequent GLO survey in 1893. In 1958 BLM found no remaining evidence of the above stated corner and reset it at proportionate distance in latitude and record distance in departure from the corner of Sections 11 and 14 on the West boundary of Section 12. The monument is stamped as shown hereon. The monument was tied in Surveys A-1100 (1963) and B-530 (1960-1967). In 1974, John L. Carlich found this monument lying down, out of position, and reset it using compass rule adjustment as shown on Survey A-2687.		
Found 3" dia. Bureau of Land Management Brass Cap marked as shown hereon, up 1.0', on southerly side of a rotten hemlock stump. Monument is on the edge of a steep slide to the east. Found steel "T" post lying down.		
(GLO 1884) – Did not find the (5" Fir bearing S47° E 84 lks. [55.44']).		
(GLO 1884) – Did not find the (4" Fir bearing N 61°30' E 65 lks. [42.90']).		
(BLM 1958) – Did not find the (27" Hemlock bearing N 64°30' E 20.5 lks. [13.53']).		
(BLM 1958) – Did not find the (37" Fir bearing S 56°30' E 67 lks. [44.22']).		
() Indicates record information, Tillamook County Survey Records.		
[] Indicates record links converted to feet.		
Monument Set (Procedures and Description): N/A		Sketch of Found Monument: 
New Accessories set: Set 60 lbs. of concrete in a 12" dia. cylinder around monument. Set a 72" hat section post with a yellow metal location tag 3.0' North of the monument. Re-set found steel "T" post 3.0' South of the monument.		
New Bearing Trees Marked: *15" dia. Spruce bearing N 6° E 19.8', scribed, "T1SR9WS11BT", tagged and painted. *20" dia. Hemlock bearing S 84° W 5.0', scribed, "T1SR9WS15BT", tagged and painted.		
*Indicates an aluminum nail with a washer marked, "Till. Co. Surveyor" set in the face between the scribed "B" and "T" and a yellow metal location tag affixed in an upper blaze.		
Location & Comments: N/A		SURVEYOR'S SEAL 
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 1510 3 rd Street, Suite C Tillamook, Oregon 97141		
Party Chief: Joe Jensen, P.L.S. 60067, Deputy County Surveyor		
Notes: Digital images were taken of the monument and its accessories.		
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, P.L.S. 86926, Survey Technician		

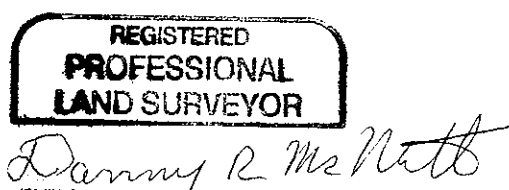