#### **Tillamook County**

## DEPARTMENT OF COMMUNITY DEVELOPMENT BUILDING. PLANNING & ON-SITE SANITATION SECTIONS

1510 - B Third Street Tillamook, Oregon 97141 www.tillamookcounty.gov



Land of Cheese, Trees and Ocean Breeze

# NESKOWIN COASTAL HAZARDS AREA PERMIT #851-24-000313-PLNG: Ready2Market/Wells Fargo Bank

NOTICE TO MORTGAGEE, LIENHOLDER, VENDOR OR SELLER: ORS 215 REQUIRES THAT IF YOU RECEIVE THIS NOTICE, IT MUST BE PROMPTLY FORWARDED TO THE PURCHASER

November 18, 2024

Dear Property Owner:

This is to confirm that the Tillamook County Department of Community Development **APPROVED WITH CONDITIONS** the above-cited request on November 19, 2024. A copy of the application, along with a map of the request area and the applicable criteria for review are available for inspection at the Department of Community Development office located at 1510-B Third Street, Tillamook, Oregon 97141 and can be found on the Community Development website: <a href="https://www.co.tillamook.or.us/commdev/landuseapps">https://www.co.tillamook.or.us/commdev/landuseapps</a>.

**Appeal of this decision.** This decision may be appealed to the Tillamook County Planning Commission, who will hold a public hearing. Forms and fees must be filed in the office of this Department before 4:00pm on December 2, 2024. This decision will become final on December 2, 2024, after 4:00pm unless an appeal is filed in accordance with Tillamook County Land Use Ordinance Article X.

**Request:** A request for approval of a Neskowin Coastal Hazard Area Permit for the construction of a

dwelling identified as Unit 11 of the Breakers Condominium, a rebuild of an existing unit

damaged by fire.

Location: Located within the Unincorporated Community Boundary of Neskowin and within the

Neskowin Coastal Hazards Overlay (Nesk-CH) Zone, accessed via Breakers Blvd, and designated as Tax Lot 94211 of Section 25CB in Township 5 South, Range 11 West of the

Willamette Meridian, Tillamook County, Oregon.

**Zone:** Neskowin Low Density Residential (NeskR-1)

Neskowin Coastal Hazards Overlay (Nesk-CH) Zone

Applicant: Ready2Market, 4237 SW Hwy 101, Lincoln City, OR 97367

**Property Owner:** Wells Fargo Bank, P.O. Box 41389, Austin, TX 78704

#### **CONDITIONS OF APPROVAL:**

The Conditions of Approval are as follows. Failure to comply with the Conditions of Approval may result in both nullification of this permit approval and enforcement action.

- 1. The applicant shall obtain all required permits from Federal, State and local agencies prior to development.
- 2. The Hazard Disclosure Statement (Exhibit C) shall be recorded in the Tillamook County Clerk's Office. A copy of the recorded statement shall be provided to the Department at the time of consolidated Zoning and Building application permit submittal.
- 3. Development of this property shall adhere to the development standards outlined in TCLUO Section 3.570: Neskowin Coastal Hazards Overlay (Nesk-CH) Zone.
- 4. Development of this property shall adhere to the development recommendations outlined in the Geotechnical Investigation (GHR) prepared by Adam Large, MSc, RB, CEG, of H.G. Schlicker and Associates, for the construction of the new (replacement) dwelling unit, dated April 23, 2024, (Exhibit B) including review of site development plans and observation of pile installation as detailed in Section 5.10 and Appendix E of the GHR.
- 5. The following supplemental information shall be provided to the Department of Community Development at the time of Zoning Permit application submittal:
  - a. Original copy of the stamped and signed letter from HGSA certifying the submitted plans (including plans for site preparation, grading, erosion control during and after construction, a stormwater management plan and vegetation removal/revegetation plan) are in conformance with the development standards outlined in the GHR (Exhibit B).
  - b. Grading plan clearly identifying all cuts and fills.
  - c. Stormwater Management plan consistent with the standards outlined in TLCUO Section 5.100: Neskowin Erosion Control and Stormwater Management. The stormwater management plan shall demonstrate management of surface water runoff at or behind the riprap structure to reduce potential erosion and structure failure.
  - d. Erosion control plan consistent with the standards outlined in TLCUO Section 5.100: Neskowin Erosion Control and Stormwater Management that identifying temporary measures to control runoff and erosion of soils/sand during construction.
  - e. Vegetation removal and revegetation plan.
- 6. Development of this property shall adhere to the development standards outlined in TCLUO Section 3.322: Neskowin Low Density Residential (NeskR-1) Zone. The maximum building height shall be limited to 24-feet as measured from existing/pre-construction grade.
- 7. This Neskowin Coastal Hazard Area Permit shall be valid for a period of two (2) years from the effective date of the decision (November 18, 2024). If development authorized by the permit is not initiated within this two (2) year time period, this Neskowin Coastal Hazard Area permit is expired.

Sincerely,

Tillamook County Department of Community Development

Melissa Jenck, CFM, Senior Planner

Sarah Absher, CFM, Director

Enclosed: Vicinity & Zoning Maps

#851-24-000313-PLNG: READY2MARKET/WELLS FARGO BANK

#### **Tillamook County**

#### DEPARTMENT OF COMMUNITY DEVELOPMENT

BUILDING, PLANNING & ON-SITE SANITATION SECTIONS



1510 – B Third Street Tillamook, Oregon 97141 www.tillamookcounty.gov 50.842.3408

Land of Cheese, Trees and Ocean Breeze

# NESKOWIN COASTAL HAZARD AREA PERMIT REQUEST #851-24-000313-PLNG: Ready2Market/Wells Fargo Bank ADMINISTRATIVE DECISION & STAFF REPORT

**Decision Date: November 18, 2024** 

**Decision:** <u>APPROVED WITH CONDITIONS</u> (This is not Building or Zoning Permit Approval)

Report Prepared by: Sarah Absher, CFM, Director

#### I. GENERAL INFORMATION

**Request:** A request for approval of a Neskowin Coastal Hazard Area Permit for the construction of a

dwelling identified as Unit 11 of the Breakers Condominium, a rebuild of an existing unit

damaged by fire (Exhibit B).

Located within the Unincorporated Community Boundary of Neskowin and within the

Neskowin Coastal Hazards Overlay (Nesk-CH) Zone, accessed via Breakers Blvd, and designated as Tax Lot 94211 of Section 25CB in Township 5 South, Range 11 West of the

Willamette Meridian, Tillamook County, Oregon.

**Zone:** Neskowin Low Density Residential (NeskR-1)

Neskowin Coastal Hazards Overlay (Nesk-CH) Zone

Applicant: Ready2Market, 4237 SW Hwy 101, Lincoln City, OR 97367

**Property Owner:** Wells Fargo Bank, P.O. Box 41389, Austin, TX 78704

**Property Description:** The subject property is part of the Breakers Condominium development is located at the intersections of Mount Angel Avenue and Breakers Boulevard, both County Roads, within the Neskowin Community Boundary (Exhibit A). The Breakers Condominium property is a corner lot, rectangular in shape, 1.29 acres in size, and located on dune complex with vegetative cover that consists primarily of lawn and beach grasses (Exhibits A and B). The dwelling unit is identified as Unit 11, located in the northeastern region of the development (Exhibits A and B). The dwelling unit proposed for construction is a replacement dwelling following damage of the dwelling by fire. The damage dwelling unit has been demolished. The dwelling unit is identified as Unit 11, located in the northeastern region of the development (Exhibits A and B). The development is within an area of NeskR-1 zoned property primarily developed with residential uses. The Breakers Condominium development and Unit 11 are bordered to the west by the Pacific Ocean, Sheridan Avenue, a County road to the south, Breakers Boulevard, also a County road, to the east, and Mount Angel, a

County road, to the north (Exhibit A). The replacement dwelling unit will be built within the same footprint as the previous unit, within the area identified on the plat for Unit 11, Breakers Condominium (Exhibit A & B).

The subject property is located within an Area of Special Flood Hazard as depicted on the FEMA Flood Insurance Rate Map (FIRM) #41057C1005F, dated September 28, 2018. Breakers Condominium Unit 11 (subject unit) is located within the VE Zone and is subject to ocean flooding (Exhibit A).

#### II. APPLICABLE ORDINANCE AND COMPREHENSIVE PLAN PROVISIONS

A. TCLUO Section 3.570: Neskowin Coastal Hazards Overlay (Nesk-CH) Zone

#### III. ANALYSIS:

A. TCLUO Section 3.570: Neskowin Coastal Hazards Overlay (Nesk-CH) Zone

- (1) PURPOSE: The purpose of the Neskowin Coastal Hazards Overlay Zone is to manage development in areas subject to chronic coastal hazards in a manner that reduces long term risks to life, property, and the community by:
- (a) Identifying areas that are subject to chronic coastal natural hazards including ocean flooding, beach and dune erosion, dune accretion, bluff recession, landslides, and inlet migration;
- (b) Assessing the potential risks to life and property posed by chronic coastal natural hazards; and
- (c) Applying standards to the site selection and design of new development which minimize public and private risks to life and property from these chronic hazards; such measures may include hazard avoidance and other development limitations consistent with Statewide Planning Goals 7 and 18 as well as the Hazards Element and Beaches and Dunes Element of the Tillamook County Comprehensive Plan.

Section 3.570(4)(c)(D) Procedure requires notification of the request to be mailed to landowners within 250-feet of the subject property and agencies in accordance with Article 10 of the TCLUO, to allow 14 days for written comment, and requires staff to consider comments received in making the decision.

**Findings:** Notice was mailed to property owners and agencies on October 3, 2024. No comments were received on this request.

- B. TCLUO Section 3.570(4)(e): A decision to approve a Neskowin Coastal Hazard Area Permit shall be based upon findings of compliance with the following standards:
  - (A) The proposed development is not subject to the prohibition of development on beaches and certain dune forms as set forth in subsection (8) of this section;

**Findings:** The subject property is within an exception area where there is no prohibition of development on beaches and certain dune forms as set forth in subsection 8 of TCLUO Section 3.570: Neskowin Coastal Hazards Overlay (Nesk-CH) Zone (Exhibit A).

(B) The proposed development complies with the applicable requirements and standards of subsections (6), (7), (8), and (10) of this section;

**Findings:** A Geotechnical Investigation (GHR) was prepared by Adam Large, MSc, RB, CEG, of H.G. Schlicker and Associates, for the construction of the new (replacement) dwelling unit (Exhibit B). Review of the GHR (Exhibit B) in relation to the applicable requirements and standards of subsections (6), (7), (8) and (10), Staff finds the following:

- The replacement unit is designed and constructed to meet applicable provisions of TCLUO Section 3.510: Flood Hazard Overlay Zone for construction of a dwelling in the VE Zone. Staff will require compliance with TCLUO Section 3.510 through demonstration of compliance with conditions of approval, requiring a Floodplain Development Permit prior to future construction.
- There are no proposals to partition the subject property.

- The proposal is for the construction of one (1) single family dwelling. The proposal is not increasing residential density on the property.
- The unit will be constructed within the same footprint as platted for Lot 11 of Breakers Condominium.
- Staff finds that (7)(c) does not apply.
- Foredune breaching is not proposed and foredune restoration is not proposed.
- This proposal does not include utilization of groundwater resources.
- Foredune grading is not proposed.
- The subject property is located within a Goal 18 Exception area.
- The property owner is not proposing a land division of the subject property.
- Applicant/Property Owner shall record a hazard disclosure statement as required in accordance with (4)(d)(F). Staff find this standard can be met through compliance with the conditions of approval.

#### (C) The geologic report conforms to the standards for such reports set forth in subsection (5) of this section;

**Findings:** The Geotechnical Investigation (GHR) was prepared by Adam Large, MSc, RB, CEG, of H.G. Schlicker and Associates, for the construction of the new (replacement) dwelling unit (Exhibit B). (Exhibit B). The GHR dated April 23, 2024, addresses the standards outlined in subsection (5) and includes a description of the subject property, a description of the fronting beach, analyses of erosion and flooding potential, and an assessment of potential reactions to erosion episodes (Exhibit B). A summary of the main engineering geologic concerns at the site are as follows:

- Site lies on poorly consolidated dune sands, subject to accretion and erosion from wind and wave attack.
- Site has shallow groundwater depths sensitive to tidal influences.
- Site lies within mapped 'VE' Flood zone, a coastal high hazard area as defined by FEMA.
- Site is within area subject to inherent risk of earthquakes and subsequent liquefaction.
- Site is within Tsunami Hazard Overlay Zone.

## (D) The development plans for the application conform, or can be made to conform, with all recommendations and specifications contained in the geologic report; and

**Findings:** The GHR includes development recommendations for site preparation, fills, vegetation removal and revegetation practices, foundation recommendations, drainage and stormwater management, erosion control, flooding considerations, and seismic considerations (Exhibit B).

Conditions of Approval have been made to ensure development of the subject property conforms to the recommendations and specifications contained in the GHR, including requirements for geotechnical review of construction plans prior to submittal for zoning and building permit review and a requirement for those site development inspections during construction as recommended in the GHR (Exhibit B).

(E) The geologic report provides a statement that, in the professional opinion of the engineering geologist, the proposed development will be within the acceptable level of risk established by the community, as defined in subsection (5)(c) of this section, considering site conditions and the recommended mitigation.

Findings: The GHR (Exhibit B) includes summary findings and conclusions that state:

- No adverse impacts are anticipated to occur on adjacent lots as a result of development of this site, provided that the recommendations detailed in the GHR are adhered to.
- Recommendation for mitigations of flooding and stormwater erosion have been incorporated in the GHR.
- Adverse effects of this development on surrounding areas will be minimized when all the stormwater, foundation, vegetation, and erosion control recommendations detailed in the GHR are adhered to.
- Stabilization programs for this site include vegetation and erosion stabilization, surface water collection and maintenance of the riprap revetment.

#### IV. DECISION AND CONCLUSION

Staff concludes the submitted Geologic Hazard Report (GHR) complies with the standards outlined in TCLUO Section 3.570(4)(e) and this project is therefore Approved with Conditions. All development activities shall conform to the Conditions of Approval outlined in Section V of this report. No further development shall occur on the subject property without prior land use approval. This approval does not address any additional development of the subject property.

By accepting this approval the applicant and property owner agrees to indemnify, defend, save and hold harmless Tillamook County, and its officers, agents, and employees from any claim, suit, action or activity undertaken under this approval, including construction under a Building Permit approved subject to this approval. The applicant /property owner shall obtain all of the necessary local, state, and federal permits and comply with all applicable regulations for the proposed construction.

**Appeal of this decision.** This decision may be appealed to the Tillamook County Planning Commission, who will hold a public hearing. The forms and fees must be filed in the office of this Department before 4:00 PM on December 2, 2024.

#### V. CONDITIONS OF APPROVAL

The Conditions of Approval are as follows. Failure to comply with the Conditions of Approval may result in both nullification of this permit approval and enforcement action.

- 1. The applicant shall obtain all required permits from Federal, State and local agencies prior to development.
- 2. The Hazard Disclosure Statement (Exhibit C) shall be recorded in the Tillamook County Clerk's Office. A copy of the recorded statement shall be provided to the Department at the time of consolidated Zoning and Building application permit submittal.
- 3. Development of this property shall adhere to the development standards outlined in TCLUO Section 3.570: Neskowin Coastal Hazards Overlay (Nesk-CH) Zone.
- 4. Development of this property shall adhere to the development recommendations outlined in the Geotechnical Investigation (GHR) prepared by Adam Large, MSc, RB, CEG, of H.G. Schlicker and Associates, for the construction of the new (replacement) dwelling unit, dated April 23, 2024, (Exhibit B) including review of site development plans and observation of pile installation as detailed in Section 5.10 and Appendix E of the GHR.
- 5. The following supplemental information shall be provided to the Department of Community Development at the time of Zoning Permit application submittal:
  - a. Original copy of the stamped and signed letter from HGSA certifying the submitted plans (including plans for site preparation, grading, erosion control during and after construction, a stormwater management plan and vegetation removal/revegetation plan) are in conformance with the development standards outlined in the GHR (Exhibit B).
  - b. Grading plan clearly identifying all cuts and fills.
  - c. Stormwater Management plan consistent with the standards outlined in TLCUO Section 5.100: Neskowin Erosion Control and Stormwater Management. The stormwater management plan shall demonstrate management of surface water runoff at or behind the riprap structure to reduce potential erosion and structure failure.
  - d. Erosion control plan consistent with the standards outlined in TLCUO Section 5.100: Neskowin Erosion Control and Stormwater Management that identifying temporary measures to control runoff and erosion of soils/sand during construction.
  - e. Vegetation removal and revegetation plan.
- 6. Development of this property shall adhere to the development standards outlined in TCLUO Section 3.322: Neskowin Low Density Residential (NeskR-1) Zone. The maximum building height shall be limited to 24-feet as measured from existing/pre-construction grade.


7. This Neskowin Coastal Hazard Area Permit shall be valid for a period of two (2) years from the effective date of the decision (November 18, 2024). If development authorized by the permit is not initiated within this two (2) year time period, this Neskowin Coastal Hazard Area permit is expired.

#### VI. EXHIBITS

- A. Assessor's Map, Zoning Map, FEMA FIRM
- B. Applicant submittal
- C. NeskCH Overlay Hazard Disclosure


# **EXHIBIT A**

Vicinity Map

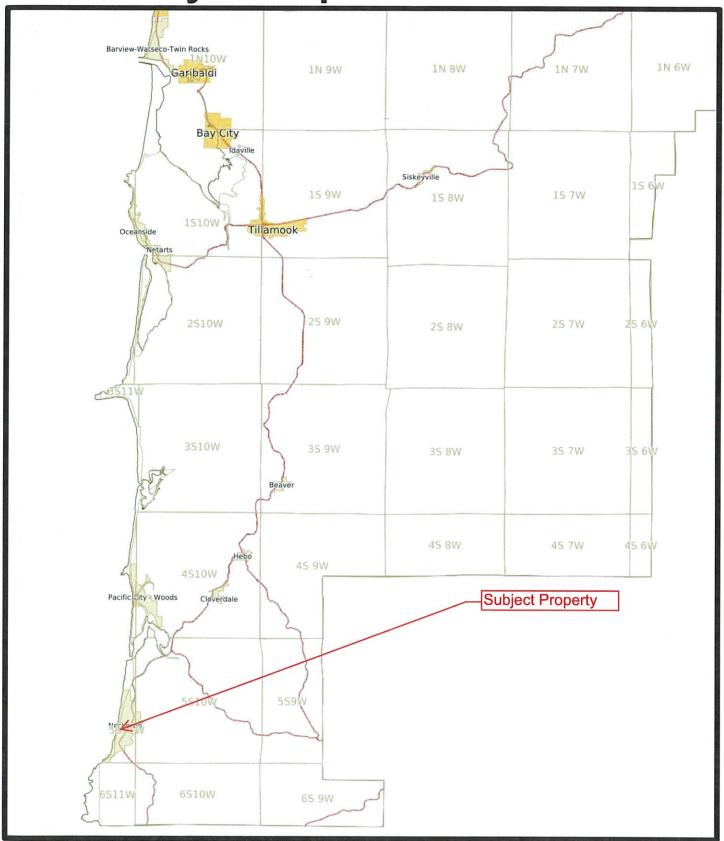

# Zoning Map




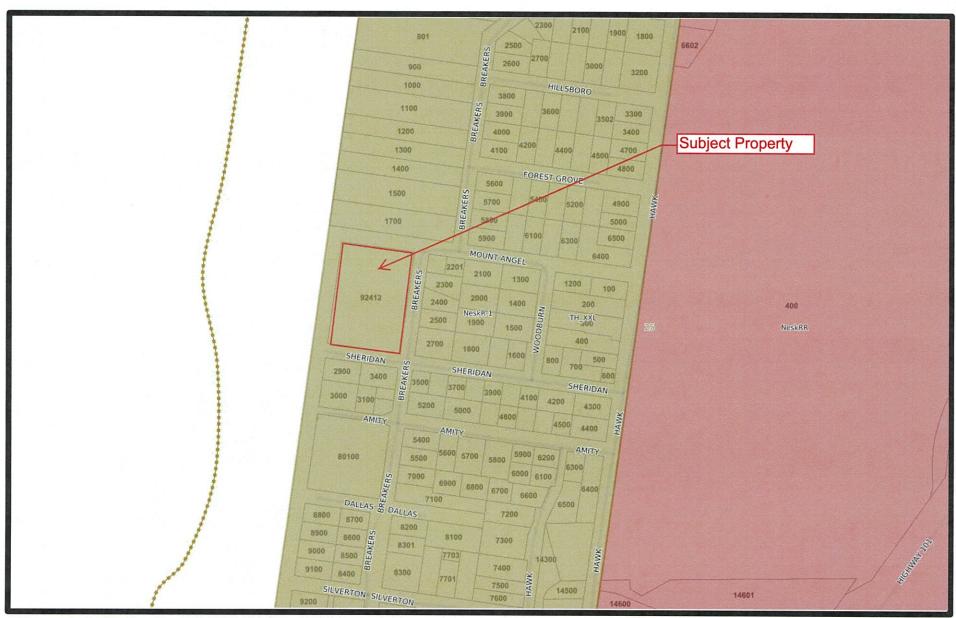

Generated with the GeoMOOSE Printing Utilities

# NeskCH Overlay Mapping



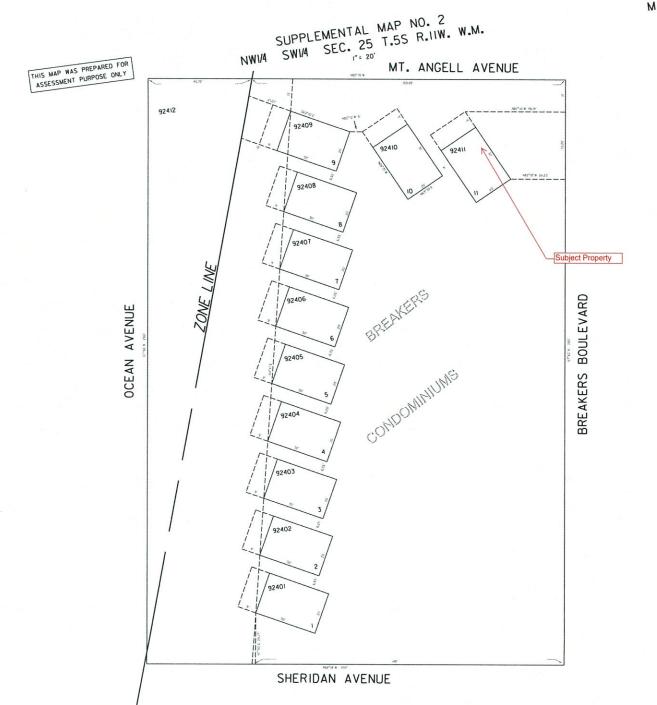

5S II 251 SUPPLEMENT MAP NO Revised 04/27/05



#### **Tillamook County** 2023 Real Property Assessment Report

**Account 254673** 

Map

5S1125CB92411

**Tax Status** 

Subtype

Assessable

Code - Tax ID

2207 - 254673

**Account Status** 

Active **NORMAL** 

**Legal Descr** 

**BREAKERS CONDO** 

Lot - UNIT 11

Mailing

WELLS FARGO BANK, N.A. TRUSTEE

% RE0054610 PO BOX 35605

DALLAS TX 75235

Sales Date/Price

Deed Reference # 2021-5546

**Appraiser** 

06-24-2021 / \$0 KARI FLEISHER

**Property Class** 

112

MA

SA

NH

**Value Source** 

**RMV Class** 

Code Area

Area

Code

Area

112 09

RFPD Ex Zone

01 052

Site Situs Address

City

Value Summary

**RMV** 

MAV

AV

**RMV Exception** 

CPR %

**Grand Total** 

ID#

Land Breakdown

Code Plan

Trend

Size Land Class

Trended RMV

**Class Description** 

Improvement Breakdown

Year Stat Built

Trend

% Total Sqft Ex% MS Acct

Trended RMV

**Exemptions / Special Assessments / Notations** 

#### **Notations**

- ACT OF GOD RMV & MAV ADJUSTED 308.146 ADDED 2023
- ACT OF GOD PRORATED 308.425 ADDED 2022
- DESTROYED OR DAMAGED PROPERTY, JULY 1 ASMT DATE 308.146(6) ADDED 2023


#### Comments

5/25/04 Added year built and changed stat class. dv. 8/11/09 Changed stat to 143.LM

2/27/15 Added sq ft to condo. SLK

6/16/23 Owner applied for July 1 re-assessment. Condo unit was damaged during a fire that occurred on Sept

2022. Condo was fully demolished prior to July 1. Adjusted RMV/MAV. KF

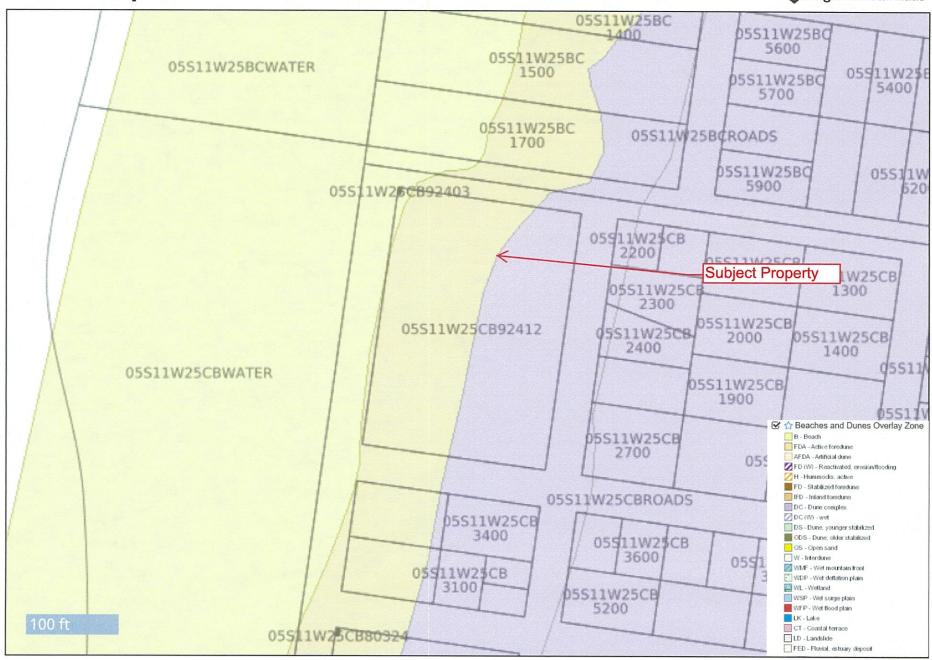


Disclaimer: The spatial information hosted at this website was derived from a variety of sources. Care was taken in the creation of these themes, but they are provided "as is". The state of Oregon, or any of the data providers cannot accept any responsibility for errors, omissions, or positional accuracy in the digital data or underlying records. There are no warranties, expressed or implied, including the warranty of merchantability or fitness for a particular purpose, accompanying any of these products. However, notification of any errors would be appreciated. The data are clearly not intended to indicate the authoritative location of property boundaries, the precise shape or contour of the earth or the precise location of fixed works of humans.

### **Hazard Map - Geologic**

#### Oregon Coastal Atlas



Disclaimer: The spatial information hosted at this website was derived from a variety of sources. Care was taken in the creation of these themes, but they are provided "as is". The state of Oregon, or any of the data providers cannot accept any responsibility for errors, omissions, or positional accuracy in the digital data or underlying records. There are no warranties, expressed or implied, including the warranty of merchantability or fitness for a particular purpose, accompanying any of these products. However, notification of any errors would be appreciated. The data are clearly not intended to indicate the authoritative location of property boundaries, the precise shape or contour of the earth or the precise location of fixed works of humans.

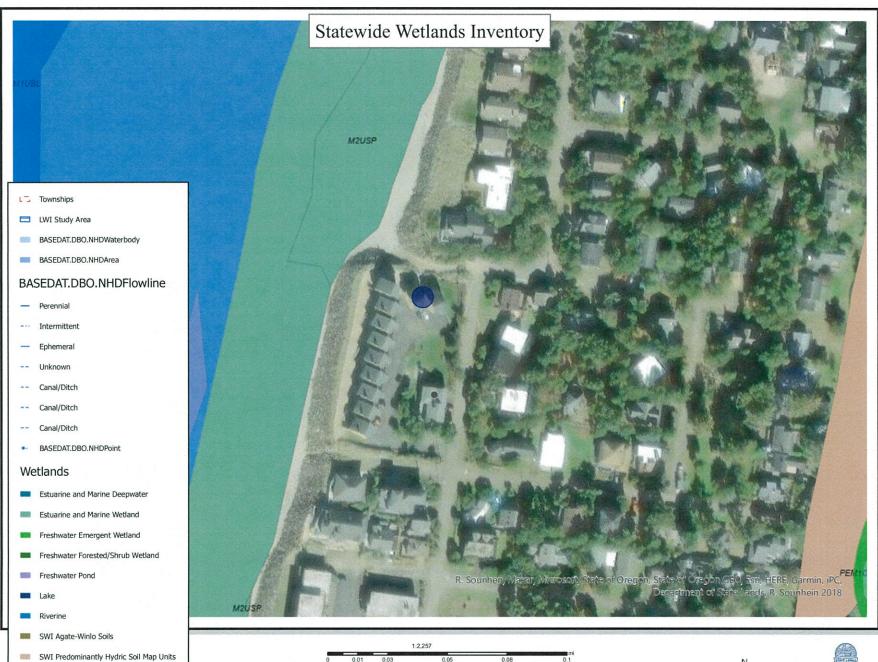

The Statewide Wetlands Inventory (SWI) represents the best data available at the time this map was published and is updated as new data becomes available. In all cases, actual field conditions determine the presence, absence and boundaries of wetlands and waters (such as creeks and ponds). An onsite investigation by a wetland professional can verify actual field conditions. Z

# EXHIBIT B



Tillamook County Department of Community Development

1510-B Third Street. Tillamook, OR 97141 | Tel: 503-842-3408 Fax: 503-842-1819

www.co.tillamook.or.us

### PLANNING APPLICATION

Address: 4237 SW HI City: Lincoln City Star Email: n2moregon@gma Property Owner Name: WELLS FARGO BANK, NA AS TRUSTEE Name: of the Cael O'Donnell Forceskie Trust Address: P.O. Box XXXXXX 41389	ne: 503-863-0064 NY 101 te: 0R Zip: 97367	Denied Received by: \$5 Receipt #: 13795+ (AU30) Fees: 1345 Permit No: 851-9-00019-PLNG
Request: To rebuild ho	ouse post fire	
Type II	Type III	Type IV
☐ Farm/Forest Review	☐ Detailed Hazard Report	☐ Ordinance Amendment
☐ Conditional Use Review	☐ Conditional Use (As deemed	☐ Large-Scale Zoning Map
☐ Variance	by Director)	Amendment
340 T TO 1.00 TO TO	_	☐ Plan and/or Code Text
Exception to Resource or Riparian Setba		Amendment
□ Nonconforming Review (Major or Minor		Allerances
☐ Development Permit Review for Estuary	☐ Nonconforming Review (As	
Development	deemed by Director)	
□ Non-farm dwelling in Farm Zone	☐ Variance (As deemed by	
Foredune Grading Permit Review	Director)	
Neskowin Coastal Hazards Area	Directory	
Location: Site Address: 48060 Break	ers Blvd. #11, Nest	cowin OR 97149
	1 West Map # 55/125	
Township	Range	Section Tax Lot(s)
Clerk's Instrument #:		
Authorization		
This permit application does not assure per	mit approval. The applicant and/or pro	perty owner shall be responsible for
obtaining any other necessary federal, state	e, and local permits. The applicant verif	ies that the information submitted is
complete, accurate, and consistent with otl	ner information submitted with this app	olication.
		06/03/2024
by: Jose Mota, V.P.		Date
Property Owner Signature (Required)		117.1
Alala XIX		6/2/24
Applicant Signature		, frate

Geotechnical Investigation (Phase 2)
Tax Lot 92411, Map 5S-11W-25CB Supp. Map No. 2
Lot-Unit 11, 48060 Breakers Boulevard
Neskowin, Tillamook County, Oregon

Prepared for:
Breakers Condominium
Attn: Glenn Garrett, HOA President
16476 NW Racely Court
Portland, Oregon 97229

H.G. Schlicker & Associates, Inc.

607 Main Street, Suite 200 · Oregon City, Oregon 97045 (503) 655-8113 · FAX (503) 655-8173

Project #Y234676B

April 23, 2024

To:

**Breakers Condominium** 

Attn: Glenn Garrett, HOA President

16476 NW Racely Court Portland, Oregon 97229

Subject:

Geotechnical Investigation (Phase 2)

Tax Lot 92411, Map 5S-11W-25CB Supp. Map No. 2

Lot-Unit 11, 48060 Breakers Boulevard Neskowin, Tillamook County, Oregon

#### Dear Mr. Garrett:

The accompanying report presents the results of our geotechnical investigation (phase 2) for the above subject site.

After you have reviewed our report, we would be pleased to discuss it and to answer any questions you might have.

This opportunity to be of service is sincerely appreciated. If we can be of any further assistance, please contact us.

H.G. SCHLICKER & ASSOCIATES, INC.

Adam M. Large, MSc, RG, CEG

President/Principal Engineering Geologist

AML:mgb

### TABLE OF CONTENTS

		Page
1.0	Introduction and Project Description	1
2.0	Site Description	2
3.0	Geologic Mapping, Investigation and Descriptions	2
3.1	Subsurface Exploration and Observations	2
3.2	Liquefaction Hazards	3
4.0	Flooding Hazards	4
5.0	Conclusions and Recommendations	5
5.1	Development Density	6
5.2	Locations for Structures and Roads – Safest Site	6
5.3	Grading Practices	6
5.4	Vegetation Removal and Re-Vegetation Practices	6
5.5	Deep Foundations	7
5.6	Drainage and Stormwater Management	8
5.7	Erosion Control	8
5.8	Flooding Considerations	9
5.9	Seismic Considerations	9
5.10	Plan Review and Site Observations	9
5.11	Worker Safety	10

#### **TABLE OF CONTENTS (continued)**

	the first of the contract $oldsymbol{r}$	age
6.0	Summary Findings and Conclusions	. 10
6.1	Proposed Use	. 10
6.2	Hazards to Life, Property, and the Environment	. 10
6.3	Off-Site Protection	. 11
6.4	Stabilization Programs	. 11
6.5	Conclusions Regarding Hazards and Adverse Environmental Effects	. 11
6.6	Recommendations for Further Work	. 11
7.0	Limitations	. 11
8.0	Disclosure	. 12
9.0	References	12

#### **FIGURES**

Figure 1 – Site Topographic Map Figure 2 – Slope Profile A-A'

#### **APPENDICES**

Appendix A – Site Photographs
Appendix B – Boring Logs
Appendix C – Liquefaction Analysis
Appendix D – Pile Analysis

Appendix E - Checklist of Recommended Plan Reviews and Site Observations

Project #Y234676B

April 23, 2024

To:

**Breakers Condominium** 

Attn: Glenn Garrett, HOA President

16476 NW Racely Court Portland, Oregon 97229

Subject:

Geotechnical Investigation (Phase 2)

Tax Lot 92411, Map 5S-11W-25CB Supp. Map No. 2

Lot-Unit 11, 48060 Breakers Boulevard Neskowin, Tillamook County, Oregon

Dear Mr. Garrett:

#### 1.0 Introduction and Project Description

At your request and authorization, we visited the subject site on November 2, December 13, 2023, and February 15, 2024, to complete a geotechnical investigation. Previously, we completed a Geologic Hazards Investigation (Phase 1) (dated May 23, 2023) at Tax Lot 92411, Map 5S-11W-25CB Supp. Map No. 2, Lot-Unit 11, 48060 Breakers Boulevard, Neskowin, Tillamook County, Oregon. In our earlier report, we recommended that a second-phase investigation be completed to explore and characterize subsurface materials at the site and provide geotechnical recommendations for deep foundations. It is our understanding that you are planning to construct a new house at the site.

This report addresses the subsurface conditions at the site and provides geotechnical recommendations for construction. The scope of our work consisted of a review of our previous geologic hazards report, site observations and measurements, subsurface exploration using a mud rotary drill rig, in-situ soil testing, and soil sampling, geotechnical analysis, and a report of our findings, conclusions and geotechnical recommendations for design and construction. This report also includes some, but not all, of the information from our earlier report for ease of use by the reader. For permitting purposes, both our previous report (Phase 1) and this report (Phase 2) should be submitted to the county.

#### 2.0 Site Description

The subject site consists of Tax Lot 92411, Map 5S-11W-25CB Supp. Map No. 2, which is approximately 20 feet wide and 30 feet deep. The rectangular-shaped lot is located on a younger stabilized dune at the Breakers Condominiums in the community of Neskowin, Oregon (Figure 1). The site is one of eleven condominium tax lots located within Tax Lot 92412, Map 5S-11W-25CB, which encompasses the greater area of the Breakers Condominiums.

An oceanfront protective structure (riprap revetment) is located on the dune slope approximately 105 feet west of the site; this revetment is contiguous with other revetments to the north and south (Appendix A). However, a gap in the riprap is present at the nearby beach access northwest of the site. The condominium property surrounding the site is bounded to the west by the beach and the Pacific Ocean, to the north by Mt. Angel Avenue, to its east by Breakers Boulevard, and to its south by Sheridan Avenue.

During our previous Geologic Hazards Investigation the site was occupied by a fire-damaged residential structure and attached deck. Since the time of our previous work, the damaged house was demolished, the foundation was removed for equipment access, and a drilling pad was graded using sand (Appendix A). Based on our review of the document provided to us, a surveyor completed an elevation certificate before the demolition of the previous structure.

#### 3.0 Geologic Mapping, Investigation and Descriptions

The site lies in an area that has been mapped as Pleistocene beach sand (Schlicker et al., 1972). Neskowin lies on a large dune complex, which is approximately 4 miles long, north to south and extends from the coastline east to the base of the hills. This dune complex consists of numerous individual dunes which vary in age and stability. The area of the site has been mapped as a younger stabilized dune (open dune sand conditionally stable), which is a dune that has become conditionally stable regarding wind erosion (USDA et al., 1975). More recent mapping also identifies the area of the site as recently stabilized dunes (Allan, 2020). The dune consists of tan, loose, fine-grained sand with a thin, moderately developed topsoil. Under the Land Conservation and Development Commission (LCDC) classification system, the site is a Dune, Younger Stabilized.

#### 3.1 Subsurface Exploration and Observations

At the time of our February 15, 2024, site visit, we completed one mud rotary boring with a CME-75 drill rig operated by Western States Soil Conservation to a depth of approximately 60 feet below the ground surface (bgs). Sampling was completed by obtaining and observing select cuttings brought up by the auger, and observing materials

recovered in split spoon samples from Standard Penetration Tests (SPTs) conducted at selected depth intervals to obtain in situ soil strength data based on penetration resistance (blow counts or "N" values). A geologist from our office visually classified and logged the soils encountered in the borehole according to the Unified Soil Classification System (USCS). A detailed description of subsurface conditions encountered during boring is provided in Appendix B, and the approximate location of the borehole is shown on Figures 1 and 2.

The boring generally encountered approximately 15 feet of loose to medium dense sand overlying approximately 20 feet of wet to saturated, dense sand from approximately 15 to 35 feet, underlain by organic-rich soft silty sand and peat from approximately 35 to 45 feet. From approximately 45 to 60 feet, dense to very dense, wet to saturated sand was encountered. Groundwater was encountered at approximately 12.5 feet.

#### 3.2 Liquefaction Hazards

#### Liquefaction

Liquefaction occurs when saturated, cohesionless soils are subjected to ground vibrations, resulting in a decrease in volume of the soil. If drainage is unable to occur, the tendency to decrease in volume results in an increase in pore water pressure, and if the pore water pressure builds up to the point at which it is equal to the overburden pressure, the effective stress becomes zero, and the soil loses its strength and develops a liquefied state. Liquefaction is most common in saturated, loose, granular soils, sand or silty sand materials. Cohesive soils, such as clayey silt and clay, will generally not liquefy during earthquakes. Older sediments are also more resistant to liquefaction than recently deposited sediments (Idris and Boulanger, 2008).

To determine the liquefaction potential of the site, we used the computer program LiquefyPro by CivilTech Software, which utilizes methods recommended by the 1996 NCEER Workshop to calculate liquefaction and seismic-induced settlement potential (Martin et al., 1999) (Appendix C).

For our analysis, we used an 8.8 magnitude Cascadia Subduction Zone earthquake, site-modified peak ground acceleration for Site Class D (default soil) of 0.77g, and the depth to water was set at 12.5 feet below the ground surface.

Based on our analysis, two zones of the soil column at the site are prone to liquefaction during the design earthquake due to the low strength, non-cohesive nature of sands near the groundwater table and the soft, organic-rich silty sands and peat. The liquefiable zones are estimated between approximately 12.5 to 16 feet and 34 to 43 feet.

DOGAMI's HazVu website (https://gis.dogami.oregon.gov/maps/hazvu/) has mapped the area of the site as having a high susceptibility to liquefaction. DOGAMI states:

"Buildings and infrastructure sitting on these soils are likely to be severely damaged in an earthquake."

#### Settlement

Settlement can be the result of liquefaction of saturated soils or simply a result of dry soil densifying under vibration (volumetric compression). Volumetric compression during an earthquake is the result of vibrations of the soil, which causes soil particles to settle into a denser state, decreasing the volume of the soil. The degree of settlement is primarily dependent upon the initial density of the soil and the magnitude and duration of ground vibration (shaking). Settlement caused by liquefaction is commonly differential, and the magnitude of settlement typically varies throughout a site, whereas settlement caused by volumetric compression tends to be more uniform.

Based on our analysis, the total amount of earthquake-induced liquefaction and volumetric compression is estimated at approximately 6.99 inches, and differential settlements can be expected to be as much as  $^{1}/_{2}$  to  $^{2}/_{3}$  of the total or approximately 3.5 to 4.7 inches (Appendix C). Because this settlement occurs above the recommended pile tip embedment depth, we would expect little to no settlement of a house founded on the recommended pile below.

#### 4.0 Flooding Hazards

Based on the 2018 Flood Insurance Rate Map (FIRM, Panel #41057C1005F), the area of the site lies in an area rated as Zone VE (EL 32), defined as a special flood hazard area with base flood elevations determined, and subject to inundation by the 1-percent-annual-chance flood event with additional hazards due to storm-induced velocity wave action.

The beach and revetment area west of the site lies in an area rated as Zone VE (EL 41.3 feet) (NAVD 88), which is defined as a special flood hazard area with base flood elevations determined, and subject to inundation by the 1-percent-annual-chance flood event with additional hazards due to storm-induced velocity wave action. The area east of the revetment and west of the site lies in an area rated as Zone VE (EL 33), defined as a special flood hazard area with base flood elevations determined and subject to inundation by the 1-percent-annual-chance flood event with additional hazards due to storm-induced velocity wave action; the area east of the site is mapped as an area rated as Zone AE (EL 25) which is defined as an area of 1-percent-annual-chance of being flooded and wave heights are less than 3 feet.

Based on the Oregon Department of Geology and Mineral Industries mapping (DOGAMI, 2012), the subject site lies within the tsunami inundation zone resulting from an approximately 8.7 and greater magnitude Cascadia Subduction Zone (CSZ) earthquake. The 2012 DOGAMI mapping is based upon 5 computer-modeled scenarios for shoreline tsunami

inundation caused by potential CSZ earthquake events ranging in magnitude from approximately 8.7 to 9.1. The January 1700 earthquake event (discussed in Section 4.7 above) has been rated as an approximate 8.9 magnitude in DOGAMI's methodology. More distant earthquake source zones can also generate tsunamis.

#### 5.0 Conclusions and Recommendations

The main engineering geologic concerns at the site are:

- 1. The site lies on dune sands, which are poorly consolidated and subject to accretion and erosion from wind and wave attack. Inherent risks of coastal erosion and future dune sand movement and accretion activity at this site must be accepted by the owner, future owners, developers, and residents.
- 2. The site has shallow groundwater depths that are sensitive to tidal influences. Seasonal variation of groundwater depth and tidal influences can contribute to flooding at the site, particularly during storm events.
- 3. The site is mapped in a FEMA VE (EL 32) and is subject to a one percent or greater chance of flooding in any given year. The site lies in a coastal high hazard area, defined as an area of special flood hazard subject to high-velocity wave action from storms and seismic sources. These risks must be accepted by the owner, future owners, developers and residents of the site.
- 4. There is an inherent regional risk of earthquakes along the Oregon Coast which could cause harm and damage structures. Ground shaking during an earthquake can cause soils to liquefy, resulting in loss of bearing capacity and structural damage. The site also lies in a mapped tsunami inundation hazard zone. A tsunami impacting the Neskowin area could cause harm, loss of life, and damage to structures. These risks must be accepted by the owner, future owners, developers and residents of the site.

#### Recommendations

Based on FEMA FIRM mapping and liquefaction potential, we recommend that new or substantially improved buildings at the site be supported on a deep foundation system. Foundations in V Zones should be on piers or piling capable of resisting simultaneous wind and flood loads (with wave action). Foundations will need to support vertical loads and provide support in the event of coastal erosion encroaching in the new foundation area. Foundations will also need to resist uplift forces, particularly for any cantilever-type house design. An open foundation or breakaway wall design may be necessary for the area below the lowest floor. V Zone standards should apply to the site, and we recommend that you design to these standards.

Typically, the lowest horizontal structural members of the new building should be a minimum of 1 foot or more above base flood elevations. Additional freeboard may be necessary.

During construction, disturbed, dry sands may be blown by winds, which can result in transport and deposition of sands off-site. Therefore, periodic watering or covering of exposed areas may be required to control blowing sands during windy conditions.

The following recommendations should be adhered to.

#### 5.1 Development Density

It is our understanding that only one single-family residence will be located at the site.

#### 5.2 Locations for Structures and Roads - Safest Site

Due to the lot's small size, we anticipate that the new house will occupy the entire site. No new roads or driveways are anticipated; existing access to the site is provided by the common parking lot.

Please note, that the Oregon Coast is a dynamic and energetic environment. Most of the coastline along this stretch of beach is slowly receding and will continue to recede in the future. Geologic conditions and the rates of geologic processes can change in the future.

#### 5.3 Grading Practices

We recommend the following grading practices:

Any organic soils, disturbed soils, and any existing fills should be stripped from grade beams, driveway, and slab areas prior to construction.

Based on the existing topography and the lot size at the site we do not anticipate significant temporary or permanent cuts and fills or grading to occur during construction.

Based on the FEMA Flood mapping, the use of permanent fill for structural support is not recommended. Any temporary grading and fill work necessary for equipment and construction access should be limited and indicated on the plan set.

#### 5.4 Vegetation Removal and Re-Vegetation Practices

Vegetation should be removed only as necessary, and exposed areas should be replanted following construction. Disturbed ground surfaces exposed during the wet season (November 1 through April 30) should be temporarily planted with grasses or protected with erosion control blankets or hydromulch.

#### 5.5 Deep Foundations

We recommend that the new house be placed on elevated beams supported on pile or columns with the lowest horizontal structural member no lower than 1 foot above the base flood elevation. We recommend that the foundation system consist of drilled and gravity grouted micropile.

#### 5.5.1 Gravity Grouted Micropile

We provide the following allowable micropile loads for 8 and 10-inch (drilled hole) diameter, 48 feet embedment length, gravity grouted pile based on grout-to-ground bond strengths from Table 5-21 in the Federal Highway Administration National Highway Institutes Micropile Design and Construction Reference Manual. The allowable loads were calculated with conservative bond ultimate strength values of 11 psi (1,584 psf) for the loose to medium sands between 12.5 and 35 feet and 14 psi (2,016 psf) for the dense sand between 43 and 48 feet. Bond ultimate strength for the upper 12.5 feet of fill and loose sands and the organic-rich silty sand and peat between approximately 35 and 43 feet were assumed to be negligible.

The use of permanent steel casing in the upper 12.5 feet of each pile is acceptable. All other temporary casing used during pile construction should be removed to achieve the assumed grout-to-ground strength used in our analysis.

The micropile capacities were determined using Allpile, version 7.8c, by Civiltech Software. Allowable bearing capacities and pullout resistance are provided below, and additional results from our analyses are provided in Appendix D.

GRAVITY GROUTED PILE ALLOWABLE	ELOADS	
Pile (Drilled Hole) Diameter	8 inches	10 inches
Allowable Pile Loads (Compression) (FOS = 2.5) <sup>a</sup>	38 kips	47 kips
Allowable Pile Loads (Tension) (FOS = 2.5) <sup>a</sup>	39 kips	50 kips

<sup>&</sup>lt;sup>a</sup> A representative of HGSA should observe pile installation operations and verify achieved embedment depths on-site. Please provide us with at least five (5) days' notice prior to any needed site observations.

The house can be placed on individual piles that extend up to the lowest horizontal framing member. Pile spacing and design can vary with the size and type of pile utilized, and the project's structural engineer should determine the above-ground elements of the foundation system. HGSA should work with the structural engineer and architect during the foundation design process.

Grade beams at the existing ground level can be used for lateral bracing based on structural considerations. Any new slab or flatwork at existing grade under the new house should be structurally independent of and detached from the pile foundation system and/or any grade beams.

Guidance and standards for breakaway walls and alternatives for breakaway walls below the BFE are provided in TCLUO 3.510 (10) (e) and FEMA-NFIP Technical Bulletin 9/September 2021.

Prior to construction, the foundation contractor should provide a work plan for HGSA's review (also refer to Appendix E).

A representative of HGSA should observe all pile construction and installation operations to ensure that suitable materials have been encountered and address any issues that may arise during construction (Appendix E).

Any structures and all structural elements should be designed to meet the current Oregon Residential Specialty Code (ORSC) and Oregon Structural Specialty Code (OSSC) seismic requirements.

#### 5.6 Drainage and Stormwater Management

Surface water shall be diverted from building foundations and walls to approved disposal points by grading the ground surface to slope away a minimum of 2 percent for 6 feet towards a suitable gravity outlet to prevent ponding near the structures.

All roof and footing drains shall be discharged to an approved disposal point. If water will be discharged to the ground surface, we recommend that energy dissipaters, such as splash blocks or a rock apron, be utilized at all pipe outfall locations. Water collected on the site shall not be concentrated and discharged to adjacent properties.

#### 5.7 Erosion Control

As detailed above, vegetation should be removed only as necessary, and exposed areas should be replanted following construction. Disturbed ground surfaces exposed during the wet season (November 1 through April 30) should be temporarily planted with grasses or protected with erosion control blankets.

A temporary sediment fence should be installed around and downslope disturbed areas of the site until permanent vegetation cover can be established.

#### 5.8 Flooding Considerations

The recommendations provided herein are based on guidelines by FEMA and Tillamook County for construction within a coastal special flood hazard area. Adverse effects of coastal flooding will be minimized when all recommendations detailed in this report are adhered to. However, the site lies in an area subject to potential ocean flooding and erosion. These risks must be accepted by the owner, future owners, developers and residents of the site.

#### 5.9 Seismic Considerations

The structure and all structural elements should be designed to meet current Oregon Residential Specialty Code (ORSC) and Oregon Structural Specialty Code (OSSC) seismic requirements as applicable. Based on the guidelines recommended in the ORSC and OSSC, the structure should be designed to meet the following seismic parameters:

SEISMIC DESIGN PARAMETERS	
Site Class	D
Seismic Design Category	$D_2$
Mapped Spectral Response Acceleration for Short Periods	$S_S = 1.295g$
Site Coefficient	$F_a = 1.200$
Design Spectral Response Acceleration at Short Periods	$S_{DS} = 1.036g$
Site-modified peak ground acceleration	$PGA_{m} = 0.77$

#### 5.10 Plan Review and Site Observations

#### Design Review

This report pertains to a specific site and development. It is not applicable to adjacent sites, nor is it valid for types of development other than that to which it refers. Any variation from the site or development plans necessitates a geotechnical review in order to determine the validity of the design concepts evolved herein.

HGSA's review of final plans and specifications is necessary to determine whether the recommendations detailed in this report have been properly interpreted and incorporated into the design and construction documents. At the completion of our review, we will issue a letter of conformance to the client for the plans and specifications.

#### Construction Monitoring

Because of the judgmental character of geotechnics, as well as the potential for adverse circumstances arising from construction activity, observations during site preparation, excavation, and construction will need to be carried out by a representative of HGSA or our designate. These observations may then serve as a basis for confirmation and/or alteration of geotechnical recommendations or design guidelines presented herein to the benefit of the project.

Field observations become increasingly important should earthwork proceed during adverse weather conditions. Oregon Structural Specialty Code requires full-time inspection of deep foundation construction by a qualified professional.

Also, it is our understanding that Tillamook County now requires us to complete an additional site visit and summary letter at the end of construction to obtain an occupancy permit. Please provide us with 5 days' notice prior to the needed observations.

#### 5.11 Worker Safety

All construction activities should be completed in accordance with OSHA standards and all State and local laws, rules, regulations, and codes.

#### 6.0 Summary Findings and Conclusions

Our summary findings and conclusions are presented below:

#### 6.1 Proposed Use

The proposed project consists of constructing a residential structure on the site. No new roads are anticipated. No adverse impacts are anticipated to occur on adjacent lots as a result of the development of this site, provided that the recommendations detailed in this report are adhered to.

#### 6.2 Hazards to Life, Property, and the Environment

Hazards to life, property and the environment associated with this proposed use include flooding, ocean wave erosion, and seismic hazards. Recommendations for mitigation of liquefaction, settlement, and oceanfront flooding and erosion have been incorporated into this report. Please note that the risk of these hazards is inherent with development and construction in this part of Tillamook County and must be assumed by the owner, future owners, developers, and residents.

#### 6.3 Off-Site Protection

Protection of the surrounding areas from any adverse effects of this development will be minimized when all the stormwater, vegetation, and erosion control recommendations detailed in this report are adhered to.

#### 6.4 Stabilization Programs

Stabilization programs for this site include vegetation and erosion stabilization, as addressed in Sections 5.4 and 5.7 of this report, and surface water collection, as addressed in Section 5.6 of this report.

#### 6.5 Conclusions Regarding Hazards and Adverse Environmental Effects

Adverse environmental effects will be minimized by following the recommendations detailed in this report during the design and construction of the proposed project.

#### 6.6 Recommendations for Further Work

Assuming the recommendations provided herein are adhered to, no additional investigation or analysis is required by our firm other than review of site development plans and observation of pile installation as detailed in Section 5.10 and Appendix E of this report.

#### 7.0 Limitations

The Oregon Coast is a dynamic environment with inherent, unavoidable risks to development. Landsliding, erosion, tsunami, storms, earthquakes and other natural events can cause severe impacts to structures built within this environment and can be detrimental to the health and welfare of those who choose to place themselves within this environment. The client is warned that, although this report is intended to identify the geologic hazards causing these risks, the scientific and engineering communities' knowledge and understanding of geologic hazard processes is not complete. This report pertains to the subject site only and is not applicable to adjacent sites nor is it valid for types of development other than that to which it refers. Geologic conditions including materials, processes and rates can change with time and therefore a review of the site and/or this report may be necessary as time passes to assure its accuracy and adequacy.

The boring logs and related information depict generalized subsurface conditions only at these specific locations and at the particular time the subsurface exploration was completed. Soil and groundwater conditions at other locations may differ from the conditions at these boring locations. Also, the passage of time may result in a change in the soil and groundwater conditions at the site.

Our investigation was based on engineering geological reconnaissance and a limited review of published information. The data presented in this report are believed to be representative of the site. The conclusions herein are professional opinions derived in accordance with current standards of professional practice and no warranty is expressed or implied. The performance of this site during a seismic event has not been fully evaluated. If you would like us to do so, please contact us. This report may only be copied in its entirety.

#### 8.0 Disclosure

H.G. Schlicker & Associates, Inc. and the undersigned Certified Engineering Geologist have no financial interest in the subject site, the project or the Client's organization.

#### 9.0 References

- Allan, J. C., 2020, Temporal and Spatial Changes in Coastal Morphology, Tillamook County, Oregon: Oregon Department of Geology and Mineral Industries, Open-File Report O-20-04, 27 p. report, geodatabase, metadata.
- DOGAMI, 2012, Tsunami inundation maps for Neskowin, Tillamook County, Oregon: Oregon Department of Geology and Mineral Industries, TIM-Till-114 maps.
- Idris, I. M., and Boulanger, R. W., 2008, Soil Liquefaction During Earthquakes: Earthquake Engineering Research Institute, 243 p.
- Martin, G. R., Lew, M. K., Baez, A. J. L., Blake, T. F., Ghardi, E. F., Hsu, G. D., Kupferman, S., O'Tousa, J., Real, C. R., Reeder, W., Simantob, E., and Youd, T. L, 1999, Guidelines for analyzing and mitigating liquefaction in California: Southern California Earthquake Center, Recommended Procedures for Implementation of DMG Special Publication 117, 63 p.
- Schlicker, H. G., Deacon, R. J., Beaulieu, J. D., and Olcott, G. W., 1972, Environmental geology of the coastal region of Tillamook and Clatsop Counties, Oregon: Oregon Department of Geology and Mineral Industries, Bulletin 74, 164 p., maps.
- USDA Soil Conservation Service, and Oregon Coastal Conservation and Development Commission, 1975, Beaches and dunes of the Oregon Coast: 161 p.

Project #Y234676B Page 13

It has been our pleasure to serve you. If you have any questions concerning this report, or the site, please contact us.

Respectfully submitted,


H.G. SCHLICKER AND ASSOCIATES, INC.



EXPIRES: 12/31/2024


Adam M. Large, MSc, RG, CEG President/Principal Engineering Geologist

AML:mgb

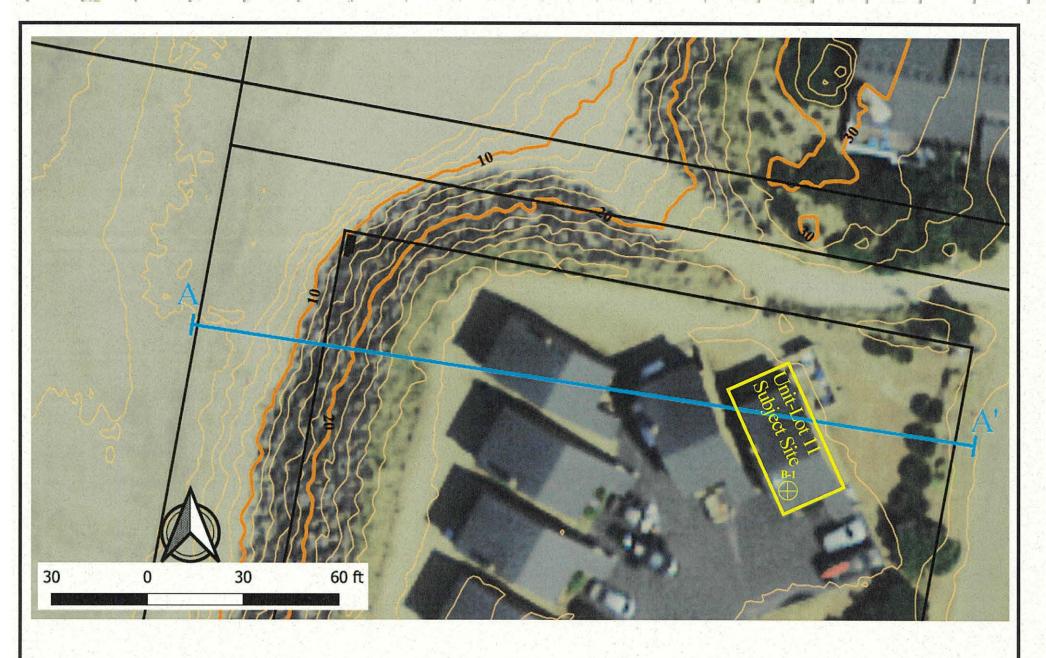

Imagery provided by 2018 Oregon Explorer
Topographic data derived from West\_Coast\_2016\_El\_Nino Lidar data from NOAA
All locations and dimensions are approximate.

= Approximate location of drilled boring

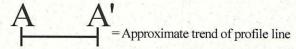

Date: 04/23/2024

Scale: 1" = 30'

**Project #Y234676B** 


Prepared by: MGB

Approved by: AML

Site Topographic Map Tax Lot 92411, Map 5S-11W-25CB Supp. No. 2; Lot-Unit 11 48060 Breakers Blvd, Neskowin, Tillamook County, Oregon



H.G. Schlicker & Associates, Inc. Figure 1

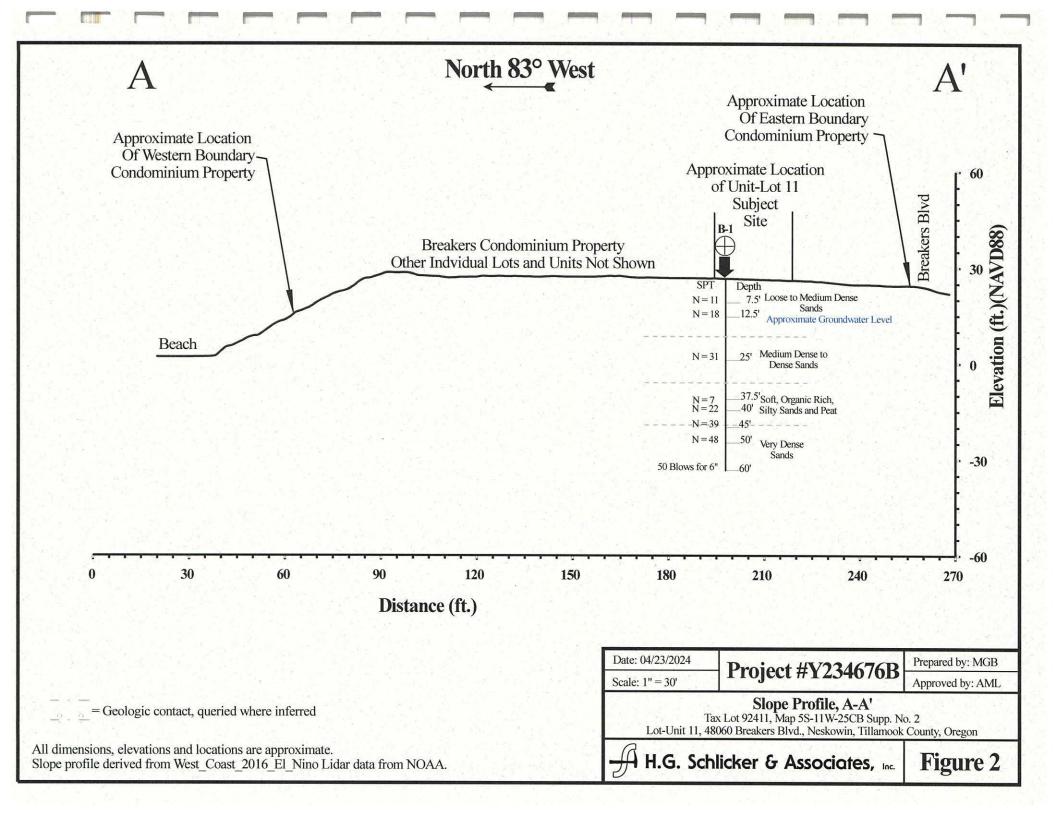

Appendix A
- Site Photographs -



Photo 1 - View of the foundation of the previous house at the site after demolition.



Photo 2 – View of the drill rig set up at the location of Boring B-1.



Photo 3 –View of the loose to medium dense, fine-grained sand recovered between 10 to 11.5 feet depth in Boring B-1.



Photo 4 – View of the dense, silty sand recovered between 25 to 26.5 feet depth in Boring B-1.



Photo 5 – View of the dense, medium to coarse-grained sand with shell fragments recovered between 30 to 31.5 feet depth in Boring B-1.



Photo 6 – View of the soft/loose, clayey, silty sand with decaying wood fragments recovered between 37 to 38.5 feet depth in Boring B-1.



Photo 7 – View of the very dense silty sand with decaying wood fragments recovered between 50 to 51.5 feet depth in Boring B-1.



Photo 8 – Close-up view of the very dense, fine-grained, clean sand recovered between 60 to 61.5 feet depth in Boring B-1.

Appendix B - Boring Logs -

### **BORING LOG EXPLANATION**

MAJOR	DIVISIONS	GROUP SYMBOL*	GROUP NAME		
OARSE-GRAINED SOILS	GRAVELS	GW	Well-graded gravel		
SOILS		GP	Poorly-graded gravel		
		GM	Silty gravel		
		GC	Clayey gravel		
	SANDS	sw	Well-graded sand		
		SP -	Poorly-graded sand		
		SM	Silty sand		
		SC	Clayey sand		
FINE-GRAINED SOILS	SILTS AND CLAYS	ML	Silt with low plasticity.		
SOILS	Liquid Limit Less than 50	CL	Clay with low plasticity		
		OL	Organic silt or organic clay with low plasticity		
	SILTS AND CLAYS	МН	Silt with high plasticity		
	Liquid Limit 50 or more	СН	Clay with high plasticity		
		ОН	Organic silt or organic clay with high plasticity		
HIGHLY OR	GANIC SOILS	PT	Peat, Muck, and other highly organic soils.		

<sup>\*</sup> NOTE: the symbol RK (not within the USCS system) is used in our logs to denote rock materials.

### SAMPLE TYPE

SPT = Standard Penetration Test and Split-Barrel Sampler (ASTM D1586); 1 3/8-inch I.D.

2.5" = Modified 2.5-inch I.D. Split-Barrel Sampler.

Shelby = Thin-Walled Tube Sampler (ASTM D1587); 3-inch O.D.

### Sampling Interval

			[10] (프라이트 (1985년 - 1985년 - 1
L	= No sample attempted	= Location of retrieved sample.	= Location where sample was attempted with no recovery.

### Standard Penetration Test (SPT)

Blows per 6" = Number of blows required to drive SPT sampler 6 inches using a 140 Lb. hammer dropped from a height of 30 inches (recorded in three 6" intervals).

N = Standard Penetration Resistance: Number of blows (N) required to drive SPT sampler 12 inches using a 140 Lb. hammer dropped from a height of 30 inches (ASTM D1586).

P = Indicates that SPT sampler was pushed 6 inches with only the weight of the hammer or drill stem (N = 0)


		ny: We			_		reakers Condo e	Project #: Y234676B Boring #: B1				
								Sheet 1 of 4				
oler T	ype:	2.	5" Split B	arrel	2.8"	Shelby T	ube SPT		ling Time			
e Wt.	3	1		Lbs	Fall		30 In.	Start	Finish			
Vater	Level	9.11				Time	Date	Time: ~10am	Time: ~1pm			
			~12.5 to	o ~15	1	N. W. T. S.						
	36.	8 6 0				7.7.		Date: 2/15/2024	Date: 2/15/2024			
eld Pe	rsonr	iel:				asing De	pth: (Ft.)	Ground Elevation	ı: ~26 (Fi			
ws pe	r 6"	N	Sample Type	Depth (Ft.)		USCS	Description					
				0	0. 4	FILL	Loose fill sand in area of p	revious foundation.				
2	1	7	CDT	2.5		GD.						
3	4	1	SPI	2.5		SP	Sand; medium brown with ~8" recovered in split spoor	dark grains, moist, l n.	loose, medium grained			
4	6	10	SPT	5		SP	Sand; medium brown, mois	t, loose to medium	dense, medium graine			
7 - Ag		33.50										
5	6	11	SPT	7.5		SP	Sand; medium brown, mois ~8" recovered in split spoor	t, loose to medium on.	dense, medium graine			
5	5	10	SPT	10		SP	Sand; gray-brown, moist, lo	oose to medium den	se, fine grained.			
8	10	18	SPT	12.5		SP	Sand; medium brown with omedium grained. ~9" recover	dark grains, wet, me ered in split spoon.	edium dense, fine to			
							Groundwater					
11	12	23	SPT	15		SM		grains, wet to satu	rated, medium dense,			
							Sand Sand					
14	18	32	SPT	17.5		SP			medium grained.			
		7										
	ing Coig: CME ig: CME	Sing Companies   Companies	Sign   Company: West   West   State   State	Solid Auge   Sol	Solid Auger 4"	Sang Company: Western States   Solid Auger 4"   Holid	Sing Company: Western States   States					

				Oregon estern Sta	tes	_	b Name: Br	reakers Condo	<b>Project #:</b> Y23467 <b>Boring #:</b> B1	6B	
	Rig: CMI			olid Auge		He	ollow Auger	Rotary Wash	Sheet 2 of 4		
Sam	pler T	ype:		5" Split B			8" Shelby Tu		Drilling Time		
	e Wt.			40	Lbs	Fa		30 In		Finish	
V	Vater	Level	33 13	Depth	(ft.)	Time Date			Time: ~10am	Time: ~1pm	
				~12.5 to		187					
					2-11				Date: 2/15/2024	Date: 2/15/2024	
: Fi	eld Pe	rsonn	el:	M. P	ordal		Casing Dep	oth: (Ft.)	Ground Elevation		
		_		Sample	Depth				Ground Elevation	20 (1)	
Ble	ows pe	r 6"	N	Type	(Ft.)	1	USCS	Description			
10	14	18	32	SPT	20		SP	Sand; brown with dark min	parale wat to coturate	ad danca	
10	1.7	10	32	51.1	20		51	~9" recovered in split spo		eu, delise.	
-			200					recovered in spin spo	on.		
	-	- 1				-					
	1			7 2 2 2 3							
					22.5						
					22.5	1 3					
2.	5-8		3.5	11 12 15 1			19 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1				
1	0-6	24	-31		11111	1					
	11 77					TV.					
		18				E f					
10	15	16	31	SPT	25		SM	Silty Sand; brown, wet to s	saturated, dense. Silt	to medium grained	
			NAME OF	(52 - 23)			San Mary	with a few ~1/4" pebbles a			
Side	VEC 16						Harris II	~10" recovered in split spe			
72	E/ 10				5 20 1	17.	S. 10 C. S. A.				
	7	150	0.0			4	THE CO				
31/1					27.5						
7				GRAB	21.5	- 46	GW-Shelle	Pebbles and Shell fragmen	te coming un in drilli	ing fluid saraan	
	7		1	CICAD	7	-	O W-DHEIIS	and Shell fragmen	is coming up in drill	ing fluid screen	
X-1 1970											
7		-		Service I		200		7 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1			
15	17	20	37	SPT	30		CW	Co. 1. 1. 1			
13	17	20	31	SFI	30		SW	Sand; dark gray, wet to sat With shell fragments and r		im to coarse grained.	
-		2 J. A. S.	-								
1	- VIII		-	De la Contraction de la Contra				~10" recovered in split spo	OII.		
X											
135		1, =1			20.5						
	3 14 15	× (e)	- 1	13/6/13	32.5		1150				
	3 10		13/3/1	117-6							
	S 15 8			2 8 10 70			1 1 1 1 1 1 1				
100	1	35-6		3		5	112				
100						- 1					
1.3	10-1-24			GRAB	35	2	PT	Peat, fine organics, and she	ell fragments. Sulfur	Smell	
		Win.	10 300		7-26	1.5					
N. P.		al, I			H SE OF		Mark Street				
1 5 V		1	1.51		V 10 T	177					
1,11	1 King	44.75		14 A	Mark Street	Ē	ST 5. 154				
2	3	4	7	SPT	37.5		PT/SM	Organic Rich Clayey Silt a	nd Silty Sand: dark o	ray, moist soft/loose	
	719	1 35						Decaying wood debris and	organics. ~15" recov	vered in split spoon	
		77.0		- J. 1 - W					3	- Franchoom	
				77							
				7.7							
							11.5.00				

_	Location: Neskowin, Oregon  Drilling Company: Western States					_	b Name: I	Control of the State of the Sta	Condo			Project #: Y234676B			
						_	iller: Shar				Boring #: B1				
	Rig: CMI			olid Auger		_	llow Auge		Rotary Wash	4 9	Sheet <u>3</u> of <u>4</u>				
	pler T	ype:		5" Split B		_	" Shelby T		SPT		Drilli	ing Time			
	e Wt.			40	Lbs	Fa	ll:	3	30	In.	Start	Finish			
V	Vater	Level		Depth		13.0	Time		Date	-	Time: ~10am	Time: ~1pm			
			7/2	~12.5 to	~15										
		wide years a solit		11.5				V 1971	- (12) Turkey S		Date: 2/15/2024	Date: 2/15/2024			
Fi	eld Pe	rsonr	iel:	M. B			Casing De	pth:	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	(Ft.)	Ground Elevation:	~26 (Ft			
Blo	ows pe	r 6"	N	Sample Type	Depth (Ft.)		USCS	Descr	iption						
5	10	12	22	SPT	40		SM	Silty	Sand; dark gray,	wet to	o saturated, loose/so	ft. Silt to fine sand.			
			2 32		18,200						cs, and ~1" wood fra	agment. ~15"			
			1 3- 1					recov	ered in split spoo	n.					
2.3		×	100		10.5										
					42.5										
						$\forall$									
The second	7				100		PT	Wood	debris, organics	. clay	ey peat coming up o	on drilling fluid			
	4. 3	J. Tak	FIR				P. Pay		and the second	, Juy	-, pour coming up c	arming mala			
15	21	18	39	SPT	45		SM	Silty S	Sand; dark gray, v	wet to	saturated, dense. S	ilt to fine sand.			
r e									rganics. ~13" rec						
					APP T			113							
1155	dia						resting.								
- 1															
		0 0 E30			47.5	2									
	- 123	77													
V 1/2						$\vdash$									
75	E 2														
12	20	28	48	SPT	50		SM	Silty S	Sand; dark gray, v	wet to	saturated, dense. S	ilt to fine sand.			
1		4.34						550	2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2		of sampler. ~11" re				
1.7															
10			2.7	100	17.17			0							
	1 12 1				100										
- 1					52.5										
Mil.				4 13.											
2 44			8,												
35	50	Separate III	50+	SPT	55	-10	SP Sand; medium gray, wet to saturated, very dense.								
	50	7.		211			Fine grained, no silt or organics. ~10" recovered in split sp								
			7 -					1 }	, no biit oi	0.50		a in spire spoon.			
. *					156,3										

Appendix C
- Liquefaction Analysis-

# LIQUEFACTION ANALYSIS

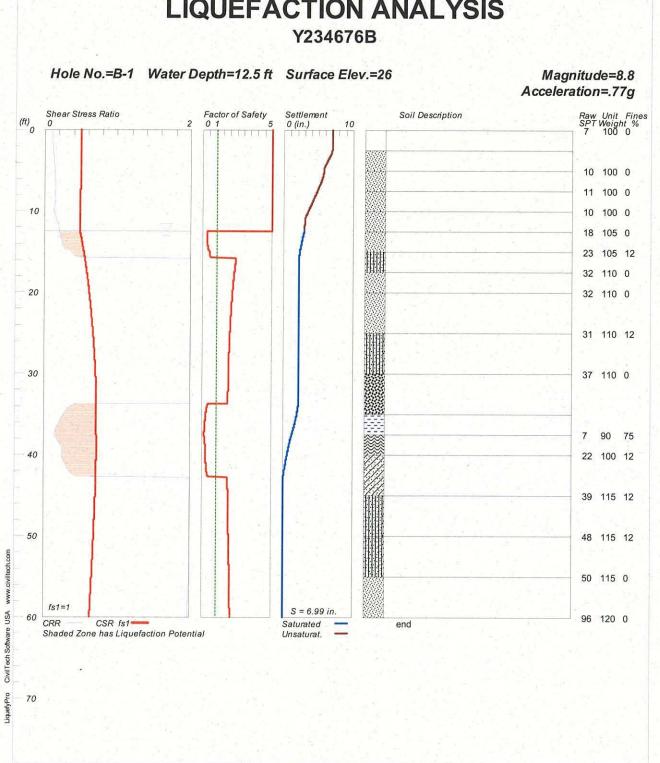

**CivilTech Corporation** 

**Breakers** 

Plate A-1

Appendix D
- Pile Analysis -


- 8-inch Micropile -

www.civiltech.co

Licensed to

### **FOUNDATION PROFILE & SOIL CONDITIONS**


For uplift and compression, one no-friction steel casing section and one high pressure grouted section.

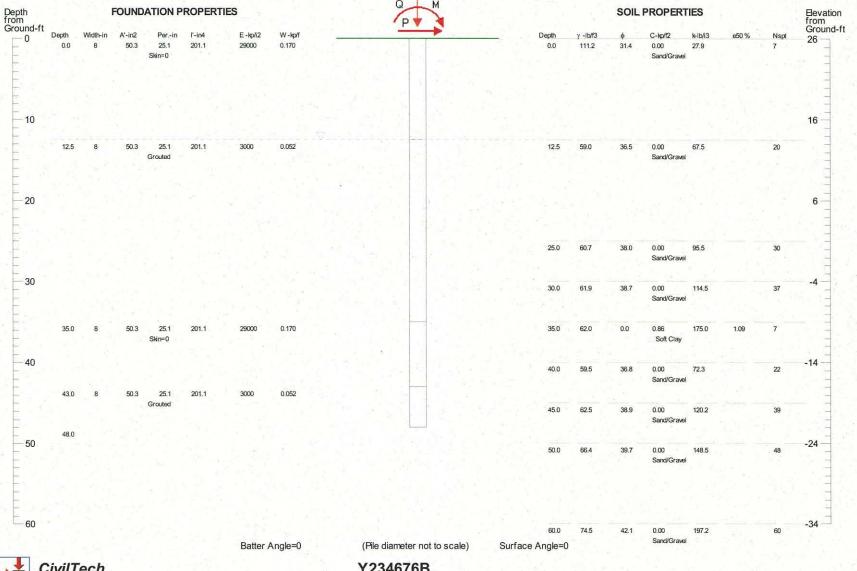

CivilTech Software

Y234676B Breakers 8inch

Figure 1

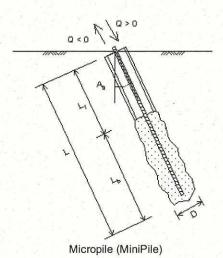

#### Loads:

Load Factor for Vertical Loads = 1.0 Load Factor for Lateral Loads = 1.0 Loads Supported by Pile Cap= 0 % Shear Condition: Static

Vertical Load, Q= 25.0 -kp Shear Load, P= 0.0 -kp Moment, M= 0.0 -kp-f

#### Profile:

Pile Length, L= 48.0 -ft Top Height, H= 0 -ft Slope Angle, As= 0 Batter Angle, Ab= 0

Soil D	ata:		1.15				Pile Da	ata:					1901
Depth -ft	Gamma -lb/f3	Phi	C -kp/f2	K -lb/i3	e50 or Dr %	Nspt	Depth -ft	Width	Area -in2	Per. -in	l -in4	E -kp/i2	Weight -kp/f
0	111.2	31.4	0.00	27.9	27.34	7	0.0	8	50.3	25.1	201.1	29000	0.170
12.5	59.0	36.5	0.00	67.5	54.06	20	12.5	8	50.3	25.1	201.1	3000	0.052
25	60.7	38.0	0.00	95.5	65.80	30	35.0	8	50.3	25.1	201.1	29000	0.170
30	61.9	38.7	0.00	114.5	72.63	37	43.0	8	50.3	25.1	201.1	3000	0.052
35	62.0	0.0	0.86	175.0	1.09	7	48.0		r -				
40	59.5	36.8	0.00	72.3	56.25	22							
45	62.5	38.9	0.00	120.2	74.55	39							
50	66.4	39.7	0.00	148.5	83.29	48							
60	74.5	42.1	0.00	197.2	95.94	60							

### Vertical capacity:

Weight above Ground= 0.00 Total Weight= 4.15-kp \*Soil Weight is not included Side Resistance (Down)= 95.263-kp Side Resistance (Up)= 95.263-kp Tip Resistance (Down)= 0.000-kp Tip Resistance (Up)= 0.000-kp Total Ultimate Capacity (Down)= 95.263-kp Total Ultimate Capacity (Up)= 99.415-kp Total Allowable Capacity (Down)= 38.105-kp Total Allowable Capacity (Up)= 39.766-kp OK! Qallow > Q

### Settlement Calculation:


At Q= 25.00-kp Settlement= 0.02702-in At Xallow= 1.00-in Qallow= 99999.00000-kp

Note: If the program cannot find a result or the result exceeds the upper limit. The result will be displayed as 99999.



Y234676B Breakers 8inch

# SOIL STRESS, SIDE RESISTANCE, & AXIAL FORCE vs DEPTH Based on Ultimate Load Condition

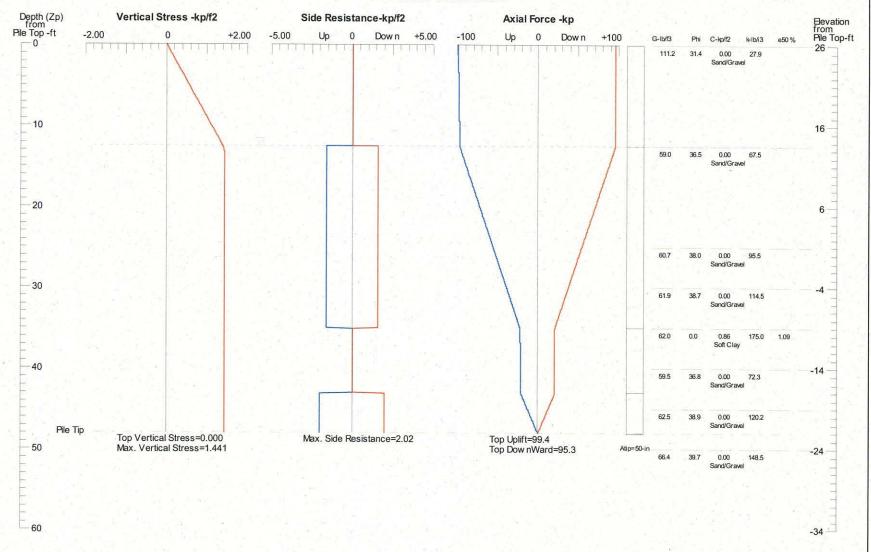





Y234676B **Breakers 8inch** 

Figure 1

# **ALLOWABLE CAPACITY vs FOUNDATION DEPTH**

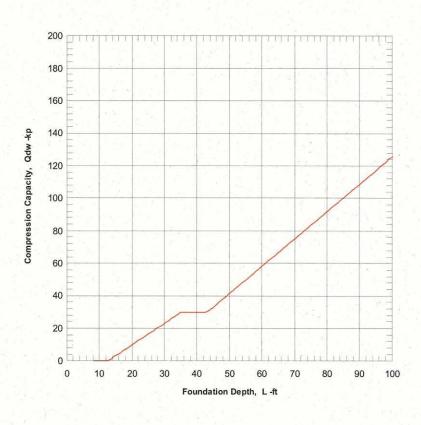


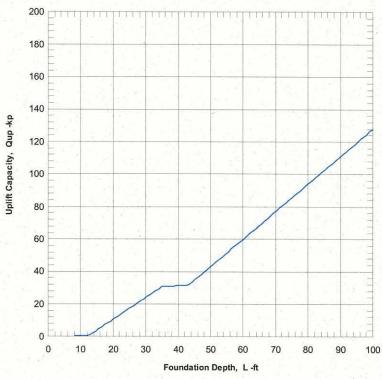



Y234676B Breakers 8inch

# Vertical Load vs. Settlement

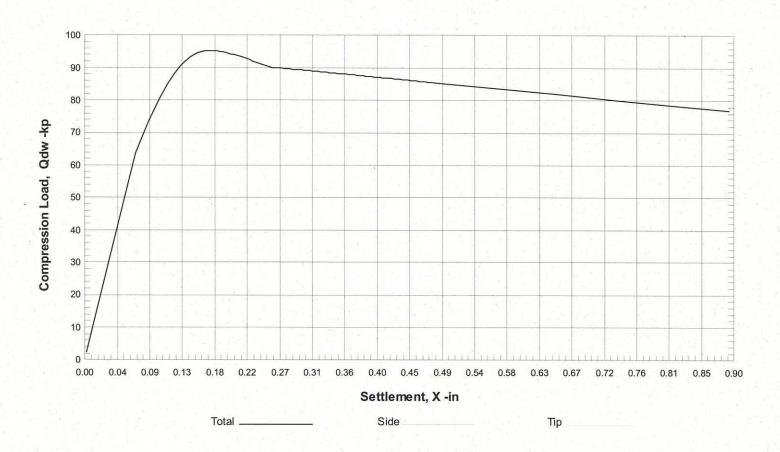

CivilTech Software Y234676B Breakers 8inch

Figure 1

- 10-inch Micropile -

www.civiltech.com

Licensed to

### **FOUNDATION PROFILE & SOIL CONDITIONS**


For uplift and compression, one no-friction steel casing section and one high pressure grouted section.

pth m ound-ft			OUND	ATION P	ROPERTI	IES		QM			SOIL	PROPERT	TES			⊟evatio from
ound-11 0  	Depth 0.0	Width-in 10	A'-in2 78.5	Perin 31.4 Skin=0	l'-in4 490.9	E -kp/i2 29000	W-kp/f 0.266		Depth	γ -lb/f3 111.2	ф 31,4	C-lq/f2 0.00 Sand/Gravel	k-lb/i3 27.9	e50 %	Nspt 7	Ground- 26
10																16
	12.5	10	78.5	31.4 Grouted	490.9	3000	0.082		12.5	59.0	36.5	0.00 Sand/Gravel	67.5		20	
20																6
									25.0	60.7	38.0	0.00 Sand/Gravel	95.5		30	
30									30.0	61.9	38.7	0.00 Sand/Gravel	114.5		37	-4
	35.0	10	78.5	31.4 Skin=0	490.9	29000	0.266		35.0	62.0	0.0	0.86 Soft Clay	175.0	1.09	7	
-40	43.0	10	78.5	31.4	490.9	3000	0.082		40.0	59.5	36.8	0.00 Sand/Gravel	72.3		22	-14
	48.0			Grouted					45.0	62.5	38.9	0.00 Sand/Gravel	120.2		39	
-50									50.0	66.4	39.7	0.00 Sand/Gravel	148.5		48	-24
-60																-34
50						Batter A	Angle=0	(File diameter not to scale)	60.0 Surface Angle=0	74.5	42.1	0.00 Sand/Gravel	197.2		60	



Y234676B Breakers 10inch

Figure 1

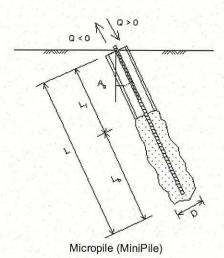

### Loads:

Load Factor for Vertical Loads = 1.0 Load Factor for Lateral Loads = 1.0 Loads Supported by Pile Cap= 0 % Shear Condition: Static

Vertical Load, Q= 25.0 -kp Shear Load, P= 0.0 -kp Moment, M= 0.0 -kp-f

#### Profile:

Pile Length, L= 48.0 -ft Top Height, H= 0 -ft Slope Angle, As = 0 Batter Angle, Ab= 0

Soil D	ata:				111111111111111111111111111111111111111		Pile Da	ita:					
Depth -ft	Gamma -lb/f3	Phi	C -kp/f2	K -lb/i3	e50 or Dr %	Nspt	Depth -ft	Width -in	Area -in2	Per.	l -in4	E -kp/i2	Weight
0	111.2	31.4	0.00	27.9	27.34	7	0.0	10	78.5	31.4	490.9	29000	0.266
12.5	59.0	36.5	0.00	67.5	54.06	20	12.5	10	78.5	31.4	490.9	3000	0.082
25	60.7	38.0	0.00	95.5	65.80	30	35.0	10	78.5	31.4	490.9	29000	0.266
30	61.9	38.7	0.00	114.5	72.63	37	43.0	10	78.5	31.4	490.9	3000	0.082
35	62.0	0.0	0.86	175.0	1.09	7	48.0						
40	59.5	36.8	0.00	72.3	56.25	22							
45	62.5	38.9	0.00	120.2	74.55	39							
50	66.4	39.7	0.00	148.5	83.29	48							
60	74.5	42.1	0.00	197.2	95.94	60							

### Vertical capacity:

Weight above Ground= 0.00 Total Weight= 6.52-kp \*Soil Weight is not included Side Resistance (Down)= 119.174-kp Side Resistance (Up)= 119.175-kp Tip Resistance (Down)= 0.000-kp Tip Resistance (Up)= 0.000-kp Total Ultimate Capacity (Down)= 119.174-kp Total Ultimate Capacity (Up)= 125.691-kp Total Allowable Capacity (Down)= 47.670-kp Total Allowable Capacity (Up)= 50.276-kp OK! Qallow > Q


#### Settlement Calculation:

At Q= 25.00-kp Settlement= 0.01932-in At Xallow= 1.00-in Qallow= 97.14198-kp

Note: If the program cannot find a result or the result exceeds the upper limit. The result will be displayed as 99999.




# SOIL STRESS, SIDE RESISTANCE, & AXIAL FORCE vs DEPTH Based on Ultimate Load Condition

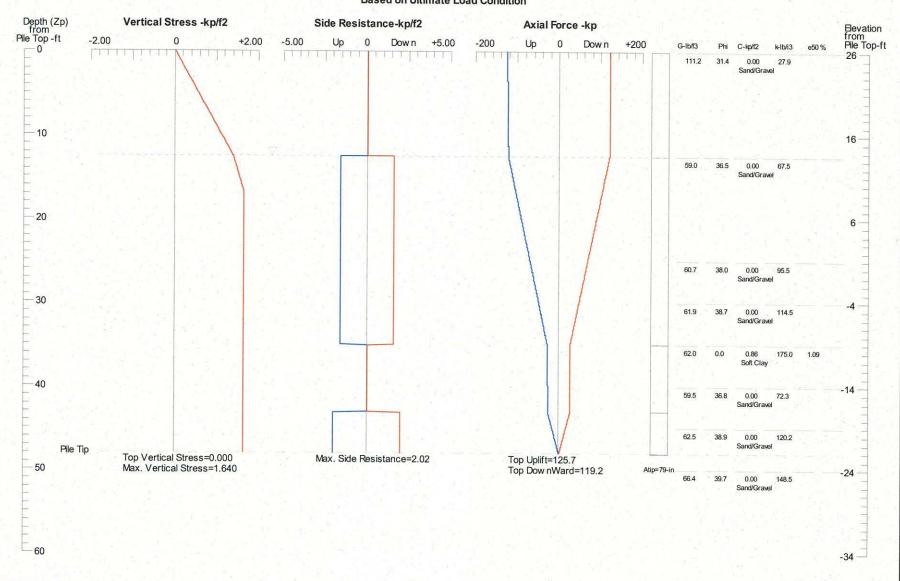




Y234676B Breakers 10inch

# **ALLOWABLE CAPACITY vs FOUNDATION DEPTH**

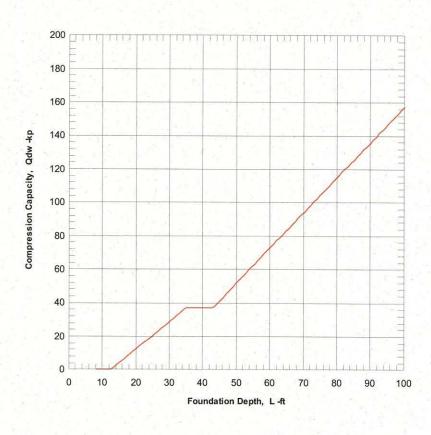


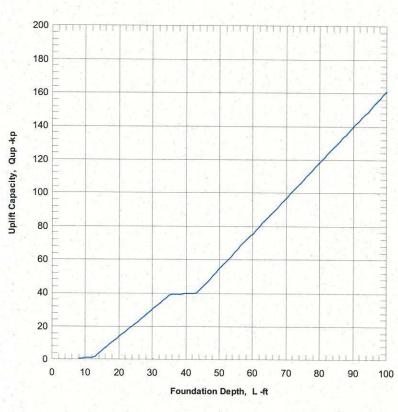



Y234676B Breakers 10inch

# Vertical Load vs. Settlement

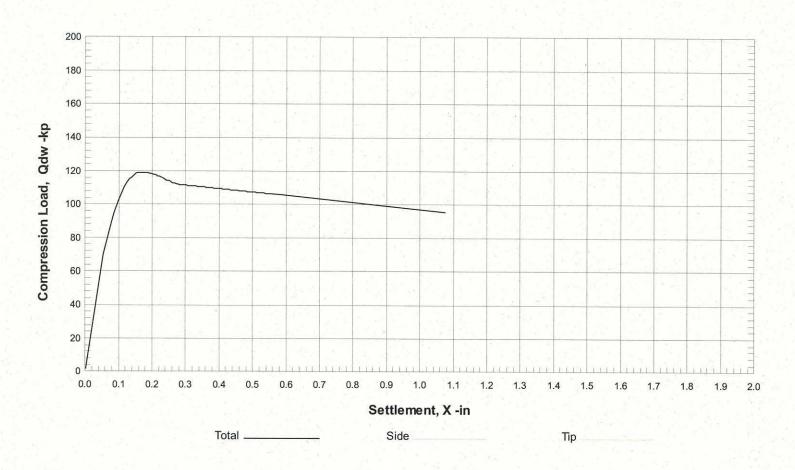

CivilTech Software Y234676B Breakers 10inch

Appendix E
- Checklist of Recommended Plan Reviews and Site Observations -

### APPENDIX E

Checklist of Recommended Plan Reviews and Site Observations
To Be Completed by a Representative of H.G. Schlicker & Associates, Inc.

Item No.	Date Done	Procedure	Timing
1*		Review site development, foundation, drainage, grading and erosion control plans.	Prior to permitting and construction.
2*		Observe Pile installation and testing operations.	During installation. **
3*	1910	Summary Site Observation Visit	After construction before occupancy**

<sup>\*</sup> There will be additional charges for these services.

<sup>\*\*</sup> Please provide us with at least 5 days' notice prior to all site observations.

Geologic Hazards Investigation
Tax Lot 92411, Map 5S-11W-25CB Supp. Map No. 2
Lot-Unit 11, 48060 Breakers Boulevard
Neskowin, Tillamook County, Oregon

Prepared for:
Breakers Condominium
Attn: Glenn Garrett, HOA President
16476 NW Racely Court
Portland, Oregon 97229

H.G. Schlicker & Associates, inc.

Project #Y234676

May 23, 2023

To:

**Breakers Condominium** 

Attn: Glenn Garrett, HOA President

16476 NW Racely Court Portland, Oregon 97229

Subject:

Geologic Hazards Investigation

Tax Lot 92411, Map 5S-11W-25CB Supp. Map No. 2

Lot-Unit 11, 48060 Breakers Boulevard Neskowin, Tillamook County, Oregon

### Dear Mr. Garrett:

The accompanying report presents the results of our geologic hazards investigation for the above subject site.

After you have reviewed our report, we would be pleased to discuss it and to answer any questions you might have.

This opportunity to be of service is sincerely appreciated. If we can be of any further assistance, please contact us.

H.G. SCHLICKER & ASSOCIATES, INC.

Adam M. Large, MSc, RG, CEG

President/Principal Engineering Geologist

AML:mgb

# TABLE OF CONTENTS

	<u>Page</u>
1.0	Introduction1
2.0	Site Description1
2.1	The history of the site and surrounding areas, such as previous riprap or dune
	grading permits, erosion events, exposed trees on the beach, or other relevant
	local knowledge of the site
2.2	Topography, including elevations and slopes on the property itself2
2.3	Vegetation cover
2.4	Subsurface materials – the nature of the rocks and soils
2.5	Conditions of the seaward front of the property, particularly for sites having a sea cliff. 3
2.6	Presence of drift logs or other flotsam on or within the property3
2.7	Description of streams or other drainage that might influence erosion or locally
	reduce the level of the beach
2.8	Proximity of nearby headlands that might block the long shore movement of
	beach sediments, thereby affecting the level of the beach in front of the property 3
2.9	Description of any shore protection structures that may exist on the property or
	on nearby properties
2.10	Presence of pathways or stairs from the property to the beach

# TABLE OF CONTENTS (continued)

<u>Page</u>	
2.11 Existing human impacts on the site, particularly any that might alter the	2.11
resistance to wave attack4	
Description of the Fronting Beach	3.0
Average widths of the beach during the summer and winter	3.1
3.2 Median grain size of beach sediment	3.2
3.3 Average beach slopes during the summer and winter	3.3
3.4 Elevations above mean sea level of the beach at the seaward edge of the property	3.4
during summer and winter5	
3.5 Presence of rip currents and rip embayments that can locally reduce the elevation	3.5
of the fronting beach5	
Presence of rock outcrops and sea stacks, both offshore and within the beach zone 5	3.6
3.7 Information regarding the depth of beach sand down to bedrock at the seaward	3.7
edge of the property5	
Geologic Hazards Analysis5	1.0
.1 Subsurface Materials	4.1
4.2 Geologic Structures	4.2
1.3 Slopes	4.3

# **TABLE OF CONTENTS (continued)**

	Page
4.4	Orientation of Bedding Planes in Relation to the Dip of the Surface Slope
4.5	Site Surface Water Drainage Patterns7
4.6	Dune Stability and Erosion
4.7	Regional Seismic Hazards8
4.8	Flooding Hazards10
4.9	Climate Change10
4.10	Analyses of Erosion and Flooding Potential11
4.11	Assessment of Potential Reactions to Erosion episodes
5.0	Conclusions and Preliminary Recommendations for Further Work
6.0	Limitations
7.0	Disclosure
8.0	References Cited

# **FIGURES**

Figure 1 – Location Map Figure 2 – Plat Map Figure 3 – Site Topographic Map Figure 4 – Slope Profile A-A'

# **APPENDICES**

Appendix A - Site Photographs

Project #Y234676 May 23, 2023

To: Breakers Condominium

Attn: Glenn Garrett, HOA President

16476 NW Racely Court Portland, Oregon 97229

Subject: Geologic Hazards Investigation

Tax Lot 92411, Map 5S-11W-25CB Supp. Map No. 2

Lot-Unit 11, 48060 Breakers Boulevard Neskowin, Tillamook County, Oregon

Dear Mr. Garrett:

### 1.0 Introduction

At your request and authorization, a representative of H.G. Schlicker and Associates, Inc. (HGSA) visited the subject site on March 31, 2023, to complete a geologic hazards investigation of Tax Lot 92411, Map 5S-11W-25CB Supp. Map No. 2, Lot-Unit 11, 48060 Breakers Boulevard, Neskowin, Tillamook County, Oregon (Figures 1 and 2; Appendix A). Reportedly, the existing residential building was severely damaged by a structural fire. It is our understanding that you are working with a contractor and the owner's representative and plan to demolish the existing damaged structure and build a new residential building in its place. Reportedly, the proposed development will be considered a new development, new construction or a substantial improvement; however, we defer to the county and city of Neskowin to make this determination.

This report addresses the geologic hazards at the site with respect to the proposed development. The scope of our work consisted of a site visit, site observations and measurements, a slope profile, a limited review of the geologic literature, interpretation of topographic maps, lidar and stereo aerial photographs, and preparation of this report of our findings, conclusions and preliminary recommendations for further work.

### 2.0 Site Description

The subject site consists of Tax Lot 92411, Map 5S-11W-25CB Supp. Map No. 2, which is approximately 20 feet wide and 30 feet deep. The rectangular-shaped lot is located on a

younger stabilized dune at the Breakers Condominiums in the community of Neskowin, Oregon (Figure 1). The site is one of eleven condominium tax lots located within Tax Lot 92412, Map 5S-11W-25CB, which encompasses the greater area of the Breakers Condominiums (Figure 2).

The subject site is occupied by a fire-damaged residential structure and attached deck. An oceanfront protective structure (riprap revetment) is located on the dune slope approximately 105 feet west of the site; this revetment is contiguous with other revetments to the north and south (Appendix A). The condominium property surrounding the site is bounded to the west by the beach and the Pacific Ocean, to the north by Mt. Angel Avenue, to its east by Breakers Boulevard, and to its south by Sheridan Avenue.

# 2.1 The history of the site and surrounding areas, such as previous riprap or dune grading permits, erosion events, exposed trees on the beach, or other relevant local knowledge of the site

According to Tillamook County records, the existing one and ½ story building was built in 1971 as part of the Breaker Condominium development. The condominium property is occupied by 11 detached residential units on individual lots within a larger parcel with a detached building in the southeast corner. The units, including the subject site, share an asphalt parking area accessed off Breakers Blvd. The subject building and attached deck appear to completely occupy the tax lot of the subject site. Reportedly, a fire recently severely damaged the building (Appendix A). According to a review of a 1967 aerial photograph, the area of the site was previously occupied by an undeveloped dune. Based on this photo, a detached building appears to occupy the southeast of the site at that time.

The site lies along an area that has been hardened with riprap revetment for hundreds of feet to the north and south. Most of this hardening has been constructed during and following the severe El Niño and La Niña events of the mid-to-late 1990s. Much of this riprap has needed repair of varying degree throughout the years.

### 2.2 Topography, including elevations and slopes on the property itself

The site is located on the western portion of a younger stabilized dune. Elevation at the site is approximately 26 feet (NAVD 88). The area of the site is generally flat but appears to have been subject to prior grading activities (Figures 3 and 4; Appendix A).

### 2.3 Vegetation cover

The subject site appears to be completely occupied by the existing building. The vegetation in the area of the site consists of lawn grass, beach grass and a few shore pine along the road.

# 2.4 Subsurface materials – the nature of the rocks and soils

Subsurface materials are discussed in detail in Section 4.1.

## 2.5 Conditions of the seaward front of the property

The property's western boundary (seaward front) is located approximately 105 feet east of the revetment in the western portion of a younger-developed dune. The general area of the site is densely developed, with existing homes with varying amounts of vegetation.

At The Breakers Condominiums, the revetment is approximately 20 feet high and generally slopes at 29 to 31 degrees. The armor stone generally varies from 4 to 7 feet in diameter along the mid and lower slope and 3 to 6 feet in diameter along the upper slope. The revetment is composed of angular basalt quarry stone from various sources. Some of the rock consists of volcanic breccias and agglomerates, including pillow basalts. Much of the volcanic breccia and agglomerate is fractured and can break into smaller pieces. Some of the revetment is composed of better quality, harder, fine-grained basalt of more durable character. We believe the better quality rock was primarily placed during repairs.

Reportedly, the revetment lacks a geotextile filter fabric beneath it to prevent the piping of sand from behind the revetment out through it (sand bleed through). Unfortunately, sand piping can occur anytime water levels are above the toe of the revetment, not just during storm conditions.

# 2.6 Presence of drift logs or other flotsam on or within the property

During our site visit, we did not observe drift logs or flotsam on the beach to the west of the property. However, a small log was wedged in the riprap boulders in the lower portion of the revetment west of the site.

# 2.7 Description of streams or other drainage that might influence erosion or locally reduce the level of the beach

Neskowin Creek discharges onto the beach approximately 0.5 mile south of the site (Figure 1). Historical satellite imagery from Google Earth indicates that although Neskowin Creek's stream channel meanders approximately 500 feet north and south on the beach, the stream generally enters the ocean near the east side of proposal rock and does not appear to influence the level of the beach west of the subject site.

# 2.8 Proximity of nearby headlands that might block the long shore movement of beach sediments, thereby affecting the level of the beach in front of the property

The site is located approximately 1 mile north of the Cascade Head headlands and approximately 7.5 miles south of Cape Kiwanda. Proposal Rock, located approximately 0.5 miles south of the site, can be considered the nearest headland and does not appear to affect the subject site substantially.

Project# Y234676 Page 4

# 2.9 Description of any shore protection structures that may exist on the property or on nearby properties

An existing riprap revetment is present approximately 105 feet west of the subject site and is connected to other oceanfront revetments, which extend for hundreds of feet to the south along Neskowin Beach. The unimproved beach access ramp at the western end of Mt. Angel Avenue is not occupied by an oceanfront protection structure; however, an oceanfront revetment is present fronting the adjoining property to the north.

# 2.10 Presence of pathways or stairs from the property to the beach

The nearest public beach access occupies the western end of Mt. Angel Avenue, approximately 15 feet north of the site.

# 2.11 Existing human impacts on the site, particularly any that might alter the resistance to wave attack

Human impacts are not contributing to the alteration of the resistance of the riprap revetment to wave attack west of the site.

# 3.0 Description of the Fronting Beach

Neskowin Beach fronts the condominium property west of the site. Detailed descriptions of the characteristics of the beach are provided below.

# 3.1 Average widths of the beach during the summer and winter

The beach near the site has a highly variable width, which is primarily dependent upon tide levels, and it tends to be narrower in the winter than in the summer. Although the beach can be more than 300 feet wide, at high tide, there is often no walkable beach. The beach here is very dynamic and changes morphology frequently, primarily due to rip current formation.

# 3.2 Median grain size of beach sediment

During our site visit, we observed fine-grained to medium-grained beach sand.

# 3.3 Average beach slopes during the summer and winter

Beach slopes vary from approximately 2 to 5 degrees depending upon recent accretion or erosion. The beaches tend to be flatter in the summer.

Project# Y234676 Page 5

# 3.4 Elevations above mean sea level of the beach at the seaward edge of the property during summer and winter

The property's western edge lies approximately 105 feet east of the upper edge of the riprap revetment west of the site. Lidar data from 2016 shows the junction between the beach and the revetment was at approximately 8 feet (NAVD 88). Allan and Hart (2005) surveyed the elevation of the beach/dune junction in 1997, 1998, and 2002 at approximately 23.9 feet, 19.2 feet, and 16 feet, respectively. Winter elevations primarily depend on beach profiles formed by storm conditions.

# 3.5 Presence of rip currents and rip embayments that can locally reduce the elevation of the fronting beach

Rip currents and rip current embayments commonly contribute to erosion along the oceanfront in Neskowin. Narrow beaches and near-shore relatively deep water conditions contribute to rip current and rip current embayment formation.

It appears that rip currents have set-up in this general area consistently throughout the years, particularly north of Proposal Rock. As a result, future problems with rip current embayments and erosion should be expected in this area. When rip currents form, they create a channel of deeper water oriented perpendicular to the coastline. This commonly allows larger waves to travel further shoreward before breaking, adding to the erosive potential. When these channels terminate at the base of a riprap revetment, they have the potential to undermine the revetment, causing its failure. This appears to be partly responsible for the revetment failures seen in Neskowin. The potential for revetment failure by undermining is also increased at Neskowin because Neskowin is an old dune sheet, lacking rock at shallow depth on which to found the revetment.

# 3.6 Presence of rock outcrops and sea stacks, both offshore and within the beach zone

Proposal Rock is located approximately 0.5 miles south of the site.

# 3.7 Information regarding the depth of beach sand down to bedrock at the seaward edge of the property

Based on our experience with Neskowin sites in the vicinity, we estimate that bedrock lies more than 20 feet below beach level.

# 4.0 Geologic Hazards Analysis

Our geologic hazards analysis is presented below.

# 4.1 Subsurface Materials

The site lies in an area that has been mapped as Pleistocene beach sand (Schlicker et al., 1972). Neskowin lies on a large dune complex which is approximately 4 miles long, north to south and extends from the coastline east to the base of the hills. This dune complex consists of numerous individual dunes which vary in age and stability. The area of the site has been mapped as a younger stabilized dune (open dune sand conditionally stable), which is a dune that has become conditionally stable regarding wind erosion (USDA et al., 1975). More recent mapping also identifies the area of the site as recently stabilized dunes (Allan, 2020). The dune consists of tan, loose, fine-grained sand with a thin, moderately developed topsoil. Under the Land Conservation and Development Commission (LCDC) classification system, the site is a Dune, Younger Stabilized.

Existing development, assumed buried utilities and installation, pavement, and hardscaping prevented subsurface investigation of the site with hand-augered equipment. Loose, unconsolidated dune sand was exposed on the ground surface around the site. Probing around the existing foundation indicated shallow spread footings.

# 4.2 Geologic Structures

Structural deformation and faulting along the Oregon Coast is dominated by the Cascadia Subduction Zone (CSZ) which is a convergent plate boundary extending for approximately 680 miles from northern Vancouver Island to northern California. This convergent plate boundary is defined by the subduction of the Juan de Fuca plate beneath the North America Plate and forms an offshore north-south trench approximately 60 miles west of the Oregon coast shoreline. A resulting deformation front consisting of north-south oriented reverse faults is present along the western edge of an accretionary wedge east of the trench, and a zone of margin-oblique folding and faulting extends from the trench to the Oregon Coast (Geomatrix, 1995).

A northwest-trending strike-slip fault is mapped near the site, extending from Proposal Rock to the southeast, approximately 4 miles (Snavely et al., 1996). Based on mapping, the fault appears to offset middle Tertiary geologic units.

An unnamed offshore fault is mapped approximately 9 miles west of the site (Personius et al., 2003). The faults are part of a mapped group of left- and right-lateral strike-slip, normal, and reverse faults which offset accretionary wedge sediments underlying the continental shelf and slope in the forearc of the Cascadia Subduction Zone; some of the faults in this group also offset the overlying sedimentary section and underlying oceanic basalts of the subducting Juan de Fuca Plate (Personius et al., 2003). Most of the offshore faults in this group have strikes oblique to the Cascadia deformation front, suggesting a strong lateral component of slip. No detailed information on the ages of faulted deposits has been published, but similar offshore structures offset late Pleistocene

and Holocene sediments (Personius et al., 2003). An offshore thrust fault is also mapped approximately 2 miles west of the site (Personius et al., 2003).

The nearest potentially active fault is the Happy Camp Fault (formerly the Netarts Bay fault), which lies at the north end of Netarts Bay, approximately 23 miles north of the site (Geomatrix, 1995). This fault is a west-northwest trending, high angle reverse fault which cuts Miocene basaltic and Pleistocene channel deposits. This fault is believed to have been active approximately 125,000 years ago; however, it does not appear to cut 80,000-year-old marine terrace deposits, which suggests that the fault has not been active for at least 80,000 years (Geomatrix, 1995).

Other mapped potentially active faults are located in the Tillamook Bay fault zone approximately 31 miles north of the site, which are northwest-striking faults that offset the Eocene Tillamook Volcanics on the west flank of the Coast Range. No displacements in Quaternary deposits have been documented, but the fault zone parallels the mountain front that controls the northeastern margin of Tillamook Bay and thus has geomorphic expression consistent with Quaternary displacement (Personius et al., 2003).

# 4.3 Slopes

Slopes are discussed in detail in Section 2.2 above.

# 4.4 Orientation of Bedding Planes in Relation to the Dip of the Surface Slope

The site lies in an area mapped as dune sands which have beds of varying dip related to the surface slope. The underlying Basalt of Cascade Head has been mapped as dipping down to the north-northwest from 30 to 45 degrees (Snavely et al., 1996). Grades at the subject site are primarily related to past grading and fill activities rather than the orientation of underlying units.

## 4.5 Site Surface Water Drainage Patterns

The ground surface surrounding the site gently slopes to the southeast. However, we anticipate most stormwater would easily infiltrate through the areas of exposed loose sand. At the time of our site visit, we observed no streams at the site. The nearest stream is Kiwanda Creek, located approximately 960 feet east of the site. Kiwanda Creek joins Neskowin Creek and discharges onto the beach approximately 0.5 miles south of the site.

#### 4.6 Dune Stability and Erosion

The site is located on loose dune sand, which is easily eroded by ocean wave activity, and wind when devoid of vegetation. During the winters of 1998, 1999, 2000 and 2001, severe storms resulted in substantial ocean wave erosion, which removed active dunes in the area of the site. As reported by local residents, up to 10 feet of erosion has been observed during a single storm event. Ocean wave erosion has also resulted in lowering

of the beach elevation by several feet, allowing higher energy waves to impact the bluff. The increase in ocean wave erosion observed along much of the Oregon Coast in the recent past is a consequence of the mid-to-late 1990s El Niño/La Niña events, which altered ocean currents and transported much of the beach sand offshore. There has been some rebuilding of the beach in the last few years, but this has been a slow process. As a result, nearly all of Neskowin's oceanfront residences have had oceanfront protection installed.

The site lies along an area that has been hardened for hundreds of feet to the north and south. Most of this hardening has been constructed during and following the severe El Niño and La Niña events of the mid-to-late 1990s. All of the hardening in this area has been done with riprap revetments. Much of this riprap has needed repair of varying degree throughout the years. The southern part of The Breakers Condominiums, the two homes south of The Breakers Condominiums, and The Pacific Sands Condominiums to the south were particularly affected by early December 2007 and early January 2008 storms, and at least one of the homes required underpinning. These severe storms were accompanied by only moderately high tides. Had the storms been accompanied by higher tide levels, the damage could have been substantially worse. The riprap revetment greatly reduces the potential for erosion when maintained and repaired as necessary.

Mapping by Allan and Priest (2001) identifies the site within the High Hazard Zone. The dune slope and revetment areas west of the site are mapped in the active coastal erosion hazard zones. The active coastal erosion hazard zone is defined as an area that is being actively eroded by ocean waves and the mass movements directly caused by wave action, and the high coastal erosion hazard zone is defined as an area having a high probability that it could be affected by active erosion in the next  $\sim 60$  to 100 years (Allan and Priest, 2001). It should be noted that the mapping done for the 2001 study was intended for regional planning use, not for site-specific hazard identification.

#### 4.7 Regional Seismic Hazards

Abundant evidence indicates that a series of geologically recent large earthquakes related to the Cascadia Subduction Zone have occurred along the coastline of the Pacific Northwest. Evidence suggests that more than 40 great earthquakes of magnitude 8 and larger have struck western Oregon during the last 10,000 years. The calculated odds that a Cascadia earthquake will occur in the next 50 years range from 7–15 percent for a great earthquake affecting the entire Pacific Northwest, to about a 37 percent chance that the southern end of the Cascadia Subduction Zone will produce a major earthquake in the next 50 years (OSSPAC, 2013; OSU News and Research Communications, 2010; Goldfinger et al., 2012). Evidence suggests the last major earthquake occurred on January 26, 1700, and may have been of magnitude 8.9 to 9.0 (Clague et al., 2000).

Project# Y234676 Page 9

There is now increasing recognition that great earthquakes do not necessarily result in a complete rupture along the full 1,200 km fault length of the Cascadia subduction zone. Evidence in the paleorecords indicates that partial ruptures of the plate boundary have occurred due to smaller earthquakes with moment magnitudes (Mw) < 9 (Witter et al., 2003; Kelsey et al., 2005). These partial segment ruptures appear to occur more frequently on the southern Oregon coast, as determined from paleotsunami studies. Furthermore, the records have documented that local tsunamis from Cascadia earthquakes recur in clusters (~250–400 years) followed by gaps of 700–1,300 years, with the higher tsunamis associated with earthquakes occurring at the beginning and end of a cluster (Allan et al., 2015).

These major earthquake events were accompanied by widespread subsidence of a few centimeters to 1–2 meters (Leonard et al., 2004). Tsunamis appear to have been associated with many of these earthquakes. In addition, settlement, liquefaction, and landsliding of some earth materials are believed to have been commonly associated with these seismic events.

Other earthquakes related to shallow crustal movements or earthquakes related to the Juan de Fuca plate have the potential to generate magnitude 6.0 to 7.5 earthquakes. The recurrence interval for these types of earthquakes is difficult to determine from present data, but estimates of 100 to 200 years have been given in the literature (Rogers et al., 1996).

The expected strength of shaking to occur at the site during an earthquake in a 500-year period has been mapped as severe (DOGAMI Oregon HazVu website, accessed May 2023). "Severe" is the second-highest level of a six-level gradation from "Light" to "Violent" in this mapping system.

### Liquefaction and Settlement

DOGAMI's HazVu website (https://gis.dogami.oregon.gov/maps/hazvu/) has mapped the area of the site as having a high susceptibility to liquefaction. DOGAMI states: "Buildings and infrastructure sitting on these soils are likely to be severely damaged in an earthquake."

Liquefaction occurs when saturated, cohesionless soils are subjected to ground vibrations, resulting in a decrease in the volume of the soil. If drainage is unable to occur, the tendency to decrease in volume results in an increase in pore water pressure. If the pore water pressure builds up to the point at which it is equal to the overburden pressure, the effective stress becomes zero, and the soil loses its strength and develops a liquefied state. Liquefaction is most common in saturated, loose, granular soils, sand or silty sand materials. Cohesive soils, such as clayey silt and clay, will generally not liquefy during

Project# Y234676 Page 10

earthquakes. Older sediments are also more resistant to liquefaction than recently deposited sediments (Idris and Boulanger, 2008).

Settlement can be the result of liquefaction of saturated soils or simply a result of dry soil densifying under vibration (volumetric compression). Volumetric compression during an earthquake is the result of vibrations of the soil, which cause soil particles to settle into a denser state, decreasing the volume of the soil. The degree of settlement is primarily dependent upon the initial density of the soil and the magnitude and duration of ground vibration (shaking). Settlement caused by liquefaction is commonly differential, and the magnitude of settlement typically varies throughout a site, whereas settlement caused by volumetric compression tends to be more uniform.

# 4.8 Flooding Hazards

Based on the 2018 Flood Insurance Rate Map (FIRM, Panel #41057C1005F), the area of the site lies in an area rated as Zone VE (EL 32), defined as a special flood hazard area with base flood elevations determined, and subject to inundation by the 1-percent-annual-chance flood event with additional hazards due to storm-induced velocity wave action.

The beach and revetment area west of the site lies in an area rated as Zone VE (EL 41.3 feet) (NAVD 88), which is defined as a special flood hazard area with base flood elevations determined, and subject to inundation by the 1-percent-annual-chance flood event with additional hazards due to storm-induced velocity wave action. The area east of the revetment and west of the site lies in an area rated as Zone VE (EL 33), defined as a special flood hazard area with base flood elevations determined and subject to inundation by the 1-percent-annual-chance flood event with additional hazards due to storm-induced velocity wave action; the area east of the site is mapped as an area rated as Zone AE (EL 25) which is defined as an area of 1-percent-annual-chance of being flooded and wave heights are less than 3 feet.

Based on the Oregon Department of Geology and Mineral Industries mapping (DOGAMI, 2012), the subject site lies within the tsunami inundation zone resulting from an approximately 8.7 and greater magnitude Cascadia Subduction Zone (CSZ) earthquake. The 2012 DOGAMI mapping is based upon 5 computer-modeled scenarios for shoreline tsunami inundation caused by potential CSZ earthquake events ranging in magnitude from approximately 8.7 to 9.1. The January 1700 earthquake event (discussed in Section 4.7 above) has been rated as an approximate 8.9 magnitude in DOGAMI's methodology. More distant earthquake source zones can also generate tsunamis.

# 4.9 Climate Change

According to most of the recent scientific studies, the Earth's climate is changing as the result of human activities which are altering the chemical composition of the atmosphere through the buildup of greenhouse gases, primarily carbon dioxide, methane, nitrous

oxide, and chlorofluorocarbons (EPA, 1998). Although there are uncertainties about exactly how and when the Earth's climate will respond to enhanced concentrations of greenhouse gases, scientific observations indicate that detectable changes are underway (EPA, 1998; Church and White, 2006). Global sea level rise, caused by melting polar ice caps and ocean thermal expansion, could lead to flooding of low-lying coastal property, loss of coastal wetlands, erosion of beaches and bluffs, and saltwater contamination of drinking water. Global climate change and the resultant sea level rise will likely impact the subject site through accelerated coastal erosion and more frequent and severe flooding.

# 4.10 Analyses of Erosion and Flooding Potential

4.10.1 Analysis of DOGAMI beach monitoring data available for the site (if available).

DOGAMI beach monitoring data has been collected for Neskowin Beach, approximately 1,300 feet south of the site, regularly since 1997. Following the winter storms of 2006-2008 and the construction of the revetments along the beach south of the site, beach elevations there have varied by several feet from minimum to maximum over the monitored period of 1999 to 2023 (Allan and Hart, 2005; Allan and Hart, 2007; Allan and Hart, 2008; Allan et al., 2015; NANOOS, accessed May 2023).

4.10.2 Analysis of human activities affecting shoreline erosion.

Armoring of the shoreline with riprap has reduced erosion along the beach.

4.10.3 Analysis of possible mass wasting, including weathering processes, landsliding, or slumping.

The erosive processes affecting the site are discussed in detail in Section 4.6 (above).

4.10.4 Calculation of wave run-up beyond mean water elevation that might result in erosion of the sea cliff or foredune.

Coastal erosion rates and hazard zones (as referenced in Allan and Priest, 2001) were presented in Section 4.6 Dune Stability and Erosion (above). In the dune-backed shoreline recession methodology applicable to the subject site, the total water level produced by the combined effect of wave runup plus the tidal elevation must exceed some critical elevation of the fronting beach, typically the elevation of the beachdune junction. Wave runup elevation can change with many variables, such as changing beach elevations, the presence of transient dunes, etc. The dune is

protected by the riprap revetment west of the subject site, and this shoreline recession methodology is not appropriate for the site.

4.10.5 Evaluation of frequency that erosion-inducing processes could occur, considering the most extreme potential conditions of unusually high water levels together with severe storm wave energy.

On this stretch of dune-backed shoreline, erosion-inducing processes are daily in the form of constant wave attack at the base of the revetment at high tide. High water levels, flooding, and severe storms can cause rip currents, which have the potential to undermine the revetment west of the site.

4.10.6 For dune-backed shoreline, use an established geometric model to assess the potential distance of property erosion, and compare the results with direct evidence obtained during site visits, aerial photo analysis, or analysis of DOGAMI beach monitoring data.

Not applicable to the subject site or nearby area, which is a dune-backed shoreline that has been extensively riprapped; see Section 4.10.4 (above).

4.10.7 For bluff-backed shorelines, use a combination of published reports, such as DOGAMI bluff and dune hazard risk zone studies, aerial photo analysis, and fieldwork, to assess the potential distance of property erosion.

Not applicable to the subject site, which lies in a dune-backed shoreline area.

4.10.8 Description of potential for sea level rise, estimated for local area by combining local tectonic subsidence or uplift with global rates of predicted sea level rise.

Based on data from NOAA monitoring stations at South Beach and Garibaldi, this general area of Oregon's coastline has a mean sea level rise of approximately 2.08 mm/year, which includes the combined effects of global rates of sea level rise and landmass elevation changes (NOAA Tides & Currents Sea Level Trends http://tidesandcurrents.noaa.gov/sltrends/sltrends.html). Additional observations are addressed in Section 4.9 of this report.

# 4.11 Assessment of Potential Reactions to Erosion Episodes

4.11.1 Determination of legal restrictions of shoreline protective structures (Goal 18 prohibition, local conditional use requirements, priority for non-structural erosion control methods).

As previously noted, riprap revetments are present west of the subject site and for hundreds of feet to the north and south in this oceanfront area of Neskowin. Lots in the area of the site were generally 'developed' on January 1, 1977; however, this is a legal issue that can have varying interpretations. Most lots in this area, including the subject site, generally meet Oregon's Goal 18 exception requirements to obtain protection when a structure is threatened by erosion.

According to the Ocean Shores Viewer (http://www.coastalatlas.net/oceanshores/, accessed May 2023), the oceanfront condominium property that the site occupies, the area around the subject site, appears eligible due to exception under the GOAL 18 Eligibility Inventory with a mapped beachfront protective structure.

4.11.2 Assessment of potential reactions to erosion events, addressing the need for future erosion control measures, building relocation, or building foundation and utility repairs.

Residential development recommendations, including erosion control and foundation design recommendations, will be provided in the geotechnical investigation recommended and discussed below.

#### 5.0 Conclusions and Preliminary Recommendations for Further Work

The main engineering geologic concerns at the site are:

- The site lies on dune sands that are poorly consolidated and subject to settlement and liquefaction, as well as ongoing coastal erosion if the revetment is damaged. Inherent risks of seismic hazards, flooding, coastal erosion, and future sand movement, including accretion at this site, must be accepted by the owner, future owners, developers, and residents.
- 2. The subject site and surrounding properties are mapped within a FEMA special flood hazard area and are subject to coastal flooding.
- 3. Based on our site observations, the existing fire-damaged building at the site appears to be supported on conventional shallow foundations. Based on the mapped hazards

at the site, this foundation does not appear suitable for reuse with the proposed development.

4. There is an inherent regional risk of earthquakes along the Oregon Coast, which could cause harm and damage structures. Ground shaking during an earthquake can cause soil consolidation resulting in settlement of the structures and can cause soils to liquefy, resulting in the loss of bearing capacity and structural damage. The site also lies in a mapped tsunami hazard zone. A tsunami impacting the Neskowin area could cause harm, loss of life, and damage to structures. Hazards associated with tsunami flooding resulting from a large seismic event cannot be economically mitigated for. These risks must be accepted by the owner, future owners, developers, and residents of the site.

## Recommendations for further work

All future development recommendations for the site assume the revetment west of the site will be maintained and repaired as necessary.

New construction or a substantial improvement of a residential building at the site is feasible, pending the results of the recommended geotechnical investigation discussed below. Based on the geologic hazards related to the development of the site, we have provided the following preliminary design considerations with respect to new construction or a substantial improvement:

Based on FEMA FIRM mapping, new or substantially improved buildings should be supported on a deep foundation system. Foundations will need to support vertical loads and provide support in the event of wave overtopping or ocean undercutting of the dune encroaching to the proposed foundation area. Foundations will also need to resist uplift forces. An open foundation or breakaway wall design may be necessary for the area below the lowest floor. V Zone standards will apply to the site, and we recommend that you design to these standards. Foundations in V Zones are required to be on piers or piling capable of resisting simultaneous wind and flood loads (with wave action).

Typically, the lowest horizontal structural members of the new building should be a minimum of 1 foot or more above base flood elevations. Additional freeboard may be necessary. We recommend that a benchmark be set prior to construction and that a certificate of elevation be obtained for the completed construction. In addition, a V Zone Design Certificate is recommended.

HGSA will need to complete a geotechnical investigation to provide recommendations for this type of site development and deep foundations. Locating services of private and public buried utilities and installations in the area of the site will be necessary.

Equipment access and associated logistics will need to be determined before the geotechnical site investigation can commence. Preparation of the site may be necessary prior to completing the geotechnical investigation. This investigation will likely include subsurface exploration with geotechnical drilling, laboratory testing, and geotechnical analysis. Following the geotechnical investigation, HGSA will likely need to consult with the designer, structural engineer, general contractor, and foundation contractor.

# 6.0 Limitations

The Oregon Coast is a dynamic environment with inherent unavoidable risks to development. Landsliding, erosion, tsunamis, storms, earthquakes and other natural events can cause severe impacts to structures built within this environment and can be detrimental to the health and welfare of those who choose to place themselves within this environment. The client is warned that, although this report is intended to identify the geologic hazards causing these risks, the scientific and engineering communities' knowledge and understanding of geologic hazards processes is not complete.

Our investigation was based on engineering geological reconnaissance, limited review of published information, and our subsurface exploration and analyses. The data presented in this report are believed to be representative of the site. The conclusions herein are professional opinions derived in accordance with current standards of professional practice and budget constraints. No warranty is expressed or implied. The performance of the site during a seismic event has not been evaluated. If you would like us to do so, please contact us.

The soil and related information depict generalized subsurface conditions only at these specific locations and at the particular time the subsurface exploration was completed. Soil, rock, and groundwater conditions at other locations may differ from the conditions at these boring locations. Also, the passage of time may result in a change in the soil and groundwater conditions at the site.

This report pertains to the subject site only, and is not applicable to adjacent sites nor is it valid for types of development other than that to which it refers. Geologic conditions including materials, processes, and rates can change with time and therefore, a review of the site and/or this report may be necessary as time passes to assure its accuracy and adequacy. This report may only be copied in its entirety.

# 7.0 Disclosure

H.G. Schlicker & Associates, Inc. and the undersigned Certified Engineering Geologist have no financial interest in the subject site, the project or the Client's organization.

# 8.0 References Cited

Allan, J. C. and Hart, R., 2005, A geographical information system (GIS) data set of beach morphodynamics derived from 1997, 1998, and 2002 LIDAR data for the central to northern Oregon coast: Technical Report to the Oregon Department of Land Conservation and Development: Oregon Department of Geology and Mineral Industries, Open-File Report O-05-09, 16 pages.

- Allan, J. C. and Hart, R., 2007, Assessing the temporal and spatial variability of coastal change in the Neskowin littoral cell: developing a comprehensive monitoring program for Oregon beaches: Technical Report to the Oregon Department of Land Conservation and Development: Oregon Department of Geology and Mineral Industries, Open-File Report O-07-01, 27 pages.
- Allan, J.C., and Hart, R., 2008, Oregon beach and shoreline mapping and analysis program: 2007-2008 beach monitoring report: Oregon Department of Geology and Mineral Industries Open file report O-08-15, 60 p.
- Allan, J.C., Ruggiero, P., Garcia, G., O'Brien, F. E., Stimely, L. L., and Roberts, J. T., 2015, Coastal Flood Hazard Study, Tillamook County, Oregon: Oregon Department of Geology and Mineral Industries Special Paper 47, 274 p.
- Allan, J. C. and Priest, G. R., 2001, Evaluation of coastal erosion hazard zones along dune and bluff backed shorelines in Tillamook County, Oregon: Cascade Head to Cape Falcon: Oregon Department of Geology and Mineral Industries, Open-File Report O-01-03, 126p., maps.
- Allan, J. C., 2020, Temporal and Spatial Changes in Coastal Morphology, Tillamook County, Oregon: Oregon Department of Geology and Mineral Industries, Open-File Report O-20-04, 27 p. report, geodatabase, metadata
- Calhoun, N. C., Burns, W. J., and Franczyk, J. J., 2020, Landslide hazard and risk study of Tillamook County, Oregon: Oregon Department of Geology and Mineral Industries, Open-File Report O-20-13, scale 1:8,000.
- Church, J. A., and White, N. J., 2006, A 20<sup>th</sup> century acceleration in global sea-level rise; Geophysical Research Letters, v. 22, LO1601, 4 p.
- Clague, J. J., Atwater, B. F., Wang, K., Wang, Y., and Wong, I., 2000, Penrose Conference 2000 Great Cascadia Earthquake Tricentennial, Programs Summary and Abstracts: Oregon Department of Geology and Mineral Industries, Special Paper 33, 156 p.

DOGAMI, 2012, Tsunami inundation maps for Neskowin, Tillamook County, Oregon: Oregon Department of Geology and Mineral Industries, TIM-Till-14, maps.

- EPA, 1998, Climate Change and Oregon: Environmental Protection Agency, EPA 236-98-007u, 4 p.
- Geomatrix Consultants, 1995, Seismic design mapping, State of Oregon, final report: Prepared for the Oregon Department of Transportation, Project No. 2442.
- Goldfinger, C., Nelson, C. H., Morey, A. E., Johnson, J. E., Patton, J. R., Karabanov, E., Gutiérrez-Pastor, J., Eriksson, A. T., Gràcia, E., Dunhill, G., Enkin, R. J., Dallimore, A., and Vallier, T., 2012, Turbidite event history—Methods and implications for Holocene paleoseismicity of the Cascadia subduction zone: U.S. Geological Survey Professional Paper 1661–F, 170 p.
- Idris, I. M., and Boulanger, R. W., 2008, Soil Liquefaction During Earthquakes: Earthquake Engineering Research Institute, 243 p.
- Kelsey, H. M., Nelson, A. R., Hemphill-Haley, E., and Witter, R. C., 2005, Tsunami history of an Oregon coastal lake reveals a 4600 yr record of great earthquakes on the Cascadia subduction zone: Geological Society of America Bulletin, v. 117, no. 7/8, p. 1009-1032.
- Leonard, L. J., Hyndman, R. D., and Mazzotti, S., 2004, Coseismic subsidence in the 1700 great Cascadia earthquake: Coastal estimates versus elastic dislocation models: Geological Society of America Bulletin, May/June 2004, v. 116, no. 5/6, pp. 655–670.
- NANOOS, Beach Monitoring Data, http://nvs.nanoos.org/BeachMapping, Oct 1997 to Mar 2023.
- Oregon Seismic Safety Policy Advisory Commission (OSSPAC), February 2013, The Oregon Resilience Plan: Reducing Risk and Improving Recovery for the next Cascadia Earthquake and Tsunami—Report to the 77<sup>th</sup> Legislative Assembly: State of Oregon Office of Emergency Management, 341 p.
- OSU News and Research Communications, May 24, 2010, Odds are 1-in-3 that a huge quake will hit Northwest in next 50 years: Oregon State University, Corvallis http://oregonstate.edu/ua/ncs/archives/2010/may/odds-huge-quake-Northwest-next-50-years
- Personius, S. F., Dart, R. L., Bradley, L-A, Haller, K. M., 2003, Map and data for Quaternary faults and folds in Oregon: U.S. Geological Survey, Open-File Report 03-095, 556 p., map.
- Rogers, A. M., Walsh, T. J., Kockelman, J., and Priest, G. R., 1996, Earthquake hazards in the Pacific Northwest an overview: U.S. Geological Survey, Professional Paper 1560, p. 1-54.

Schlicker, H. G., Deacon, R. J., Beaulieu, J. D., and Olcott, G. W., 1972, Environmental geology of the coastal region of Tillamook and Clatsop Counties, Oregon: Oregon Department of Geology and Mineral Industries, Bulletin 74, 164 p., maps.

- Snavely, P. D., Niem, A., Wang, F. L., MacLeod, N. S., and Calhoun, T. K., 1996, Geologic map of the Cascade Head Area, Northwestern Oregon Coast Range (Neskowin, Nestucca Bay, Hebo, and Dolph 7.5 minute Quadrangles): U.S. Geological Survey, Open-File Report 96-0534, 16 p., maps.
- USDA Soil Conservation Service, and Oregon Coastal Conservation and Development Commission, 1975, Beaches and dunes of the Oregon Coast: 161 p.
- Witter, R. C., Kelsey, H. M., and Hemphill-Haley, E., 2003, Great Cascadia earthquakes and tsunamis of the past 6700 years, Coquille River estuary, southern coastal Oregon: Geological Society of America Bulletin, v. 115, p. 1289-1306.

It has been our pleasure to serve you. If you have any questions concerning this report, or the site, please contact us.


Respectfully submitted,


H.G. SCHLICKER AND ASSOCIATES, INC.



Adam M. Large, MSc, RG, CEG President/Principal Engineering Geologist

AML:mgb

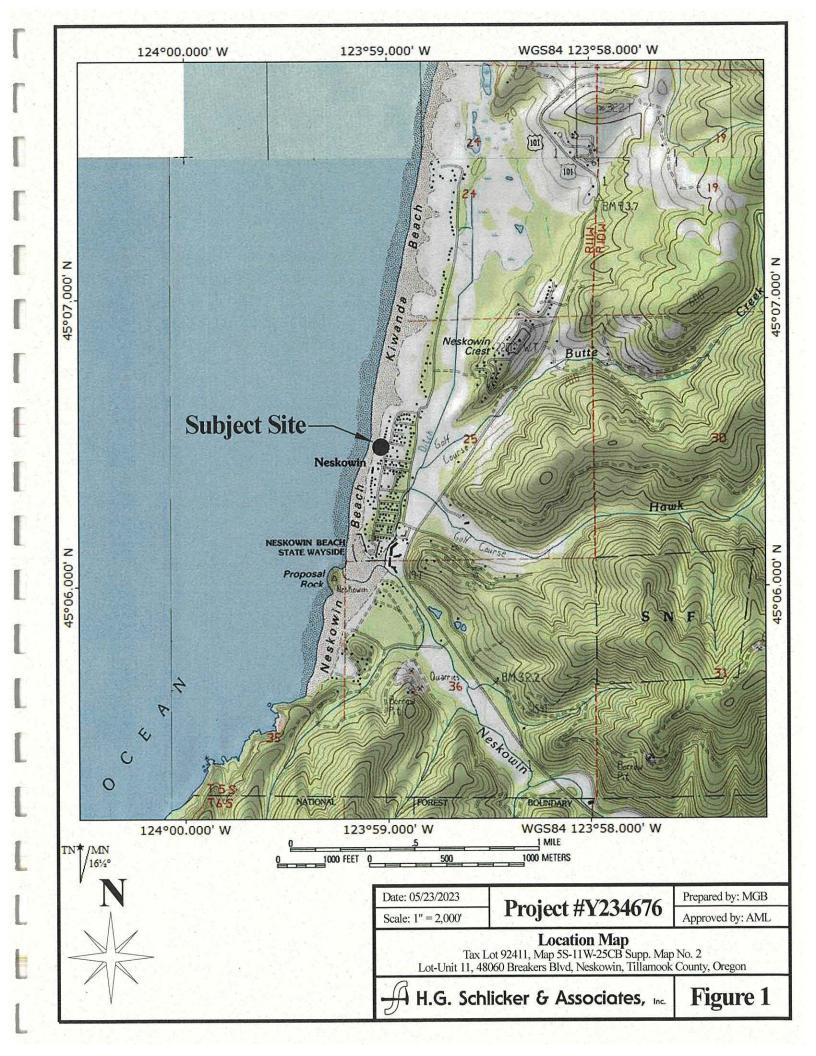

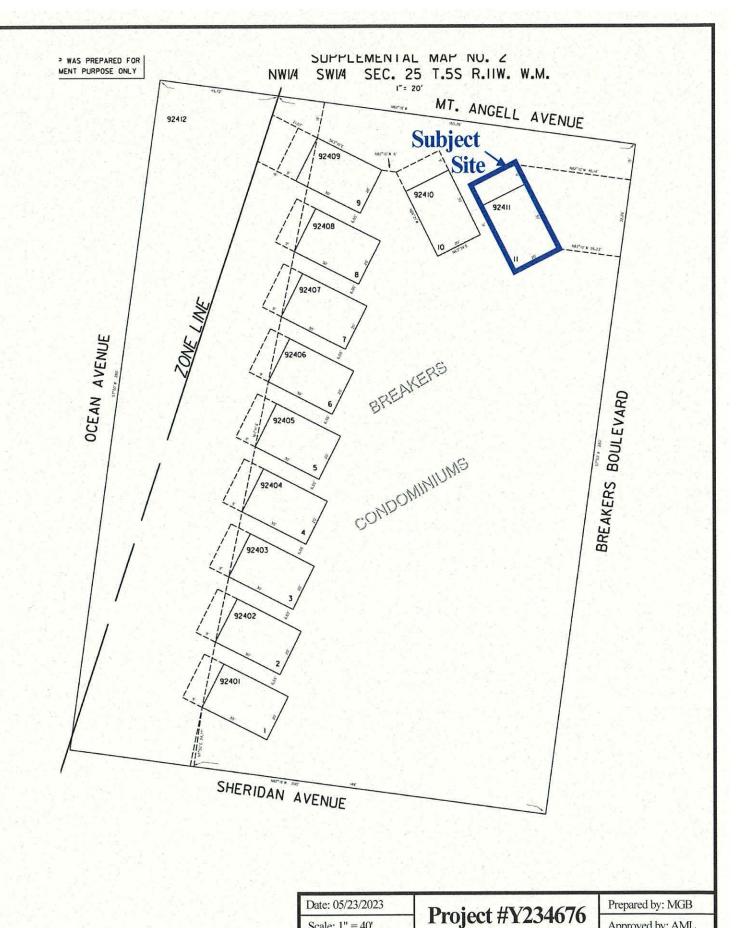

Scale: 1'' = 40'

Tax Lot 92411, Map 5S-11W-25CB Supp. Map No. 2 Lot-Unit 11, 48060 Breakers Blvd, Neskowin, Tillamook County, Oregon


Approved by: AML

H.G. Schlicker & Associates, Inc.

Plat Map

Figure 2

Modified from the Tillamook County assessor's plat 5S-11W-25CB Supp. No. 2 All locations and dimensions are approximate.

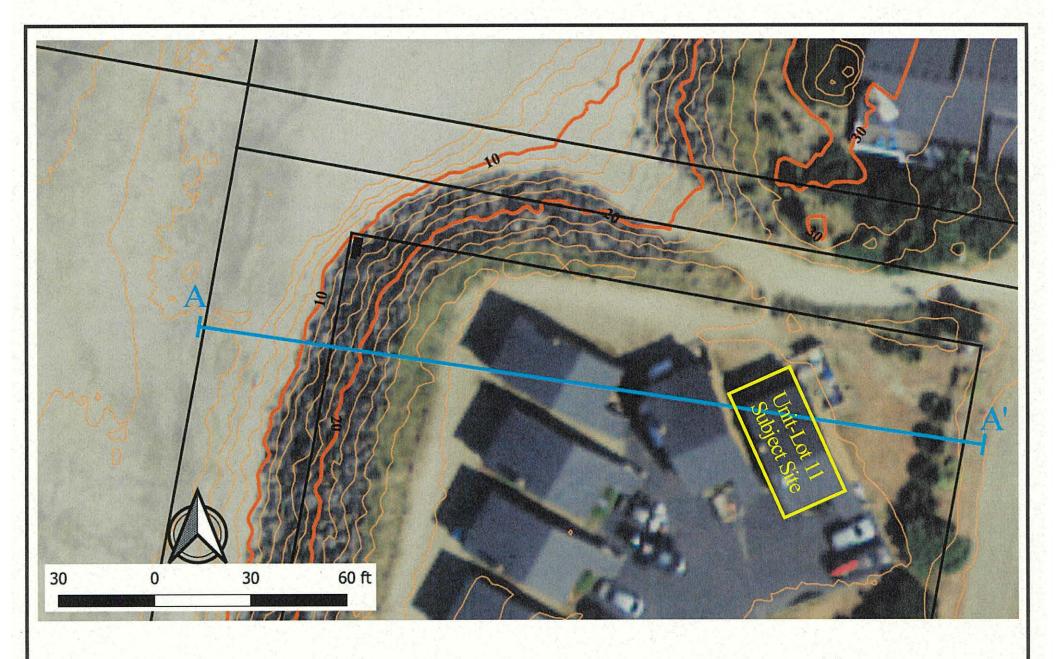

Imagery provided by 2018 Oregon Explorer
Topographic data derived from West\_Coast\_2016\_El\_Nino Lidar data from NOAA
All locations and dimensions are approximate.

= Approximate trend of profile line

Date: 05/23/2023

Scale: 1" = 30'

**Project #Y234676** 


Prepared by: MGB

Approved by: AML

Site Topographic Map Tax Lot 92411, Map 5S-11W-25CB Supp. No. 2; Lot-Unit 11 48060 Breakers Blvd, Neskowin, Tillamook County, Oregon



H.G. Schlicker & Associates, Inc. Figure 3

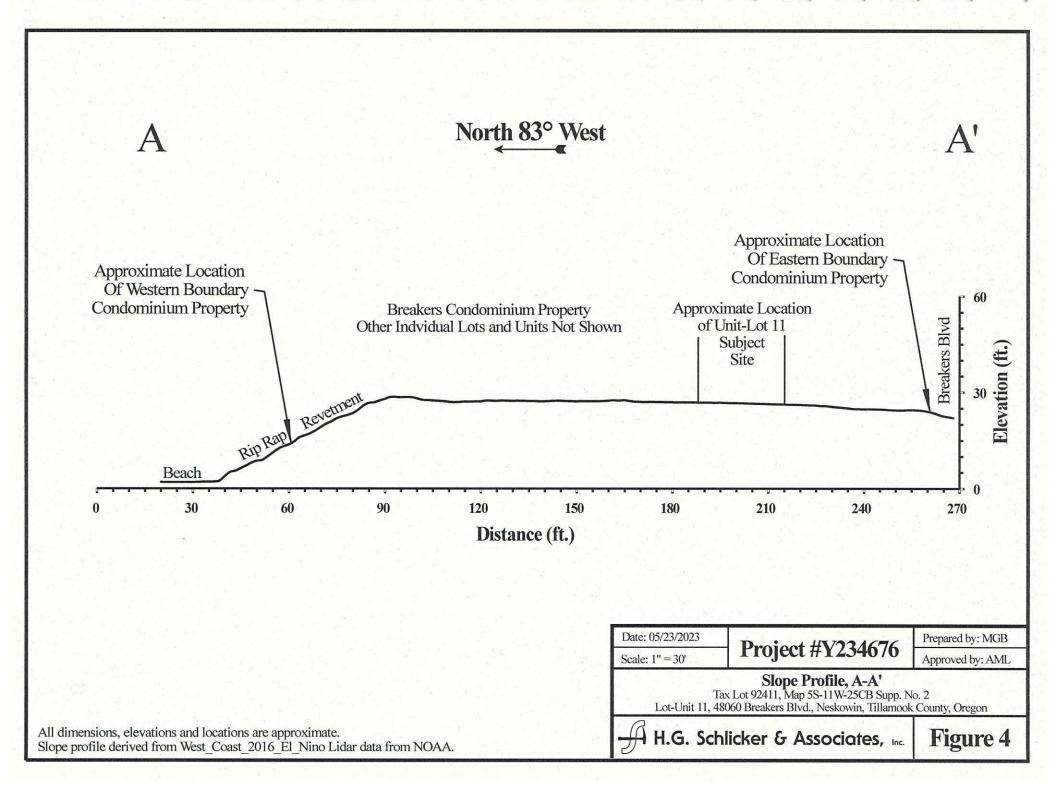

Project #Y234676

Appendix A
- Site Photographs –



Photo 1 – Northeasterly view of the subject site from the parking lot of Breakers Condominium.



Photo 2 – Southeasterly view of the subject site occupied by the existing fire-damaged residential building.



Photo 3 – Southwesterly view of the subject site from near the intersection of Breakers Blvd and Mt. Angel Ave.



Photo 4 – Easterly view of the site from the beach access ramp at the western end of Mt. Angel Ave.



Photo 5 – Easterly view of the oceanfront area west of the site from the beach.




Photo 6 – Southerly view of the beach and rip rap revetment west of the site.




Photo 7 – Westerly view from the top of the revetment, west of the site.



Photo 8 – Close-up view of a manhole near the site indicating the potential presence of buried private utilities and installations.

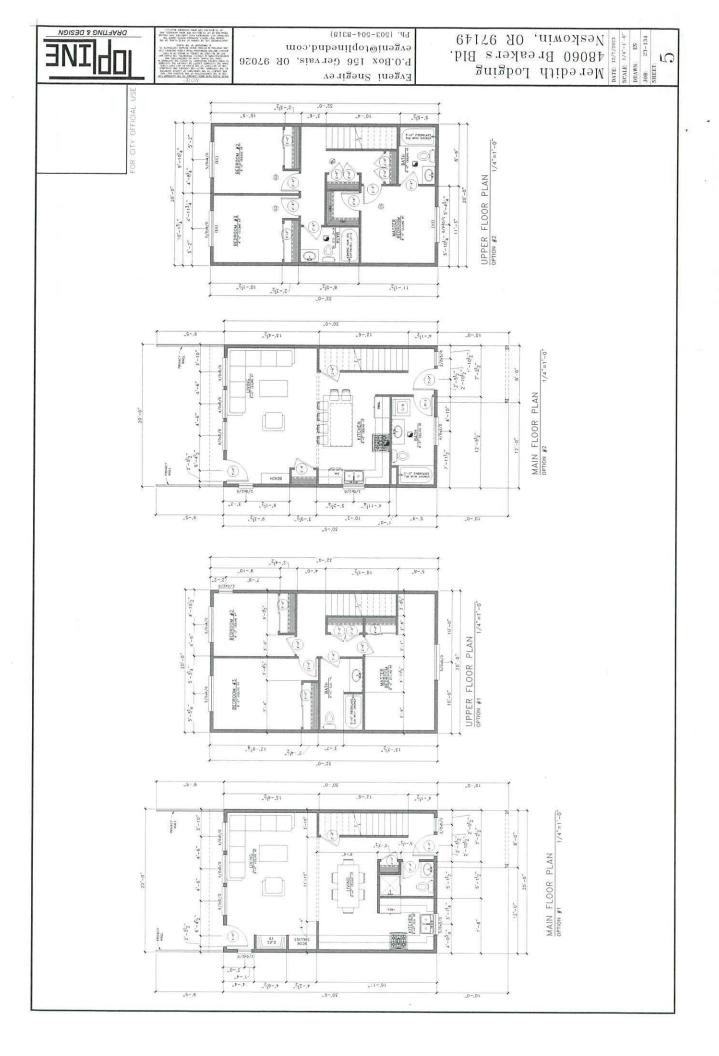



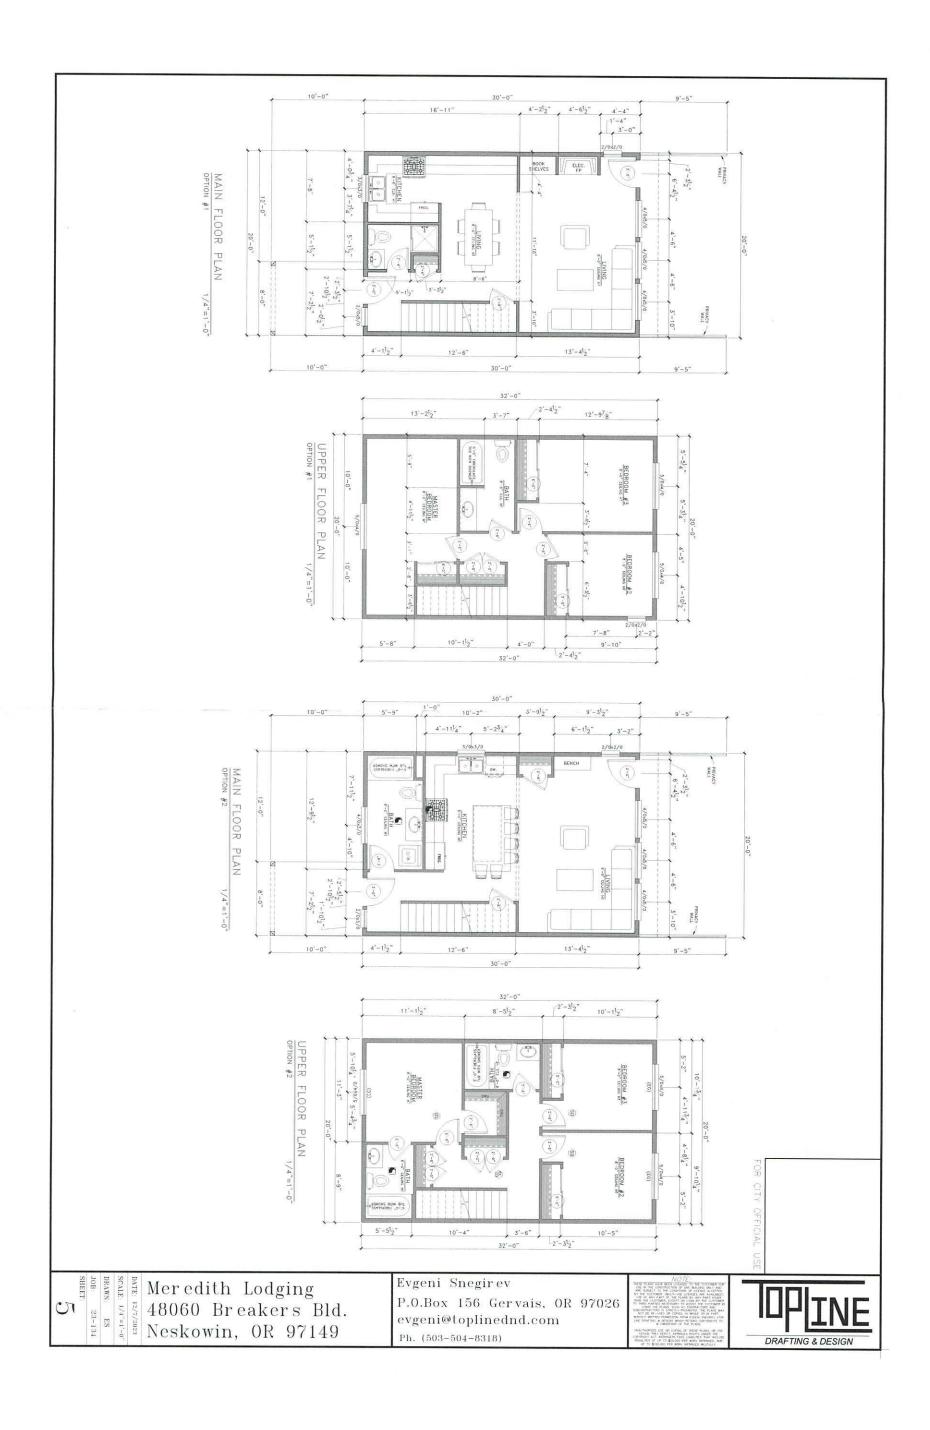

Project #Y234676B

August 21, 2024

To:

**Breakers Condominium** 

Attn: Glenn Garrett, HOA President

16476 NW Racely Court Portland, Oregon 97229

Subject:

Addendum to

Geotechnical Investigation (Phase 2) Report of April 23, 2024

Regarding TCLUO Section 3.570(6)(a).

Tax Lot 92411, Map 5S-11W-25CB Supp. Map No. 2

Lot-Unit 11, 48060 Breakers Boulevard Neskowin, Tillamook County, Oregon

#### Dear Mr. Garrett:

As requested, H.G. Schlicker and Associates, Inc. (HGSA) is providing this addendum letter to our May 23, 2023, Geologic Hazards Investigation and our April 23, 2024, Geotechnical Investigation report (HGSA #Y234676 and #Y234676B). The purpose of this addendum is to provide clarification to our engineering geologic recommendations with respect to the moveable structure design requirement set forth in section 3.570(6)(a) *Additional Development Limitations in Coastal Hazard Areas* of the Tillamook County Land Use Ordinance (TCLUO) Article 3.500.

Our report provides recommendations for the new house be placed on elevated beams supported on pile or columns with the lowest horizontal structural member no lower than 1 foot above the base flood elevation. We recommend that the foundation system consist of drilled and gravity grouted micropile. A *moveable structural design* is likely a structural engineering consideration related to the connection between the top of the pile and horizontal framing members.

Relocation of the structure, if threatened by coastal hazards within the footprint of the tax lot, may not be feasible due to its small size.

If moving the structure is necessary to a location off of the site, then the in-place constructed micropile would not be able to be moved or reused; however, the supported structure may be able to be disconnected and moved independently of the pile.

We can work with the structural engineer and architect during the design process to provide any engineering geologic feedback related to the pile system design to help achieve a building design that conforms with the intent of Section 3.570(6)(a) of TCLUO.

HGSA's review of final plans and specifications is necessary to determine whether the recommendations detailed in this report have been properly interpreted and incorporated into the design and construction documents. At the completion of our review, we will issue a letter of conformance to the client for the plans and specifications.

If you have any questions concerning this letter or the site, please contact us.

Respectfully submitted,

H.G. SCHLICKER AND ASSOCIATES, INC.

OREGON
ADIAM MACKENZIE LARGE

E2434

EXPIRES: 12/31/2024

Adam M. Large, MSc, RG, CEG
President/Principal Engineering Geologist
AML:mgb

# EXHIBIT C

# INSTRUCTIONS FOR FILING AN AFFIDAVIT FOR THE DEVELOPMENT OF A PROPERTY WITHIN THE NESKOWIN COASTAL HAZARDS OVERLAY (Nesk-CH) ZONE

- 1. This acknowledgment is required for development on a property within the Neskowin Coastal Hazard Overlay (Nesk-CH) zone that is subject to a Neskowin Coastal Hazard Zone Permit.
- 2. The attached Affidavit must be filled out and signed before a Notary Public.
- 3. Names of ALL current property owners who appear on the property deed or contract shall be shown, typed in the appropriate space at the top of the document, and signed in the presence of a Notary Public. (Signatures must be IDENTICAL to those listed.)
- 4. Property description must be IDENTICAL to what has been recorded in the Tillamook County Deed Records. This is what is referred to as <u>Exhibit A</u> on the covenant.
- 5. The applicant shall record the Statement with the Tillamook County Clerk in the Tillamook County Courthouse. After recording with the Clerks, a <u>copy</u> shall be provided to Community Development confirming the filing has occurred.
- 6. Each property involved will require a separate Affidavit.
- 7. If you have any questions about the Affidavit, or the recording procedure, please contact the Department of Community Development at (503) 842-3408 x3410.

After Recording Return To:	
Neskowin Coastal Haza	rd Zone Permit Affidavit
THIS RESTRICTIVE COVENANT, Made this	_day of, 20, by and between
property located in said County and further described	and the County of Tillamook for
PROPERTY LEGAL DESCRIPTION attached as Ex	
	THISTE A HOLOGO WHA HIGOSPOSAGO By Selection
Do hereby promise and covenant as follows:	in the state of th
Tillamook County, Oregon and is subject to potential	Neskowin Coastal Hazard Overlay (Nesk-CH) zone in chronic natural hazards. The owners/residents of this subject to risk of damage from such hazards. The clogic report for the subject property in preparation for ille with Tillamook County.
I/We, being said property owner, have reviewed the aware of the type and extent of hazards present and property.	geologic report and have thus been informed and are the risks associated with development on the subject
I/We do hereby accept the potential impacts and assu with the development of the subject property.	me all risks of damage from natural hazards associated
This affidavit shall run with the land and is intended to and successors and it can not be deleted or altered County Department of Community Development or it	o and hereby shall bind my/our heirs, assigns, lessees, if without prior contact and approval by the Tillamook is successor.
IN WITNESS WHEREOF, the said Party has20, CO	executed this instrument thisday of UNTY OF TILLAMOOK.
BY: Department of Community Development	BY: Property Owner
STATE OF OREGON	STATE OF OREGON
County of	County of
20,	20,
Personally appeared the above named	Personally appeared the above named
and acknowledged the foregoing instrument to	and acknowledged the foregoing instrument to
voluntary act and deed.	voluntary act and deed.
Before me:	Before me:
Notary Public of Oregon (My Commission Expires)	Notary Public of Oregon (My Commission Expires)