

TILLAMOOK COUNTY SURVEYORS OFFICE

1969 T2SR10W

SECTION CORNER COMMON SECTIONS  
25, 26, 35, & 36 T.2S., R.10W., W.M.

S26| S25 I found a 3/4" iron pipe with a 3" CrownZellerbach  
----+---- brass cap, disturbed by logging operation. I reset  
S35| S36 from found bearing trees as shown below (see T.C.S.  
RS 376 Map #B-737 and Rewitness Book 6 at Page 7). I encased  
the found iron pipe in a 10" concrete cylinder.

-----  
History of found monument

This monument falls in the roots of 18" alder and was bent over by yarding logs over the corner area. I straitened the Iron Pipe and reset from found bearing trees, which fit well except for the SW B.T.

Original 72" fir N.40 W. 59 lks., reported on above as 7' stump; (Found now an 84" stump smashed by logging at position).

Original 10" hemlock S.74 W. 55 lks., reported on above as 18" hemlock stump with scribing visible; (Found, now an 18" hemlock snag 6' tall S.74 W. 36.3' no marks visible).

(Book 6 Page 7) \*12" fir N.36 E. 12.9' to face; (Found, now a 17" fir stump 1' high N.36 E. 12.9'. I sawed the face open to get a good distance. Scribing visible.)

(Book 6 Page 7) \*20" fir S.52 E. 34.8' to face; (Found, now a 30" fir stump 5' tall S.52 E. 34.8'. I sawed open the face to get a good distance. Scribing visible).

(Book 6 Page 7) \*10" fir S.38 W. 36.5' to face; (Found, now a 15" fir stump 18" tall S.38 W. 36.5'. I sawed open the face to get a good distance. Scribing visible).

(Book 6 Page 7) \*16" hemlock N.81 W. 41.3' to face; (Found, now a 23" hemlock stump 5' tall N.81 W. 40.5. I sawed open the face to get a good distance. Scribing visible).

-----  
New Accessory

\*72" light hat section post N.10 E. 1.0'.

\*indicates Tillamook County Surveyors yellow metal location poster attached.

-----  
Surveys and Rewitnesses of record

B-737	12-10-76	Karl F. Foeste	LS 849
Rewitness Book 6 Page 7	12-10-76	Karl F. Foeste	LS 849
B-738	12-10-76	Karl F. Foeste	LS 849
Rewitness Book 3 Page 301	5-08-67	Charles G. Collard	RS 376
A-165	03-19-18	G.E. Davis	Deputy Co. Surveyor
Field notebook P-16 page 49	1915	C.A. Dunn	

Comment: The corner set by Book 3 Page 301 was reset at the correct location by Book 6 Page 7. (Also see Map B-737).


-----  
Monument Location

This monument is located approximately 100' East of the bottom of small ravine and approximately 250' SW of a landing in the roots of an 18" alder stump 4' tall.

In the presence of Dan McNutt and Al Dvorak

March 20, 1991

Title:

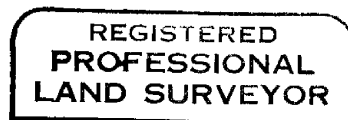

*Allan E. Duncan, C.S.*

