


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: Southeast corner of Section 10;	TOWNSHIP: 3 South	RANGE: 10 West
COUNTY: Tillamook		DATE: 7-17-07
CORNER DESIGNATION: Southeast corner of Section 10, Township 3 South, Range 10 West, W.M.		(Please check one)
		<input checked="" type="checkbox"/> Condition Report
		<input type="checkbox"/> Not Found
		<input type="checkbox"/> Renewed
		<input type="checkbox"/> Restoration
		<input type="checkbox"/> Rewitness
		<input type="checkbox"/> Referenced Out
Previous Rewitnesses, Restorations and Surveys, etc.: Rewitness Card numbers 605 and 608; Maps A-1008, A-1475, B-833, B-1085, B-1144.		
Found Monument(s) and Accessories (Condition & Source): Found a 3" diameter aluminum cap on a 2-1/2" diameter iron pipe in good condition, set by map B-833 and stamped as shown hereon. Found a 4' x 1-1/4" iron pipe on the ground. Also found a threaded 1" iron pipe with badly bent to the North. Found a 9" diameter Alder high stump, 6' tall with visible scribing in open face at record position – See Map B-833. Found a 39" diameter Hemlock high stump, 7' tall with healed face at record position – See Rewitness Card number 605. Found a 30" diameter Hemlock high stump, 7' tall with healed face at record position – See Rewitness Card number 605. Found a 17" diameter Hemlock high stump, 8' tall with healed face at record position – See Rewitness Card number 605. All of the original bearing trees are now gone. I set 120 pounds of concrete inside a 12" diameter plastic cylinder around the found monument.		
GPS position: Double-occupation results - Geodetic location: Latitude = 45° 19' 7.73582" N; Longitude = 123° 53' 2.28432" W Oregon State Plane Coordinates, North Zone NAD '83-'91: Northing = 620552.726; Easting = 7331918.734 Convergence = -2° 23' 59.50564" Scale Factor = 0.999898	Sketch of Found Monument: 	
Other new accessories set: Set 84" hat section post with yellow metal location tag 3' North of monument.		
New Bearing Trees: No new bearing trees were marked.		
Location & Comments: This corner is located approximately 20' East of a logging road in an area that has recently been logged.		
Firm/Agency: Tillamook County Surveyor's Office 201 Laurel Avenue, Tillamook, Oregon 97141		SURVEYOR'S SEAL
Party Chief: Danny R. McNutt, Tillamook County Surveyor		
Notes: This point is now a part of Tillamook County's secondary GPS control network as 'Sius' (Siuslaw).		
Witnesses: Danny R. McNutt; Joseph V. Jensen		

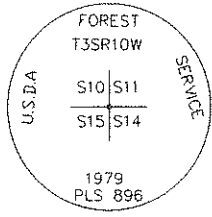