
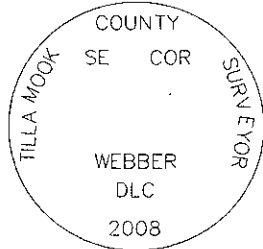


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: The Northwest ¼ of Section 1	TOWNSHIP 1 South	RANGE 10 West
COUNTY: Tillamook		DATE: 06-27-08
CORNER DESIGNATION: The Southeast Corner of the Geo. Webber Donation Land Claim #42 located in Section 1, Township 1 South, Range 10 West, W.M., Tillamook County, Oregon.		(Please check one)
		<input type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
		<input checked="" type="checkbox"/> Reset at surface
		<input type="checkbox"/> Referenced Out
Previous Rewitnesses, Restorations and Surveys, etc: Rewitness Book 6, Page 459; Rewitness Card #268; Tillamook County Survey Records.		
Found Monument(s) and Accessories (Condition & Source): Found a 3" diameter Tillamook County Brass Cap approximately 6" below the surface of the new pavement in a 10" diameter monument case, as described in Rewitness Book 6, Page 459, Tillamook County Survey Records. Found a 23" diameter Balm tree at record position (19" with bark scribing visible in Rewitness Book 6, Page 459), bark scribing now not visible. I also attached a new yellow metal bearing tree tag to the tree. Searched for and could not find 48" diameter low cut stump (Rewitness Book 6, Page 459). Found a 1" hex iron pipe (Rewitness Book 6, Page 459) at record distance. Searched for and could not find a disturbed ¾" inside diameter iron pipe (Rewitness Book 6, Page 459). Found the 84" hat section post at record position (N. 4° W. 22.3' in Rewitness Book 6, Page 459).		
Monument Set (Procedures and Description): I set a 2-1/2" diameter aluminum cap in concrete at road surface. The cap is stamped as shown hereon.	Sketch of Set Monument: 	
New accessories set: A new yellow metal Tillamook County Surveyor bearing tree tag was attached to the found 23" diameter Balm tree.		
New Bearing Trees: No new bearing trees were set.		
Location & Comments: This corner is located in the approximate centerline of Doughty County Road.		
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		SURVEYOR'S SEAL 
Party Chief: Joe Jensen, PLS 60067, Survey Supervisor		
Notes:		
Witnesses: Danny R. McNutt, PLS 49230, Tillamook County Surveyor.		

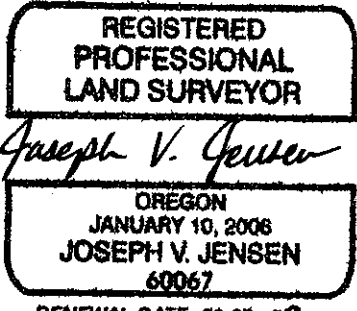