



**OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT**  
**Tillamook County Surveyor's Office**

<b>SECTION: SE Corner of Section 35</b>	<b>TOWNSHIP 2 South</b>	<b>RANGE 10 West</b>
<b>COUNTY: Tillamook</b>		<b>DATE: 01-26-09</b>
<b>CORNER DESIGNATION:</b> The Southeast Section Corner of Section 35 and the Southwest Section Corner of Section 36, T. 2 S., R. 10 W., W.M. Said corner is also on the North line of Section 2, T. 3 S., R. 10 W., W.M.		<b>(Please check one)</b>
		<input type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input checked="" type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
<b>Previous Rewitnesses, Restorations and Surveys, etc.:</b> B.L.M. Field Notes Volume: OR-R0053 Page: 0124 (G.L.O. 2S10 Page 6, 1856), B.L.M. Field Notes Volume: OR-R0272 Page: 0121 (G.L.O. 3S10 Page 16, 1882), *Field Notebook P1/95 (1955), Map B-738 (1976), Tillamook County Survey Records. *(P1/95, W.E. Anderson) is possibly in the wrong Township and Range.		<input type="checkbox"/> Reset <input type="checkbox"/> Referenced Out
<b>Found Monument(s) and Accessories (Condition &amp; Source):</b> Found 3" brass cap set on Map B-738 by Foeste, down 0.3', leaning badly. The monument is stamped as shown hereon. (G.L.O.) – Found no original evidence. (Map B-738) – Found 25" (was 18") dia. Fir Stump, 3' tall, scribing partially visible, used record bearing and distance to straighten monument. Stump bears (S 9° W 27.7') to face. (Map B-738) – Found badly rotten stump (was 20" Hemlock), scribing visible on pieces, bears (N 36° W 40.3'). (Map B-738) – Found rotten remains of (12" Hemlock), bears (N 54° E 52.6'). ( ) Indicates record from Map B-738, Tillamook County Survey Records.		
<b>Monument Set (Procedures and Description):</b> Not Applicable.	<b>Sketch of Found Monument:</b>  	
<b>Other new accessories set:</b> Set 120 lbs. of concrete in a 12" dia. cylinder around monument. Set a 72" hat section post with a yellow metal location tag, 2.0' North of monument.		
<b>New Bearing Trees:</b> *8" dia. Fir bears N 61° E 13.9', scribed "S36 BT", tagged and painted. *14" dia. Fir bears S 68° W 12.0', scribed "T3S R10W BT", tagged and painted. *12" dia. Fir bears N 67° W 17.2', scribed "T2S R10W S35 BT", tagged and painted. Note: All new bearing trees have an aluminum nail and washer marked, "Till. Co. Surveyor" in face between B and T. * Indicates a yellow metal location tag attached.		
<b>Location &amp; Comments:</b> This corner is located approximately 200' south of Yellow Fir mainline logging road at the bottom of a draw.		
<b>Firm / Agency</b> <b>Address:</b> TILLAMOOK COUNTY SURVEYOR'S OFFICE	<b>SURVEYOR'S SEAL</b>  <div style="border: 1px solid black; padding: 5px; display: inline-block;">           REGISTERED            PROFESSIONAL            LAND SURVEYOR         </div>  <div style="border: 1px solid black; padding: 5px; display: inline-block;">           OREGON            JANUARY 10, 2008            JOSEPH V. JENSEN            60867         </div> RENEWAL DATE: 08-30-09	
<b>Party Chief:</b> Joe Jensen, PLS 60067, Survey Supervisor		
<b>Notes:</b>		
<b>Witness:</b> Danny R. McNutt, PLS 49230, Tillamook County Surveyor Michael R. Rice, LSI 16723, Survey Technician		

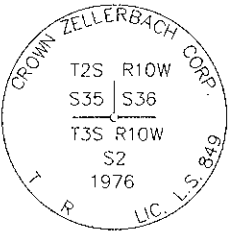