


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: 31	TOWNSHIP 3 North	RANGE 9 West
COUNTY: Tillamook		DATE: 1-29-09
CORNER DESIGNATION: The South Quarter Corner of Section 31, T. 3 N., R. 9 W., W.M. and the North Quarter Corner of Section 6, T. 2 N., R. 9 W., W.M.		(Please check one)
		<input type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input checked="" type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
		<input type="checkbox"/> Reset at surface
Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0259 Page 51-52 (GLO 3N9W Pg. 1) (1882), Book 4 Page 83 (1950), Book 1 Page 316 (1958), Rewitness Card #105 (1975), Book 7 Page 271 (1998), Tillamook County Survey Records.		<input type="checkbox"/> Referenced Out
Found Monument(s) and Accessories (Condition & Source): Found a 3" brass cap in cement in good condition. The monument is stamped as shown hereon. Found a hat section post with tag 1.5' northwesterly of monument. Found following bearing trees set by Anderson in Book 4, Page 83 in 1950. Post set by Anderson was N 60° W 6.4' from true corner point making bearings and distances to accessories in error per Book 1, Page 316. (Book 1, Page 316) – Found (70" Cedar Stump), 6' tall, bears (N 81° 30' W 66.3'), face rotten, yellow and white tag. (Book 1, Page 316) – Found (80" Cedar Stump), 10' tall, bears (S 47° W 103.3'), scribing visible, yellow tag. (Book 1, Page 316) – Found rotten remains (was 7" Alder), bears S 9° 30' W 22.6'. (Book 7, Page 271) – Found 1" Iron Pipe with a nail in wooden plug at record position, bears N 42° W 3.19'. () Indicates record information from Rewitness Book 1, Page 316, Tillamook County Survey Records.		
Monument Set (Procedures and Description): Not applicable.	Sketch of Found Monument: 	
New accessories set: Not applicable.		
New Bearing Trees set: *18" diameter Hemlock bears N 10° E 52.9', scribed "T3N R9W S31 1/4 BT", tagged and painted. *4" diameter Hemlock bears S 18° E 9.1', scribed "1/4 S6 BT", tagged and painted. * Indicates yellow metal location tag affixed to new bearing tree. All new bearing trees have a nail and aluminum washer marked, "Till. Co. Surveyor", in face of blaze, between the scribed B and T.		
Location & Comments: Corner is located approx. 80' South of a gravel logging road, approx. 20' North from the bottom of a gully.		SURVEYOR'S SEAL <div style="border: 1px solid black; padding: 5px; display: inline-block;"> REGISTERED PROFESSIONAL LAND SURVEYOR <i>Joseph V. Jensen</i> </div> <div style="border: 1px solid black; padding: 5px; display: inline-block;"> OREGON JANUARY 10, 2006 JOSEPH V. JENSEN 60067 RENEWAL DATE: 08-30-09 </div>
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		
Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor		
Notes:		
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor. Michael R. Rice, L.S.I. 16723, Survey Technician		

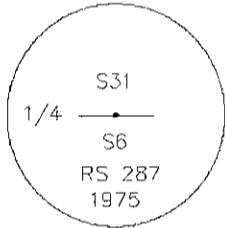