
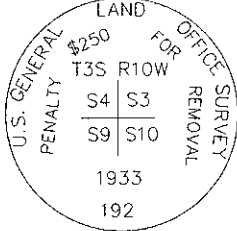


**OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT**  
Tillamook County Surveyor's Office

<b>SECTION: 3, 4, 9 and 10</b>	<b>TOWNSHIP 3 South</b>	<b>RANGE 10 West</b>
<b>COUNTY: Tillamook</b>		<b>DATE: 03-24-09</b>
<b>CORNER DESIGNATION:</b> The Section Corner to common 3, 4, 9 and 10.		<b>(Please check one)</b>
		<input type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input checked="" type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
		<input type="checkbox"/> Reset
		<input type="checkbox"/> Referenced Out
<b>Previous Rewitnesses, Restorations and Surveys, etc.:</b> BLM Field Note Volume: OR-R0272, Page 31 1882; BLM Field Note Volume: OR-R0545, Pages 131-132 1933; Rewitness Card #584, Rewitness Book 3 Pages 200-201; Map B-833, Map F-40-245, Tillamook County Survey Records.		
<b>Found Monument(s) and Accessories (Condition &amp; Source):</b> Found 2-1/2" GLO brass cap upright and in good condition. Placed 120 pounds of concrete and a 12" diameter plastic cylinder around monument. The monument is stamped as shown hereon. Found a rotten Hemlock stump with yellow metal location tag (Rewitness card #584 a 5' tall, 26" diameter Hem. stump N 26° E 8'), at record position. Found a rotten Hemlock stump, approximately 5' tall ( GLO 1882 - 10" Hem. S 82° E 18 links., marked "T3SR10WS10BT"; GLO 1933 - 20" Hemlock bears S 76° E, not S 82° E, 18 links marked "T3SR10WS10BT"; 1976 Rewitness card #584 25" Hem. stump 5' high with visible scribing bears S 78° E 18 links) at record position.		
<b>Monument Set (Procedures and Description):</b> Not Applicable.	<b>Sketch of Found Monument:</b>  	
<b>Other new accessories set:</b> Reset the found iron fencepost (See Rewitness card #584) with "National Forest Property Boundary" metal signs at N 24° E 2.9' from monument		
<b>New Bearing Trees:</b> * 16" diameter Hemlock tree which bears S 75° W 8.7', scribed "T3S R10W S9 BT", tagged and painted. * 13" diameter Douglas Fir tree which bears S 48° E 11.3', scribed "T3S R10W S10 BT", tagged and painted. * 14" diameter Douglas Fir tree which bears N 21° W 1.81', scribed "T3S R10W S4 BT", tagged and painted. * 10" diameter Hemlock tree which bears N 64° E 8.5', scribed "T3S R10W S3 BT", tagged and painted. All new Bearing Trees have a nail and aluminum washer marked, "Till. Co. Surveyor" in the face of scribe between the B and T. *Indicates yellow Tillamook County Corner tag affixed.		
<b>Location &amp; Comments:</b> This corner is located approximately 50' South of an existing logging road.		
<b>Firm / Agency</b> <b>Address:</b> TILLAMOOK COUNTY SURVEYOR'S OFFICE		<b>SURVEYOR'S SEAL</b>  
<b>Party Chief:</b> Joe Jensen, PLS 60067, Survey Supervisor		
<b>Notes:</b>		
<b>Witness:</b> Danny R. McNutt, PLS 49230, Tillamook County Surveyor Michael R. Rice, LSI 16723, Survey Technician		

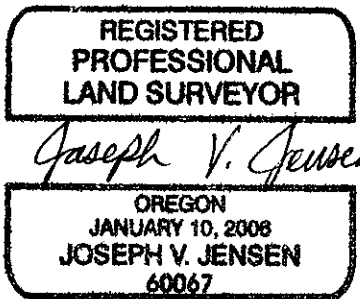