
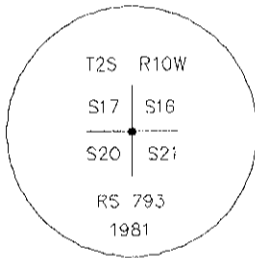


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: 16,17,20,21	TOWNSHIP 2 South	RANGE 10 West
COUNTY: Tillamook		DATE: 7-16-09
CORNER DESIGNATION: The Section Corner common to Sections 16, 17, 20 and 21.		(Please check one)
		<input type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input checked="" type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
		<input type="checkbox"/> Reset at surface
<input type="checkbox"/> Referenced Out		
Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0053 Page 404 (GLO 2S10 Page 19) (1857), BLM Field Notes Volume: OR-R0272 Page 92 (1882), Rewitness Book 10 Page 111 (1893), Map A-782 (1958), Map A-774 (1958), Map A-1933 (1970), Rewitness Card #462 (1981), Tillamook County Survey Records.		
Found Monument(s) and Accessories (Condition & Source): Found a 3" dia. Tillamook County Brass Cap, up 0.5', good condition. The monument was set in Rewitness Card #462 (1981). The monument is stamped as shown hereon. Found an iron pipe lying next to the monument, a hat section post with a yellow metal location tag 1.5' South of monument and a white painted cedar post 0.8' West of the monument. (Original G.L.O. 1857) – Found 36" dia. (was 30") Spruce Stump bears (S 59° E 29 lks. [19.14'] dist.), no scribing visible, nail in blaze. (Original G.L.O. 1857) – Found 40" dia. (was 30") Hemlock Stump bears (N 66° E 18 lks. [11.88'] dist.), no scribing visible, face rotten. (Original G.L.O. 1857) – Did not find the (Spruce 60 in dia bears N 68° W 25 lks. [16.5'] dist.). (Original G.L.O. 1857) – Did not find the (Spruce 40 in dia bears S 70° W 89 lks. [58.74'] dist.). (Rewitness Card #462) – Found 30" dia. (was 20") Hemlock, bears (N 12° W 64.25'), healed scar and "Do Not Cut" tag grown in. () Indicates record information, Tillamook County Survey Records. [] Indicates converted value from links to feet.		
Monument Set (Procedures and Description): Not applicable.	Sketch of Found Monument: 	
New accessories set: Set 120 lbs. of concrete in a 12" dia. cylinder, around monument.		
New Bearing Trees set: *16" dia. Hemlock bears N 8°30' E 14.4', scribed "T2S R10W S16 BT", tagged and painted. *16" dia. Spruce bears S 45° E 43.0', scribed "T2S R10W S21 BT", tagged and painted. *23" dia. Spruce bears S 63°30' W 35.7', scribed "T2S R10W S20 BT", tagged and painted. * Indicates a yellow metal location tag and aluminum nail with washer marked "Till. Co. Surveyor" on the face.		
Location & Comments: Corner is located approx. 200' south of the end of Stimson logging road #150F.		SURVEYOR'S SEAL <div style="border: 1px solid black; padding: 5px; width: fit-content; margin: 0 auto;"> REGISTERED PROFESSIONAL LAND SURVEYOR </div>  <div style="border: 1px solid black; padding: 5px; width: fit-content; margin: 0 auto;"> OREGON JANUARY 10, 2008 JOSEPH V. JENSEN 60067 </div> RENEWAL DATE: 06-30-2011
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		
Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor		
Notes: Digital images were taken of the monument, the found bearing trees, and the new bearing trees.		
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician		

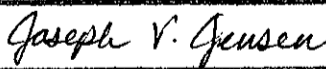