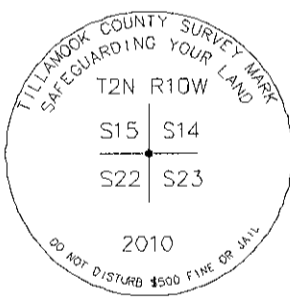
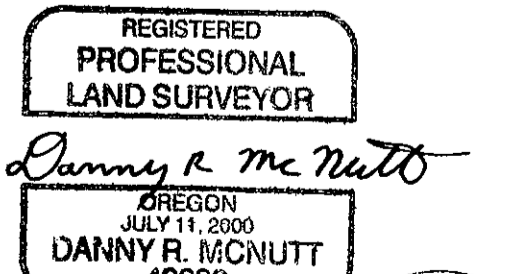


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: SE COR 15	TOWNSHIP 2 North	RANGE 10 West
COUNTY: Tillamook		DATE: 4-21-10
CORNER DESIGNATION: The Section Corner common to Sections 14, 15, 22 and 23, T. 2 N., R. 10 W., W.M.		(Please check one)
		<input type="checkbox"/> Condition Report Only
		<input checked="" type="checkbox"/> Restoration
		<input type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
		<input type="checkbox"/> Re-set at surface
<input type="checkbox"/> Referenced Out		
Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0122 Page 123, (GLO Book 2N10 Page 25) (1873), Map B-380 (1958), Tillamook County Survey Records.		
Found Monument(s) and Accessories (Condition & Source): Upon initial search we found no evidence of the original G.L.O. or Map B-380 accessories. After reviewing Field Note Book #10, Page 13 of John Carlich's notes for Map B-380, we found that he had set the corner stated above in error before finding the original G.L.O. bearing trees. A new search was performed in which we found a stump pattern that fit his accessories in error and his topographic calls. We then calculated the position of the found G.L.O. accessories per Carlich's Field Notes in Book #14, Page 5. At the newly computed position we found two rusted yellow metal location tags approximately three feet east of the coordinate. Also, the stump pattern called for on Map B-380. The topographic calls match Field Book #14 as well. There was no monument found. We set a new monument at the position. The monument is stamped as shown hereon. The monument was conventionally tied using GPS established control. The Oregon North Zone State Plane in NAD 83/91 grid coordinate for the monument is N = 740963.214, E = 7336559.848 U.S. Survey Feet. <p>(G.L.O.) – Did not find the (Hemlock 4" dia. bears S 37° E 4 lks. [2.64']), Carlich Field Book #14 found (Snag 40' high, 14" dia., face rotted) at record position.</p> <p>(G.L.O.) – Did not find the (Hemlock 9" dia. bears N 86° E 9 lks. [5.94']), Carlich Field Book #14 found (Stump 18" high, 30" dia., rotted) at record position.</p> <p>(G.L.O.) – Did not find the (Hemlock 15" dia. bears S 89° W 5 lks. [3.30']), Carlich Field Book #14 found (Stump 3' high, 15" dia., scribing "BT" evident & visible low on stump) at record position.</p> <p>(Map B-380) – Found rotten Hemlock Stump (was 18"), bears (S 30° E 18.78'), no marks visible.</p> <p>(Map B-380) – Found rotten Hemlock Stump (was 24"), bears (S 32° W 13.71'), no marks visible.</p> <p>(Map B-380) – Did not find the (Hemlock 20" dia. N 37°15'W 28.60'), falls in landing.</p> <p>(Map B-380) – Found rotten Spruce Stump (was 28"), bears (N 58°15' E 32.87'), no marks visible.</p> <p>() Indicates record information, Tillamook County Survey Records. [] Indicates converted value from links to feet.</p>		
Monument Set (Procedures and Description): Using the stump pattern of Map B-380, we set a 3" dia. Tillamook County Brass Cap on a 1 1/2" Iron Pipe, 30" long, up 0.5' at record distances from found Carlich B.T.'s.	Sketch of Set Monument: 	
New accessories set: Set a 12" dia. cylinder around monument, with 240 lbs. of concrete. Set a 72" hat section post with yellow metal location tag 2' South of the monument.		
New Bearing Trees set: *24" dia. D. Fir bears S 22° E 19.7', scribed "T2N R10W S23 BT", tagged and painted. *20" dia. D. Fir bears S 47° W 37.5', scribed "T2N R10W S22 BT", tagged and painted. *16" dia. D. Fir bears N 80° W 26.6', scribed "T2N R10W S15 BT", tagged and painted. * Indicates a yellow metal location tag affixed, as well as an aluminum nail with a washer marked, "Till. Co. Surveyor" in the face between the scribed "B" and "T".		
Location & Comments: Monument is located on a SSW'y gentle slope approx. 50' south of a landing.		
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		SURVEYOR'S SEAL 
Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor		
Notes: Digital images were taken of the set monument, the found bearing trees, and the new accessories.		
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician		