


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

| | | |
|---|---|--|
| SECTION: East 1/4 corner of Section 10 | TOWNSHIP 2 South | RANGE 10 West |
| COUNTY: Tillamook | | DATE: 11-15-10 |
| CORNER DESIGNATION: The one-quarter corner common to Sections 10 and 11, T. 2 S., R. 10 W., W.M. | | (Please check one) |
| | | <input type="checkbox"/> Condition Report Only |
| | | <input type="checkbox"/> Restoration |
| | | <input checked="" type="checkbox"/> Rewitness |
| | | <input type="checkbox"/> Unrecorded |
| | | <input type="checkbox"/> Reset |
| <input type="checkbox"/> Referenced Out | | |
| Previous Rewitnesses, Restorations and Surveys, etc.: B.L.M. Field Notes Volume: OR-R0272 Pages: 0082 and 0083, (G.L.O. 2S10 Page 45, 1882); Rewitness Book 1, Page 410 (1960), Map B-562, Map A-860, Tillamook County Survey Records. | | |
| Found Monument(s) and Accessories (Condition & Source): Found 3" Oregon State Board of Forestry brass cap in good condition. Placed a 12" diameter plastic cylinder and 120 pounds of concrete around monument. The monument is stamped as shown hereon. Found the very rotten remains of a 4" x 4" wood post lying on ground next to the monument. Found an iron fence post with a yellow metal location tag South 1.0' from the monument. (G.L.O.) – 20" diameter Hemlock tree bearing S 30° E 7 links is now gone. (G.L.O.) – 10" diameter Hemlock tree bearing S 20° W 10 links is now gone. (Rewitness Book 1, Page 410) – Found a 6' tall x 42" diameter Hemlock stump, very rotten with partial scribing visible; found at record position, (was a 27" diameter Hemlock tree bearing N 38-1/2° E 13.0'). (Rewitness Book 1, Page 410) – Found a 6' tall Hemlock stump with a yellow metal location tag, rotten and laying on the ground, (was a 38" diameter Hemlock tree bearing S 25° W 28.6'). | | |
| Monument Set (Procedures and Description): Not Applicable. | Sketch of Found Monument:  | |
| Other new accessories set: Placed a yellow metal location tag on a found white painted fence post. The post bears South 4° West 111' from the found monument and is located on the West edge of an existing gravel logging road. Set a 72" Hat Section Post with a yellow metal location tag at North 3.0' from monument. | | |
| New Bearing Trees: *15" dia. Hemlock tree bears N 55° 30' E 8.4', scribed "T2SR10W1/4S11BT", tagged and painted. *10" dia. Hemlock tree bears N 22° W 20.9', scribed "T2SR10W1/4S10BT", tagged and painted. *17" dia. Hemlock tree bears S 01° W 26.2', scribed "T2SR10W1/4S10BT", tagged and painted. Note: All new bearing trees have a nail and aluminum washer marked, "Till. Co. Surveyor" in face between B and T. * Indicates a yellow metal location tag attached. | | |
| Location & Comments: This corner is located approximately 50' Westery of an existing logging road. Yellow plastic monument tags marked "PLEASE PROTECT NEARBY SURVEY MARKER" were placed on trees along the road. | | |
| Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE | | SURVEYOR'S SEAL |
| Party Chief: Joe Jensen, PLS 60067, Survey Supervisor | | REGISTERED PROFESSIONAL LAND SURVEYOR |
| Notes: Digital images were taken of the monument and the new accessories. | | <i>Joseph V. Jensen</i> |
| Witness: Danny R. McNutt, PLS 49230, Tillamook County Surveyor Michael R. Rice, LSI 16723, Survey Technician | | OREGON JANUARY 10, 2006 JOSEPH V. JENSEN 60067 |

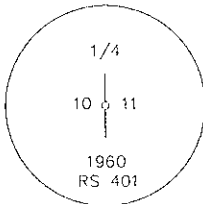