


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: Center 1/4 corner Section 14	TOWNSHIP 4 South	RANGE 7 West	
COUNTY: Tillamook		DATE: 09-01-11	
CORNER DESIGNATION: The Center One-Quarter Corner, Section 14, T. 4 S., R. 7 W., W.M.		(Please check one)	
		<input type="checkbox"/>	Condition Report Only
		<input type="checkbox"/>	Restoration
		<input checked="" type="checkbox"/>	Rewitness
		<input type="checkbox"/>	Unrecorded
		<input type="checkbox"/>	Reset at surface
Previous Rewitnesses, Restorations and Surveys, etc: Survey map number A-1614, Tillamook County Survey Records.			
Found Monument(s) and Accessories (Condition & Source): Found a 3/4" iron pipe, 1.0' above the ground and leaning to the Northwest. (Map A-1614) – Found a 27" diameter x 2-1/2' tall Fir stump and a tin cap, scribing visible at top of face, bottom of face rotted away, stump is located at record position, (was a 24" diameter Fir bearing N 24° W 38.4'). (Map A-1614) – Found a very rotten 27" diameter x 2.0' tall Fir stump with a B.L.M. tag attached to top of stump, but with no tin cap, stump is located at record position, (was a 27" diameter Fir bearing S 61° E 67.5'). Map A-1614) – Found a 27" diameter x 2-1/2' tall Fir stump and a tin cap, scribing visible on a part of a healed face, stump is located at record position, (was a 25" diameter Fir bearing N 72° W 29.5'). (Map A-1614) – Found a 28" diameter x 6' tall Fir stump with a healed face, stump is located at record position, (was a 22" diameter Fir bearing S 34° W 15.0'). () Indicates record information from Map A-1614, Tillamook County Survey Records. [] Indicates conversion from links to feet.			
Monument Set (Procedures and Description): We referenced the position of the found iron pipe and set a 3" diameter Tillamook County Brass cap on a 2-1/2" x 30" galvanized iron pipe. The monument is stamped as shown hereon. Placed a 12" diameter plastic cylinder filled with 120 pounds of concrete around the set monument.		Sketch of Set Monument: 	
New accessories set: Set a 72" hat section post 1.8' West of monument, Reset a found steel fence post North 1.9' from monument.			
New Bearing Trees set: 7" diameter Fir tree scribed "C1/4S14BT" which bears North 83° West 15.8'. Yellow metal bearing tree tag nailed to the tree. 7" diameter Fir tree scribed "C1/4S14BT" which bears South 17° West 7.6'. Yellow metal bearing tree tag nailed to the tree. 7" diameter Fir tree scribed "C1/4S14BT" which bears South 61° East 32.7'. Yellow metal bearing tree tag nailed to the tree.			
Location & Comments: The corner is located approximately 200' South of an existing logging road.			
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		SURVEYOR'S SEAL <div style="border: 1px solid black; padding: 5px; width: fit-content; margin: 0 auto;"> REGISTERED PROFESSIONAL LAND SURVEYOR </div> <p align="center"><i>Joseph V. Jensen</i></p> <div style="border: 1px solid black; padding: 5px; width: fit-content; margin: 0 auto;"> OREGON JANUARY 10, 2008 JOSEPH V. JENSEN 60067 </div> <p align="center"><small>RENEWAL DATE: 08-30-2013</small></p>	
Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor, Deputy County Surveyor			
Notes: Digital images were taken of the found monument, the new monument, the record bearing trees and new accessories.			
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician			

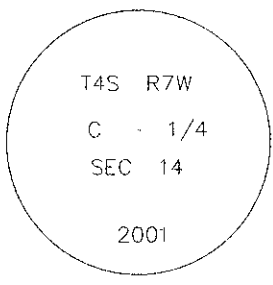