

OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: The East 1/4 corner of Section 4	TOWNSHIP 2 South	RANGE 9 West
--	-------------------------	---------------------

COUNTY: Tillamook	DATE: 08-26-15
--------------------------	-----------------------

CORNER DESIGNATION: The Quarter Corner common to Sections 4 and 3, Township 2 South, Range 9 West, W.M., Tillamook County, Oregon.	(Please check one) <input type="checkbox"/> Condition Report Only <input type="checkbox"/> Restoration <input checked="" type="checkbox"/> Rewitness <input type="checkbox"/> Unrecorded <input checked="" type="checkbox"/> Reset at surface <input type="checkbox"/> Referenced Out
---	---

Previous Rewitnesses, Restorations and Surveys: Rewitness Card #353; Rewitness Book 7, Page 81, Tillamook County Survey Records.


Found Monument(s) and Accessories (Condition & Source): The 3" diameter Tillamook County Brass Cap and monument case as described in Rewitness Book 7, Page 81, were removed for asphalt paving. New power pole was set at position of pole number 048503. Found 96" hat section post North 48° East 50.6' in good condition and at record position and as described in Rewitness Book 7, Page 81. Found garage corner at the Southeast garage foundation at record position and as described in Rewitness Book 7, Page 81. Found power pole number 048503 at record position and as described in Rewitness Book 7, Page 81. Found a punch mark and chiseled triangle on top of a fire hydrant North 59° East 46.94' at record position and as described in Rewitness Book 7, Page 81.

Monument Set (Procedures and Description): We set a 2" diameter brass cap in concrete at the surface of the new asphalt. The monument is stamped "Tillamook County Surveyor 1/4 S4 S3 2015". The position was established by averaging two separate GPS observations taken at the corner prior to removal. GPS control was used to stake out and set the new monument. Tillamook County NGS HARN Station "Prairie" was used as the control base station for the GPS control points used to stakeout and set the new monument.

The horizontal coordinate datum is NAD '83-'91, Oregon North Zone State Plane Coordinate, U.S. Foot.
 Northing = 658777.785
 Easting = 7359514.733

WGS 84 Geographic:
 Latitude = 45°25'36.08952"
 Longitude = 123°46'58.10525"

Convergence = -2°19'41.13096", Combined Scale Factor = 0.99990605.

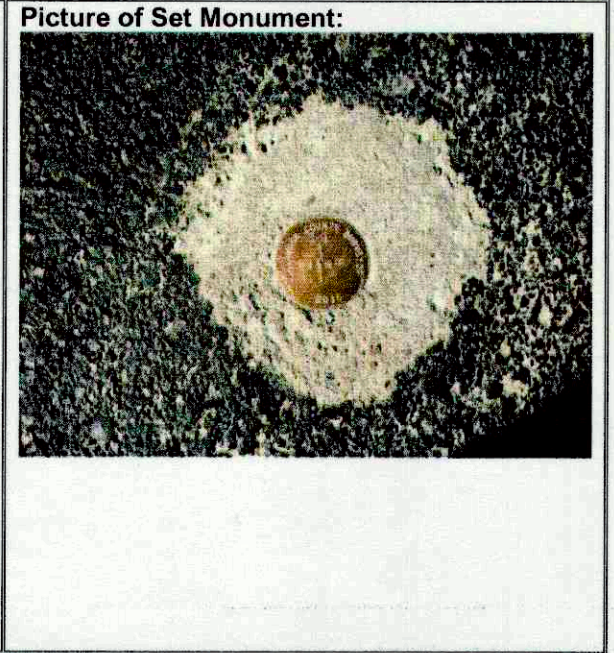

New accessories set: Monument spikes with center punch were set 1.54 feet North and 1.25 West from the monument as reference markers.

New Bearing Trees: No bearing trees were marked.

Location & Comments: The monument is located at the centerline-centerline intersection of Long Prairie Road and Brickyard Road.

Firm / Agency
Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE
 201 Laurel Avenue
 Tillamook, Oregon 97141

Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor

Notes: Digital photographs were taken of the new monument.

Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor.
 Michael R. Rice, P.L.S. 86926, Survey Technician

SURVEYOR'S SEAL

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Joseph V. Jensen

OREGON
JANUARY 10, 2009
JOSEPH V. JENSEN
60067

RENEWAL DATE: 08-30-2017

