


TILLAMOOK COUNTY SURVEYORS OFFICE

1/4 corner common to sections 25 and 36 T.2S..R.10W..W.M.

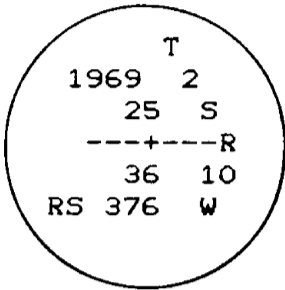

I found a 3/4" iron pipe 5' long with a 3" Crown Zellerbach brass cap 36" high in pile of logs. I sawed the logs out and lowered the cap to approximately 4" above the ground and encased in a 10" concrete cylinder. (See Tillamook County Surveyors rewitness book 3 page 301).

History of found Monument

I found this monument to be as reported on the above said rewitness, and the accessories found and/or set at that time to now be as follows:

Original 14" spruce N.88*E. 58 lks., reported as found rotting stump scribed "BT"; (Found, now an uprooted, rotten, approximately 12" diameter stump remains).

Original 12" spruce S.10*W. 57 lks., reported as found rotting stump scribed "BT"; (Found, remains of now rotten approximately 8" diameter stump leaning NW, scribing "1/4S BT" still visible).

16" fir N.39*E. 41.8': (Found, now 19" stump 4' high, scribing visible on partially healed, rotten face. Found yellow "do not cut" tag attached).

14" fir S.75*W. 23.7': (Found, now 20" stump 5' high, face overgrown. Found yellow do not cut tag attached).

* Indicates yellow Tillamook County corner tag affixed.

Surveys and rewitnesses of reference:

- A-165 1918 G. E. Davis Deputy County Surveyor
- B-737 1976 Carl F. Foeste L.S.849
- B-738 1976 Carl F. Foeste L.S.849
- Field notebook "P16" page 47 1915 C.A. Dunn.
- Rewitness book 3 page 301 1969 Charles G. Collard R.S.376.
- Rewitness book 6 page 11 1976 Carl F. Foeste L.S.849.


Monument Location

This corner is located approximately 300' West of an old landing on the NW edge of a small creek course N.55*E. Creek is full of down logs. Area has been clear cut 5-10 years ago.

In the presence of Dan McNutt & Al Dvorak

September 13, 1990

Title

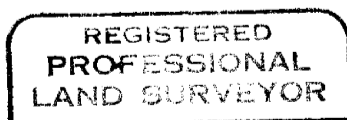

Allan E. Duncan, C.S.

