

OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

BOOK 8 209

SECTION: 29	TOWNSHIP: 1 South	RANGE: 9 West
COUNTY: Tillamook		DATE: 04/2023
CORNER DESIGNATION: The Southeast Corner of Haynes Donation Land Claim #43 in Section 29, Township 1 South, Range 9 West, Willamette Meridian, Tillamook County, Oregon.		(Please check one)
		<input type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input checked="" type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
		<input type="checkbox"/> Reset at surface
		<input type="checkbox"/> Referenced Out

Previous Rewitnesses, Restorations and Surveys, etc... BLM Field Note Volume: OR-D0036 Page 452 (1859), A-288 (1948), A-938 (1961), A-2079 (1971), Rewitness Card #238 (1972), B-1316 (1988), P-273 (1995), P-587 (2000).

History, condition, and sources: In 1859 (BLM Field Note Volume: OR-D0036 Page 452) N. Ford set post for the Southeast Corner of the Haynes DLC and established 2 Bearing Trees. In 1961 (A-938) John L. Carlich did not find referenced "Iron Pin" on his survey. No historical records in the Tillamook County Survey Records refer to an "Iron Pin" being set. In 1971/1972 (A-2079, Rewitness Card #238) John L. Carlich calculated and set a 2" Iron Pipe with a 3" Tillamook County Brass Cap in tile and concrete for the Southeast Haynes DLC Corner and added a Hat Section Post and a 3/4" Iron Rod in root for an accessory. In 1988 (B-1316) Dale Barrett found the Southeast Haynes Corner with guard post West 3'. In 2000 (P-587) Terry L. Jones found the Southeast Haynes Corner with Hat Section Post West 2'. In 2008, Tillamook County Surveyor's office moved Hat Section back to position and added Tag. In 2023, Tillamook County Surveyor's Office found a 3" Tillamook County Surveyor's Brass Cap stamped "HAYNES D.L.C. S.E. COR" in concrete in good condition as shown hereon.

Not Found: (BLM Field Note Volume: OR-D0036 Page 452) 6" Alder, N 10° E 45 Links
 Not Found: (BLM Field Note Volume: OR-D0036 Page 452) 13" Alder, N 50° E 28 Links
 Not Found: (Rewitness Card #238) 3/4" Iron Rod, N 89° 24' 35" W 41.49'
 Found: (Rewitness Card #238) Hat Section Post West 2.0'.

New accessories set:
 The Monument was tied directly using G.P.S. established control. The coordinates have been converted and are provided here in WGS 84, Latitude and Longitude.
 Latitude: 45° 27' 01.55"
 Longitude: -123° 48' 50.24"

Pictures of Found Monuments:



Location: 21.0' East of centerline of Marolf Loop County Road on Easterly projection of E-W fence line across road from Corner

Tillamook County Surveyor's office: 1510 3rd Street Suite C, Tillamook, OR. 97141

Party Chief: Travis Porter, Tillamook County Surveyor's Office

Witnesses: Michael Rice, P.L.S. 86926, Tillamook County Surveyor
 Kael Poklikuha, Tillamook County Survey Technician


Notes: Digital images taken of monument and accessories.

SURVEYOR'S SEAL

REGISTERED
 PROFESSIONAL
 LAND SURVEYOR

OREGON
 DECEMBER 11, 2012
 MICHAEL R. RICE
 86926

RENEWAL 12-31-2026

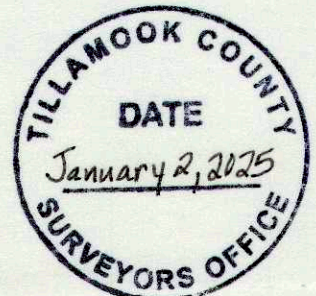

BOOK 8 209