

CHAINS

RESTORED CORNER FOR OREGON STATE BOARD OF FORESTRY

One-quarter corner common to Sections 19 and 24,  
T3S, Rgs. 9 & 10 W.; W.M.; Tillamook County, Oregon.

ORIGINAL 1880

Stone 8"x5"x4" and mound of stone (missing)

RESURVEY 1882

Set post (now missing) from which a:

5" V. Maple bears N52°W 22 lks.; 14.5 ft.; now missing,  
point falls in cat road.

6" Hem. bears N59°E 9 lks.; 5.9 ft.; now 27" stump,  
8" high, scribes  $\frac{1}{4}$  S B visible, rest unexposed.

RESTORED

Var. 21 $\frac{1}{2}$ °

Set 1 $\frac{1}{2}$ " x 36" galvanized iron pipe with 3" bronze cap  
marked "OREGON STATE BOARD OF FORESTRY  $\frac{1}{4}$  S24 S19 1956  
RS 359," 32 inches in ground, and from which a:

72" fir stump bears N69°E 42.4 ft.; scribed  $\frac{1}{4}$  S19 BT.


25" fir bears N16°W 97.5 ft.; scribed  $\frac{1}{4}$  S24 BT RS 359.

Oregon State Board of Forestry metal location poster on  
25" Fir BT.

Set 4"x4"x60" white painted Cedar post 1.5 ft. NW of pipe.

Dated December 7, 1956.

Restored by Richard A. Morris under my direction.  
Richard A. Morris, Transitman

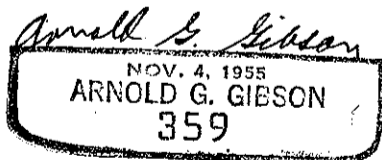

Present and witnessed by Lloyd Geraths  
Robert Sturm