


RESTORATION OF THE QUARTER CORNER COMMON TO
SECTIONS 20 AND 21, T3N, R10W, W.M.

At the corner I find a 3/4" iron pipe, top 2" above ground, set by P. L. Thompson on February 13, 1951, recorded on County Survey B-299 and B.T. Record Book 2, Page 115; from which original B.T.'s scribed by C. J. Handley in September 1873 bear as follows: The 24" spruce at N 25° E 22 links is now a rotten 2' tall 36" spruce stump that bears N 28° E 14.3 feet to estimated face position. The 15" spruce at N 60° W 11 links is now a rotten 3' tall 16" hemlock stub with portion of overgrown face. I cut this face open and find original scribe marks "BT" visible. Said B.T.'s are in place as reported by Handley. The 5' spruce stump reported by P. L. Thompson at S 82° W 22.5 feet is in place, but the scribing is no longer visible.

I removed Thompson's pipe, which measured 36" long, and in its place I set a 2" x 36" concrete filled galvanized iron pipe, top 2" below ground, with a 3" brass cap stamped "T3N R10W 1/4 S20 S21 1996 LS 849", from which I scribed B.T.'s as follows: A 9" hemlock bears N 47° E 8.20 feet to 8" spike below face scribed "1/4 S21 B.T." An 8" hemlock bears S 22° E 6.00 feet to 8" spike below face scribed "1/4 S21 B.T." A 16" hemlock bears S 42° W 24.55 feet to 8" spike below face scribed "1/4 S20 B.T." A 20" hemlock bears N 24° W 21.38 feet to 8" spike below face scribed "1/4 S20 B.T." Nailed 3/4" brass washer stamped "LS 849" in face of each B.T. Set steel fence post with location tag 2 feet north. Laid Thompson's pipe along east side of brass cap.

PRESENT: K. FOESTE, A. HOFMANN, AND L. HOFMANN

DATE: June 21, 1996

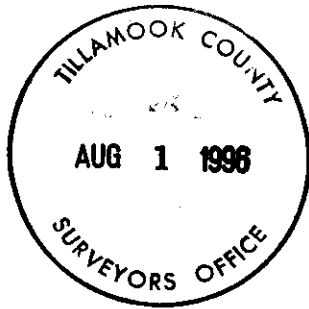

RENEWS 1/1/98