

B A Y S I D E S U R V E Y I N G

11765 HWY 101 South
Tillamook, Oregon 97141

Terry L. Jones
503-842-5551

April, May, June & July, 1997

SECTION CORNER COMMON TO SECTIONS
3, 4, 9 AND 10, T1S, R8W, W.M.

I found 9" X 10" X 17" stone with 3 notches and 4 notches(GLO 10" X 10" X 16" stone with 3 notches and 5 notches) , 3 feet downhill from mound of stone, creek, runs South, is 222 feet East(GLO 3 chains), and ridge, runs East-West is 610.5 feet North(GLO 9.25 chains), no evidence of bearing tree.

I set a (SODF) monument, 3 3/4" aluminum cap inscribed "STATE OF OREGON DEPARTMENT OF FORESTRY", on a 1 1/2" X 30" aluminum pipe, stamped "T1S R8W S3 S4 + S9 S10 1997 LS 2507", with magnet inside, in the center of the stone mound, on Southeast slope 775 feet North of power transmission line.

NEW ACCESSORIES


34" Douglas Fir scribed "T1S R8W S3 BT" on low face bears North 20° East 47.82 feet to brass nail and washer stamped "LS 2507" between the B & T;

13" Douglas Fir scribed "T1S R8W S4 BT" on low face bears North 42° West 12.50 feet to brass nail and washer stamped "LS 2507" between the B & T;

12" Alder bark scribed "T1S R8W S10 BT" Bears South 6° East 24.95 feet to brass nail and washer stamped "LS 2507" between the B & T;

11" Alder bark scribed "T1S R8W S9 BT" Bears South 75° West 41.61 feet to brass nail and washer stamped "LS 2507" between the B & T;

Orange carsonite posts 5' East and 5' West

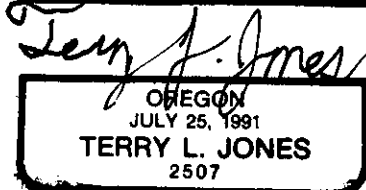

RENEWAL DATE 6-30-99