
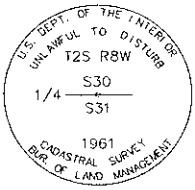


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: The South ¼ of Section 30	TOWNSHIP 2 South	RANGE 8 West
COUNTY: Tillamook		DATE: 12-30-09
CORNER DESIGNATION: The one-quarter common to Sections 30 and 31, Township 2 South, Range 8 West, W.M., Tillamook County, Oregon. The Bureau of Land Management brass cap was set by proportionate measurement in 1961. No evidence was found of the original corner which was a 12" X 10" X 9" Basalt Stone set 8" in the ground. The intent of this rewitness is to perpetuate the 1961 proportionate position of this corner.	(Please check one)	
	<input type="checkbox"/>	Condition Report Only
	<input type="checkbox"/>	Not Found
	<input checked="" type="checkbox"/>	Rewitnessed
	<input type="checkbox"/>	Unrecorded
<input type="checkbox"/>	Surveyed In	
<input type="checkbox"/>	Referenced Out	
Previous Rewitnesses, Restorations and Surveys, etc.: BLM Field Note Volume: OR-R0266 Page: 0678.0 (1883); G.L.O. Book 2S8 Page 43 (1883), Tillamook County Survey Records; BLM Field Note Volume: OR-R0574 Page: 495.0 (1961);		
Found Monument(s) and Accessories (Condition & Source): Found a rotten 20" diameter Hemlock tree on ground with a yellow metal location tag still attached (1961 - was an 11" diameter Hemlock bears S. 39° W., 25 lks.); Found a 16" diameter, 15' tall Douglas Fir snag with no visible marks (1961 - was a 6" diameter fir tree which bears North 18° East, 4 ½ lks., marked ¼ S30 BT). 4 ½ lks. = 2.97' 25 lks. = 16.5' GPS coordinates obtained by single occupation using Sokkia GSR2700ISX Dual Frequency Receivers: Northing = 633119.963, Easting = 7376778.613, NAD '83/91, Oregon North Zone State Plane Coordinates, U.S. Survey Foot.		
Monument Set (Procedures and Description): Not applicable	Sketch of Found Monument: 	
Other new accessories set: Set a hat section post with metal location tag South 3.0' from monument.		
New Bearing Trees: A 5" diameter Douglas Fir tree which bears N 19° W 17.9', scribed, "1/4 S31 BT", tagged and painted. Rescribed the found 16" diameter, 15' tall Douglas Fir snag with a 'B T' which bears N 18° E 2.97', tagged and painted. All new bearing trees have a nail and aluminum washer marked, "Till. Co. Surveyor", in face of blaze, between the scribed B and T, and a yellow metal location tag affixed.		
Location & Comments: Corner is located approximately 300' South of a spur road coming off of Simmons Ridge Road.		
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE		SURVEYOR'S SEAL 
Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor		
Notes: Digital images were taken of the found monument and monument accessories.		
Witness: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor, Michael R. Rice, L.S.I. 16723, Survey Technician		

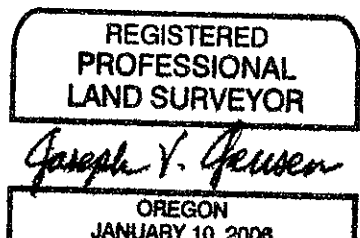