
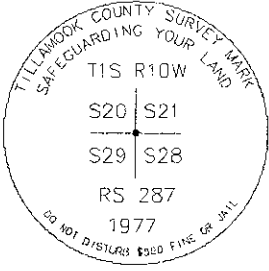


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: SE Cor. 20	TOWNSHIP 1 South	RANGE 10 West	
COUNTY: Tillamook		DATE: 10-26-11	
CORNER DESIGNATION: The Section Corner common to Sections 20, 21, 28 and 29, T. 1 S., R. 10 W., W.M.		(Please check one)	
		<input type="checkbox"/>	Condition Report Only
		<input type="checkbox"/>	Restoration
		<input checked="" type="checkbox"/>	Rewitness
		<input type="checkbox"/>	Unrecorded
		<input type="checkbox"/>	Reset at surface
		<input type="checkbox"/>	Referenced Out
Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0337 Page 277-278, (GLO Book 1S10 Page 78) (1890), Rewitness Card #310 (1977), Map B-771 (1977), Map A-8099 (2006), Partition Plat P-941 (2009), Map A-8388 (2011), Tillamook County Survey Records.			
Found Monument(s) and Accessories (Condition & Source): Found 3" dia. Tillamook County Brass Cap in a 10" tile and concrete cylinder. Found a hat section post with yellow metal location tag, East 1.5' from monument. Found a white painted cedar post lying near monument. (GLO) – Did not find the (30" Hemlock bears S 85° E 28 lks. [18.48']). (GLO) – Did not find the (10" Hemlock bears S 31 1/2° W 32 lks. [21.12']). (GLO) – Did not find the (36" Hemlock bears N 31° W 45 lks. [29.70']). (GLO) – Did not find the (30" Hemlock bears N 42° E 59 lks. [38.94']). (Crown Zellerbach Notes) – Found rotten stub, was (7" Hemlock bears N 16° E 6.5'). (Crown Zellerbach Notes) – Found root hole, was (24" Hemlock bears S 40° E 10.7'). (Crown Zellerbach Notes) – Found rotten Hemlock stub, was (25" Hemlock bears S 56° E 19.2'), back cast of "BT" visible. () Indicates record information, Tillamook County Survey Records. [] Indicates record links converted to feet.			
Monument Set (Procedures and Description): N/A		Sketch of Found Monument: 	
New Accessories set: N/A			
New Bearing Trees Marked: *10" dia. Hemlock bears S 30° W 5.0', scribed "S29BT", tagged and painted. *10" dia. Hemlock bears S 66° E 13.3', scribed "T1SR10WS28BT", tagged and painted. * 8" dia. Hemlock bears N 72° E 5.5', scribed "S21BT", tagged and painted. *10" dia. Fir bears N 63° W 27.8', scribed "T1SR10WS20BT", tagged and painted. * Indicates an aluminum nail with washer marked, "Till. Co. Surveyor" in the face of the blaze between the scribed "B" and "T". Also, a yellow metal location tag affixed in an upper blaze.			
Location & Comments: Monument is located approx. 470' northerly from lighthouse county quarry.			
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		SURVEYOR'S SEAL 	
Party Chief: Joe Jensen, P.L.S. 60067, Deputy County Surveyor			
Notes: Digital images were taken of the monument and its accessories.			
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician			

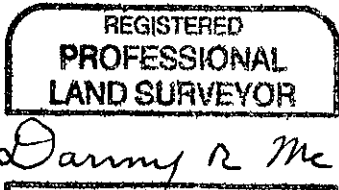