
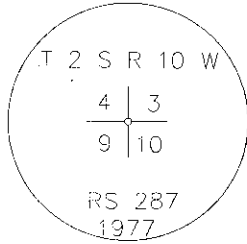


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: Southeast corner of Section 4	TOWNSHIP 2 South	RANGE 10 West
COUNTY: Tillamook		DATE: 03-11-13
CORNER DESIGNATION: Section corner common to Sections 3, 4, 9, and 10, Township 2 South, Range 10 West, W.M.		(Please check one)
		<input checked="" type="checkbox"/> Condition Report Only
		<input checked="" type="checkbox"/> GPS Session
		<input type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
		<input type="checkbox"/> Surveyed In
Previous Rewitnesses, Restorations and Surveys, etc.: Rewitness Book 7, Page 459; Rewitness card number 441; Rewitness Book 1, Page 96, Rewitness Book 4, Page 89, Rewitness Book 5, Page 72, Survey maps B-45, B-243, B-659, B-658, Tillamook County Survey Records.		
Found Monument(s) and Accessories (Condition & Source): Found a 3" diameter Tillamook County Brass cap in concrete and in good condition and stamped as shown hereon. Found a hat section post located North 1.5' Found a Spruce stump (80" in Rewitness Book 4, Page 89) with a yellow metal location tag at record position. GPS observations were taken on March 11, 2013. NGS published HARN Station "Prairie" was used as based station control. Sokkia GSR2700 ISX Dual-Frequency GPS Receiver System. The coordinates are provided here in WGS84 Latitude and Longitude. Latitude: North 45° 25' 13.10283"; Longitude: West 123° 54' 24.67056".		
Monument Set (Procedures and Description): Not Applicable.	Sketch of Found Monument: 	
New accessories set: No new accessories set. There are no bearing trees close enough to the corner to mark due to a recent logging.		
Bearing Trees: All of the bearing trees established in Rewitness Book 7, Page 459 and described below are now 5' to 6' stumps with healed faces and yellow metal bearing tree tags 17" diameter Spruce tree scribed "T2SR10WS4BT" with a nail and aluminum washer stamped "TILL.CO.SURVEYOR" which bears North 58° West 31.0'. 22" diameter Douglas Fir tree scribed "T2SR10WS10BT" with a nail and aluminum washer stamped "TILL.CO.SURVEYOR" which bears South 55° East 56.1'. 15" diameter Twin Hemlock tree scribed "T2SR10WS9BT" with a nail and aluminum washer stamped "TILL.CO.SURVEYOR" which bears South 67° West 12.6'. 14" diameter Hemlock tree scribed "T2SR10WS3BT" with a nail and aluminum washer stamped "TILL.CO.SURVEYOR" which bears North 4° East 7.7'.		
Location & Comments: This corner monument is located approximately 150' East of the existing road #100.		
Firm / Agency: Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		SURVEYOR'S SEAL  <small>RENEWAL DATE: 06-20-</small>
Party Chief: Joe Jensen, Survey Supervisor		
Notes:		
Witness: Danny R. McNutt, Tillamook County Surveyor		

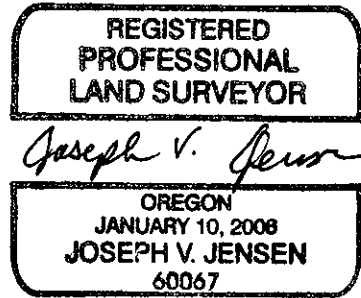